TECHNICAL SERVICE BULLETIN							
l	DATE ISSUED	MODEL YEAR(S) AFFECTED		MODEL(S) AFFECTED		TSB #	
12/28/2011		2012		See models listed below		392	
BRAND						Т	YPE
All		King Aire	\mathbf{X}	Mountain Aire		All 🗖	ТТП
		Dutch Sta	r 🗖	Kountry Aire		FW□	САП
		Kountry S	tar 🛛	Essex	X	DP⊠	D B 🗖
Sco	ttsdale 🛛	Northern	Star 🛛	London Aire		DIM	
□ Air Conditioning & Heating ⊠ Electrical Components							
	Appliances & Accessories			Exterior Components			
	Cabinets & Furnit	□ Interior Comp	□ Interior Components				
	Chassis Components			Plumbing & Bath Components			
	Construction Components			Windows, Awnings, Vents, & Doors			
DESCRIPTION OF PROBLEM							
Certain 2012 Essex and King Aire motor homes require an undate to the Silverleaf system. Silverleaf has issued a new firmware							

Certain 2012 Essex and King Aire motor homes require an update to the Silverleaf system. Silverleaf has issued a new firmware version release V1.07 for the TM-250 AC Load Module.

This is to correct a display issue with the outside temperature. When the outside temperature drops below 32 degrees F, the sensor has potential to error and the display goes to -459

RECOMMENDED SOLUTION

If this error is identified: The following part below will need to be ordered from Newmar under this TSB #. The TM-250 module will be preprogrammed for each motor home. The original TM-250 module will need to be returned to Newmar.

After the module replacement, the technician should push the features button on the front Silverleaf screen, then scroll down to the component versions to verify that the module is being read as a TM-250 v1.07.

- Labor time: 0.4
- Flat rate code: TSB 392
- Newmar Part# 116090NR
- Vendor Part# TM-250 Module Description AC Load Manager V1.07