1301 STAHLEY DRIVE BUILDING #42 NAPPANEE, IN 46550

NEWMAR CORPORATION WARRANTY DEPARTMENT

Dealer Svc. 866-290-5371 Customer Svc. 800-731-8300

TEC	CHNI	CAL SE	RV	ICE B	ULLETIN						
DATE ISS	SUED	Model Yea	R(S) A	TSB#							
04/10/2015			4-2015		Recall 15V-149 TSB 416						
BRAND											
Bay Star Sport		Ventana		Essex	X						
Bay Star		Dutch Star		King Aire	X						
Canyon Star		Mountain Aire	X	Other							
Ventana LE		London Aire	X								
		DESC	RIPT	'ION							
Safety Act. Newmar Corporation AM Equipment Framel arm connector when we wisibility which could reduced to the could reduced to the could reduced to the could reduced to the could reduce to the could redu	n has decided t ess style windsl viper system is o esult in a crash. in this recall ind	hat a defect which relationship in the high specific persons at the high specific persons and the high specific persons are the high specific persons at the high specific persons are the	es to mot 02-2320 s ed setting	tor vehicle safety e upplied for Newma g. If the wiper syste	National Traffic and Motor Vehicle exists in specific motor homes. For coaches may separate from wiper fails, the operator will have reduced and 11/11/2014.						
These motor h	omes require i	mmediate service. Cont	<mark>inued us</mark>	e poses a potential	safety hazard.						
		RECOMMEN	NDE	ACTION	I						
REPAIR PROCEDURE Please reference AM E	de to all custordless of vehicles	omers/owner vehicles is age, vehicle mileage, of the mileage mileage, of the mileage contact the mileage c	r owners	hip at the time of r							
US NHTSA# 15V CAN Recall # 201					<u>te code</u> – 15V-149 <u>'ime</u> – replace 0.1 hrs ea. 302-1320						

Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.



Technical Service Bulletin

Notice of wiper blade replacement requirement

To: Newmar Corporation and Dealer Network

From: AM Equipment Date: 2/19/2015

This bulletin describes a <u>required</u> wiper blade replacement on the specific 2014 and 2015 model year Newmar coaches listed in this bulletin

Frameless style windshield wiper blades P/N 302-2320 supplied on designated coaches may separate from wiper arm connector when wiper system is operated at the high speed setting.

Frameless wiper blades P/N 302-2320 <u>MUST</u> be immediately replaced with framed wiper blades P/N 302-1320 supplied with this service bulletin.

To comply with this service bulletin;

1. Remove frameless blade 302-2320 from wiper arm, driver and passenger side. DISPOSE OF REMOVED BLADES



To Remove Frameless Blade


- 1. Lift plastic cover to expose arm hook.
- 2. Squeeze plastic clip
- 3. Push blade back to remove from arm








2. Install framed blade 302-1320 on wiper arm, driver and passenger side.

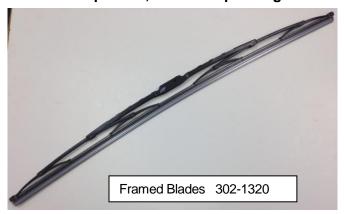

To Install Framed Blade

- 1 Orient the plastic retainer to the locking nib faces the down towards the glass
- 2 Slide hook of arm around blade plastic retainer
- 3 "CLICK" blade into place. Test to insure blades has locked onto the hook securely
- 4 Remove protective from rubber part of blade

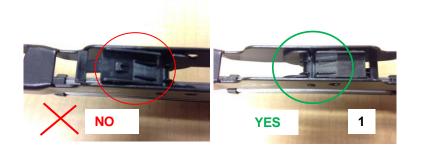







AM Equipment Technical Service Line – 541-327-1546 PO Box 790, 402 E. Hazel Jefferson Oregon 97352 **www.amequipment.com**

Vehicles affected by this bulletin

Product ID	Year	Brand	Туре	Model	Product ID	Year	Brand	Туре	Model
501121	2015	LA	DP	4553	530287	2015	KG	DB	4599
501124	2015	LA	DP	4553	530288	2015	KG	DB	4553
501125	2015	LA	DP	4553	530289	2015	KG	DB	4553
501126	2015	LA	DP	4553	530290	2015	KG	DB	4503
501127	2015	LA	DP	4553	530291	2015	KG	DB	4553
501128	2015	LA	DP	4553	801095	2014	EX	DP	4553
501129	2015	LA	DP	4553	801098	2015	EX	DP	4544
501130	2015	LA	DP	4553	801099	2015	EX	DP	4553
501132	2015	LA	DP	4503	801100	2015	EX	DP	4508
501133	2015	LA	DP	4503	801101	2015	EX	DP	4553
501134	2015	LA	DP	4503	801102	2015	EX	DP	4503
501135	2015	LA	DP	4553	801103	2015	EX	DP	4553
501136	2015	LA	DP	4553	801104	2015	EX	DP	4553
501137	2015	LA	DP	4553	801105	2015	EX	DP	4503
501138	2015	LA	DP	4553	801106	2015	EX	DP	4553
501139	2015	LA	DP	4553	801107	2015	EX	DP	4503
501140	2015	LA	DP	4553	801108	2015	EX	DP	4503
501141	2015	LA	DP	4553	801109	2015	EX	DP	4553
501142	2015	LA	DP	4503	801110	2015	EX	DP	4503
501143	2015	LA	DP	4553	801111	2015	EX	DP	4553
501144	2015	LA	DP	4553	801112	2015	EX	DP	4553
501145	2015	LA	DP	4553	801113	2015	EX	DP	4553
501146	2015	LA	DP	4553	801114	2015	EX	DP	4553
501147	2015	LA	DP	4553	801115	2015	EX	DP	4503
501148	2015	LA	DP	4503	801116	2015	EX	DP	4553
501149	2015	LA	DP	4553	801117	2015	EX	DP	4553
501150	2015	LA	DP	4553	801118	2015	EX	DP	4553
501151	2015	LA	DP	4503	801120	2015	EX	DP	4553
501152	2015	LA	DP	4553	801121	2015	EX	DP	4553
501154	2015	LA	DP	4599	801122	2015	EX	DP	4553
501155	2015	LA	DP	4503	801123	2015	EX	DP	4503
501156	2015	LA	DP	4553	801124	2015	EX	DP	4553
501157	2015	LA	DP	4553	801125	2015	EX	DP	4553
501158	2015	LA	DP	4553	801127	2015	EX	DP	4503
501158	2015	LA	DP	4553	801128	2015	EX	DP	4553
501159	2015	LA	DP	4503	801129	2015	EX	DP	4503
501160	2015	LA	DP	4553	801130	2015	EX	DP	4503
501163	2015	LA	DP	4553	801132	2015	EX	DP	4503
501164	2015	LA	DP	4503	801133	2015	EX	DP	4503

CONTINUED

Product ID	Year	Brand	Туре	Model	Product ID	Year	Brand	Туре	Model
501168	2015	LA	DP	4553	801134	2015	EX	DP	4553
501170	2015	LA	DP	4599	801135	2015	EX	DP	4553
501172	2015	LA	DP	4503	904245	2015	MA	DP	4501
501173	2015	LA	DP	4553	904266	2015	MA	DP	4369
501174	2015	LA	DP	4553	904267	2015	MA	DP	4503
501175	2015	LA	DP	4503	904268	2015	MA	DP	4553
501177	2015	LA	DP	4553	904269	2015	MA	DP	4553
501178	2015	LA	DP	4553	904270	2015	MA	DP	4553
501179	2015	LA	DP	4553	904271	2015	MA	DP	4503
501180	2015	LA	DP	4553	904273	2015	MA	DP	4553
501181	2015	LA	DP	4553	904274	2015	MA	DP	4503
501181	2015	LA	DP	4503	904275	2015	MA	DP	4553
501182	2015	LA	DP	4599	904276	2015	MA	DP	4553
501183	2015	LA	DP	4553	904277	2015	MA	DP	4503
501184	2015	LA	DP	4553	904278	2015	MA	DP	4553
501185	2015	LA	DP	4553	904279	2015	MA	DP	4553
501186	2015	LA	DP	4503	904280	2015	MA	DP	4553
501187	2015	LA	DP	4553	904281	2015	MA	DP	4553
501191	2015	LA	DP	4553	904282	2015	MA	DP	4503
501192	2015	LA	DP	4553	904284	2015	MA	DP	4503
501205	2015	LA	DP	4553	904285	2015	MA	DP	4553
530232	2015	KG	DB	4553	904286	2015	MA	DP	4553
530257	2015	KG	DB	4593	904287	2015	MA	DP	4503
530258	2015	KG	DB	4593	904288	2015	MA	DP	4553
530261	2015	KG	DB	4593	904288	2015	MA	DP	4503
530263	2015	KG	DB	4593	904289	2015	MA	DP	4553
530264	2015	KG	DB	4593	904291	2015	MA	DP	4553
530265	2015	KG	DB	4584	904292	2015	MA	DP	4503
530266	2015	KG	DB	4599	904293	2015	MA	DP	4503
530267	2015	KG	DB	4584	904294	2015	MA	DP	4553
530268	2015	KG	DB	4553	904295	2015	MA	DP	4503
530269	2015	KG	DB	4553	904297	2015	MA	DP	4553
530270	2015	KG	DB	4553	904299	2015	MA	DP	4553
530271	2015	KG	DB	4503	904300	2015	MA	DP	4503
530272	2015	KG	DB	4553	904302	2015	MA	DP	4503
530273	2015	KG	DB	4553	904303	2015	MA	DP	4553
530274	2015	KG	DB	4503	904305	2015	MA	DP	4553
530275	2015	KG	DB	4503	904306	2015	MA	DP	4503
530276	2015	KG	DB	4553	904307	2015	MA	DP	4553
530277	2015	KG	DB	4553	904309	2015	MA	DP	4568

CONTINUED

Product ID	Year	Brand	Туре	Model	Product ID	Year	Brand	Туре	Model
530278	2015	KG	DB	4503	904311	2015	MA	DP	4553
530279	2015	KG	DB	4553	904312	2015	MA	DP	4503
530280	2015	KG	DB	4553	904313	2015	MA	DP	4553
530281	2015	KG	DB	4553	904314	2015	MA	DP	4553
530282	2015	KG	DB	4553	904315	2015	MA	DP	4568
530283	2015	KG	DB	4553	904316	2015	MA	DP	4553
530284	2015	KG	DB	4553	904317	2015	MA	DP	4553
530285	2015	KG	DB	4553	904318	2015	MA	DP	4568
530285	2015	KG	DB	4503	904319	2015	MA	DP	4503
X	Х	Х	Х	X	904331	2015	MA	DP	4553

END