

NEWMAR CORPORATION

WARRANTY

DEPARTMENT

TECHNICAL SERVICE BULLETIN

DATE ISSUED	MODEL YEAR(S) AFFECTED	TSB #
12/27/2017	2017, 2018	498

MODEL

Bay Star Sport	☐	Ventana	☐	Essex	☒
Bay Star	☐	Dutch Star	☐	King Aire	☒
Canyon Star	☐	Mountain Aire	☐	New Aire	☐
Ventana LE	☐	London Aire	☒	Other	☐

DESCRIPTION

Newmar has decided to incorporate a system reset switch for coaches equipped with HWH hydraulic entrance steps. The switch has been added to the front overhead cabinet during production on later 2018 models.

If the HWH system fails to operate the pump assembly when using the leveling system touchpad, slideout switches, or the entrance step, this reset switch will provide the coach owner with a more convenient location for resetting the HWH system. This will eliminate the need to pull the F-11 fuse or exit the coach to turn off the chassis disconnect in the event of a system lockout.

Issue: In the event of a step failure, the person(s) inside the coach would have a large gap between the door threshold and the ground. The person(s) may have to exit via the large gap or the emergency exit door to get out of the coach.

Correction: A reset switch and label will be installed in the front overhead cabinet.

Refer to the attached population list for the affected coach and VIN numbers.

RECOMMENDED ACTION

Call your Service Account Manager to obtain authorization and order the parts. Follow the attached work instructions to complete the reset switch installation and testing.

Flat Rate Code: TSB 498

Labor Time: 1.5 hr.

Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.

How to Install an HWH Reset Switch

Relevant Coaches

Model: King Aire, Essex, London Aire

Year(s): 2017, 2018

Floorplan: All

Issue

TSB 498 provides instructions for installing an HWH step reset switch. This switch will provide the coach owner with a more convenient location for resetting the HWH system rather than pulling the fuse or cycling the chassis disconnect switch outside the coach.

Action

Follow the service procedure below to correct the condition. The approximate time to complete this procedure is 1.5 hours.

Necessary Tools & Replacement Parts

Wire Crimper
Wire Stripper
Screw Gun with Square and Phillips Bits
Fish Tape
12 Volt Tester
Caulk Gun

Part Name	Part Quantity	Newmar Part Number
16 Gauge Red Wire	30 ft	24219
Sticker	1 ea	141017
Switch	1 ea	140311
Blue Butt Connector Terminals	2 ea	107151
Wire Ties	7 ea	10643
1/4" Conduit	6 ft	138810
Black Screws	2 ea	135623
Blue Female Spade Terminals	2 ea	107187
Black Silicone	1 ea	24114

Service Procedure

Installing the Switch

1. Open the A-pillar on the driver side of the coach.
2. Remove the small piece between the dash and the A-pillar cover. Set it aside.



3. Remove the screws in the A-pillar.
4. Pull the A-pillar cover down and away enough to expose the A-pillar wiring chase.
5. Disconnect the speaker wires if necessary.



6. Mark a spot in the driver's overhead cabinet to install the switch and sticker. Note: The exact location may vary, so choose a spot where the switch and sticker will fit.



7. Remove the panel in the front overhead cabinet.

8. Drill a 1 3/8" hole.


9. Install the switch into the panel with two black self-tapping screws.



10. Run the wire from the overhead cabinet to the driver's side front electrical compartment.

- If necessary, use fish tape to assist in pulling wires.
- Use a flexible conduit on wires between the front compartment and the A-pillar wiring chase.


11. Strap the wires and flexible conduit as needed to hold them in place and to prevent shade interference.

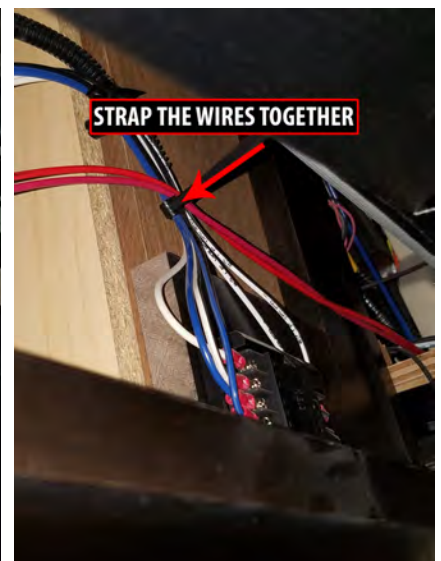

12. Reinstall the A-pillar cover and panel in the front overhead.
13. Install the sticker.



14. Hook up wires at the KIB fuse panel.
15. Locate the connector J3 and pin 6. Verify that you have the correct one by checking it with a test light while pulling the F-11 fuse.
16. Reinstall the F-11 fuse.
17. Cut the wire, and strip each end. This wire may already be cut and connected to a red wire with a white stripe. If it is, cut the butt connector out, and strip each wire.
18. Connect one of the new wires to the J3 pin 6 (F-11).
19. Connect the other wire to the step control wire that normally goes to pin 6 (F-11).

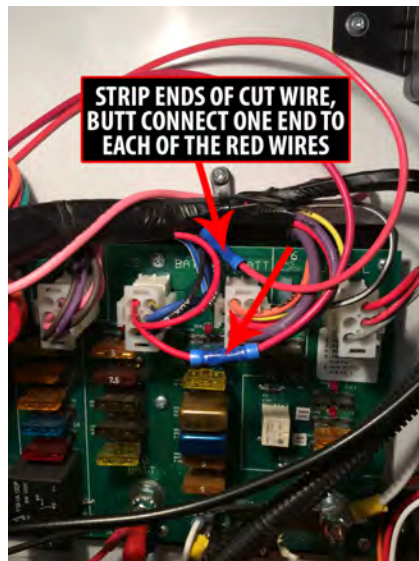

Testing the Switch

1. Turn on the HWH panel.
2. Press and hold the reset switch for five seconds.
3. Check to make sure the panel lights turn off while pressing the reset switch.
4. Test the switches and panels in the front overhead cabinet to make sure that no wires were pulled off during the switch installation process.

Prod#	VIN Number	Year	Brand	Type	Floor	Chassis	Date In Production	Date Off Production
501327	4VZVU1E90HC081288	2017	LA	DP	4513	S	12/9/2015	12/16/2015
501337	4VZVU1E94HC081133	2017	LA	DP	4553	S	2/10/2016	2/18/2016
501339	4VZVU1E99HC082214	2017	LA	DP	4533	S	5/12/2016	5/20/2016
501440	4UZFCTBG3HCHZ7804	2017	LA	DP	4553	FL	5/31/2016	6/9/2016
501441	4UZFCTBG1HCHZ7803	2017	LA	DP	4553	FL	5/24/2016	6/2/2016
501442	4VZVU1E94HC082217	2017	LA	DP	4533	S	5/27/2016	6/8/2016
501443	4VZVU1E95HC082663	2017	LA	DP	4519	S	9/12/2016	9/20/2016
501444	4VZVU1E96HC082882	2017	LA	DP	4519	S	10/24/2016	11/1/2016
501445	4VZVU1E95HC082436	2017	LA	DP	4553	S	6/24/2016	7/12/2016
501446	4VZVU1E98HC082446	2017	LA	DP	4519	S	7/11/2016	7/19/2016
501447	4VZVU1E96HC082445	2017	LA	DP	4519	S	6/3/2016	6/13/2016
501448	4UZFCTBG0HCJA0484	2017	LA	DP	4553	FL	6/13/2016	6/21/2016
501449	4UZFCTBG9HCJA4758	2017	LA	DP	4519	FL	7/13/2016	7/21/2016
501450	4UZFCTBG8HCJC3155	2017	LA	DP	4519	FL	8/15/2016	8/22/2016
501451	4UZFCTBGXHCJC3156	2017	LA	DP	4533	FL	8/18/2016	8/25/2016
501452	4UZFCTBGXHCJA2887	2017	LA	DP	4519	FL	6/28/2016	7/14/2016
501453	4UZFCTBG8HCJA2886	2017	LA	DP	4513	FL	6/13/2016	6/22/2016
501454	4VZVU1E97HC082437	2017	LA	DP	4519	S	6/29/2016	7/15/2016
501455	4UZFCTBG7HCJC0649	2017	LA	DP	4553	FL	8/9/2016	8/17/2016
501456	4UZFCTBG8HCJC3110	2017	LA	DP	4553	FL	8/1/2016	8/8/2016
501457	4UZFCTBG4HCJA6756	2017	LA	DP	4533	FL	7/14/2016	7/22/2016
501458	4VZVU1E93HC082502	2017	LA	DP	4539	S	8/10/2016	8/18/2016
501459	4UZFCTBG6HCJA6757	2017	LA	DP	4519	FL	7/26/2016	8/3/2016
501460	4UZFCTBG1HCJC3157	2017	LA	DP	4519	FL	8/19/2016	8/29/2016
501461	4VZVU1E96HC082641	2017	LA	DP	4519	S	9/7/2016	9/15/2016
501462	4VZVU1E91HC082613	2017	LA	DP	4519	S	8/26/2016	9/6/2016
501463	4VZVU1E94HC082668	2017	LA	DP	4553	S	9/13/2016	9/21/2016
501464	4UZFCTBG4HCJD1348	2017	LA	DP	4525	FL	8/29/2016	9/7/2016
501465	4VZVU1E92HC082796	2017	LA	DP	4525	S	9/23/2016	10/3/2016
501466	4UZFCTBG5HCHX0278	2017	LA	DP	4553	FL	12/13/2016	12/20/2016
501467	4VZVU1E94HC082802	2017	LA	DP	4533	S	9/30/2016	10/10/2016
501468	4UZFCTBGXHCJC8180	2017	LA	DP	4519	FL	10/14/2016	10/24/2016
501469	4UZFCTBG6HCJD1349	2017	LA	DP	4553	FL	10/19/2016	10/27/2016
501470	4UZFCTBG0GCHV9302	2017	LA	DP	4535	FL	11/2/2016	11/10/2016
501471	4UZFCTBG3HCJC8179	2017	LA	DP	4553	FL	10/10/2016	10/17/2016
501472	4UZFCTBG5HCJE7011	2017	LA	DP	4519	FL	10/12/2016	10/20/2016
501473	4UZFCTBG3HCHX0280	2017	LA	DP	4519	FL	1/13/2017	1/20/2017
501474	4VZVU1E91HC083115	2017	LA	DP	4553	S	12/6/2016	12/14/2016
501478	4VZVU1E93HC082886	2017	LA	DP	4513	S	11/11/2016	11/21/2016
501479	4UZFCTBG2HCHY3568	2017	LA	DP	4519	FL	11/8/2016	11/16/2016
501480	4UZFCTBG4GCHW1411	2017	LA	DP	4519	FL	11/7/2016	11/15/2016
501481	4VZVU1E98HC083080	2017	LA	DP	4535	S	11/22/2016	12/1/2016
501482	4UZFCTBG1HCHX0276	2017	LA	DP	4519	FL	11/18/2016	11/29/2016
501483	4VZVU1E9XHC083081	2017	LA	DP	4535	S	11/29/2016	12/6/2016
501484	4VZVU1E91HC083308	2017	LA	DP	4553	S	2/8/2017	2/15/2017
501485	4VZVU1E99HC083153	2017	LA	DP	4519	S	12/20/2016	1/12/2017
501486	4VZVU1E9XHC083307	2017	LA	DP	4519	S	2/9/2017	2/16/2017

501487	4UZFBTGG7HCHX0279	2017	LA	DP	4553	FL	2/13/2017	2/20/2017
501488	4VZVU1E98HC083192	2017	LA	DP	4519	S	1/9/2017	1/17/2017
501489	4UZFBTGG8HCHY6233	2017	LA	DP	4513	FL	2/20/2017	2/27/2017
501490	4UZFBTGG7HCHJF6664	2017	LA	DP	4553	FL	3/8/2017	3/16/2017
501491	4UZFBTGG3HCHX0277	2017	LA	DP	4525	FL	2/28/2017	3/8/2017
501492	4UZFBTGG1HCHJG0712	2017	LA	DP	4519	FL	3/20/2017	3/27/2017
501493	4UZFBTGG0JCJD9866	2018	LA	DP	4531	FL	1/13/2017	1/23/2017
501494	4UZFBTGG1JCJN9984	2017	LA	DP	4519	FL	4/4/2017	4/12/2017
501495	4VZVU1E98HC083323	2017	LA	DP	4519	S	4/3/2017	4/10/2017
501496	4UZFBTGG9HCHJF4379	2017	LA	DP	4519	FL	2/22/2017	3/2/2017
501497	4UZFBTGG5HCHJF4380	2017	LA	DP	4533	FL	2/24/2017	3/3/2017
501498	4VZVU1E96JC082869	2018	LA	DP	4534	S	2/23/2017	3/3/2017
501499	4UZFBTGG9HCHJF6665	2017	LA	DP	4519	FL	3/10/2017	3/20/2017
501500	4UZFBTGG3JCJP0405	2017	LA	DP	4553	FL	4/17/2017	4/25/2017
501501	4UZFBTGG5JCJP0406	2017	LA	DP	4519	FL	5/4/2017	5/12/2017
501502	4VZVU1E98HC083600	2017	LA	DP	4519	S	5/5/2017	5/15/2017
501503	4VZVU1E95HC083733	2017	LA	DP	4519	S	5/12/2017	5/22/2017
501504	4UZFBTGG5JCJR6603	2018	LA	DP	4531	FL	5/22/2017	6/2/2017
501506	4VZVU1E96JC084086	2018	LA	DP	4531	S	8/18/2017	8/28/2017
501507	4UZFBTGG1JCJR8347	2018	LA	DP	4535	FL	6/23/2017	7/11/2017
501508	4VZVU1E9XJC083765	2018	LA	DP	4531	S	6/12/2017	6/20/2017
501509	4UZFBTGG9JCJT1852	2018	LA	DP	4553	FL	7/21/2017	7/31/2017
501510	4VZVU1E9XJC084074	2018	LA	DP	4553	S	8/2/2017	8/10/2017
501511	4VZVU1E98JC084395	2018	LA	DP	4531	S	9/28/2017	10/6/2017
501513	4UZFBTGG6JCJU4946	2018	LA	DP	4534	FL	8/16/2017	8/24/2017
501515	4UZFBTGG7JCJU2249	2018	LA	DP	4531	FL	8/29/2017	9/7/2017
501516	4UZFBTGG1JCJS6791	2018	LA	DP	4534	FL	7/12/2017	7/20/2017
501517	4VZVU1E98JC084333	2018	LA	DP	4553	S	9/25/2017	10/3/2017
501518	4VZVU1E91JC083766	2018	LA	DP	4531	S	6/14/2017	6/22/2017
501519	4VZVU1E96JC083777	2018	LA	DP	4531	S	6/27/2017	7/14/2017
501520	4VZVU1E97JC083786	2018	LA	DP	4553	S	6/29/2017	7/18/2017
501523	4VZVU1E93JC084157	2018	LA	DP	4535	S	9/1/2017	9/12/2017
501525	4VZVU1E97JC083898	2018	LA	DP	4533	S	7/28/2017	8/7/2017
501526	4VZVU1E91JC084304	2018	LA	DP	4553	S	9/11/2017	9/19/2017
501527	4VZVU1E99JC084440	2018	LA	DP	4553	S	10/3/2017	10/11/2017
501530	4UZFBTGG5JCJV6165	2018	LA	DP	4535	FL	9/22/2017	10/2/2017
501531	4VZVU1E94JC084085	2018	LA	DP	4553	S	8/14/2017	8/22/2017
501534	4UZFBTGG6JCJX7056	2018	LA	DP	4531	FL	10/16/2017	10/24/2017
501535	4UZFBTGG3JCJT8411	2018	LA	DP	4553	FL	8/7/2017	8/15/2017
501538	4UZFBTGG0JCJW7509	2018	LA	DP	4531	FL	10/4/2017	10/12/2017
501539	4VZVU1E96JC084394	2018	LA	DP	4531	S	9/26/2017	10/4/2017
501540	4UZFBTGG4JCJX0543	2018	LA	DP	4533	FL	10/11/2017	10/19/2017
501541	4VZVU1E90JC084519	2018	LA	DP	4535	S	10/19/2017	10/27/2017
501545	4UZFBTGG8JCJX7057	2018	LA	DP	4535	FL	10/26/2017	11/3/2017
501548	4VZVU1E99JC084518	2018	LA	DP	4533	S	10/25/2017	11/2/2017
530361	4VZVU1E92HC081132	2017	KG	DB	4519	S	1/22/2016	2/1/2016
530365	4VZVU1E90HC081131	2017	KG	DB	4584	S	2/9/2016	2/17/2016
530371	4VZVU1E92HC082216	2017	KG	DB	4519	S	5/13/2016	5/25/2016

530372	4VZVU1E92HC082278	2017	KG	DB	4519	S	7/12/2016	7/20/2016
530373	4VZVU1E90HC082277	2017	KG	DB	4584	S	6/20/2016	6/28/2016
530374	4VZVU1E95HC082369	2017	KG	DB	4519	S	8/2/2016	8/10/2016
530375	4VZVU1E98HC082219	2017	KG	DB	4533	S	7/28/2016	8/5/2016
530376	4VZVU1E99HC082939	2017	KG	DB	4553	S	11/1/2016	11/9/2016
530377	4VZVU1E95HC082498	2017	KG	DB	4513	S	8/15/2016	8/23/2016
530378	4VZVU1E98HC082558	2017	KG	DB	4519	S	8/25/2016	9/2/2016
530379	4VZVU1E9XHC082559	2017	KG	DB	4533	S	8/30/2016	9/8/2016
530380	4VZVU1E94HC082797	2017	KG	DB	4553	S	9/21/2016	9/29/2016
530381	4VZVU1E95HC082565	2017	KG	DB	4553	S	9/14/2016	9/22/2016
530382	4VZVU1E91HC082370	2017	KG	DB	4519	S	9/16/2016	9/26/2016
530383	4VZVU1E96HC082803	2017	KG	DB	4519	S	9/26/2016	10/4/2016
530384	4VZVU1E98HC082804	2017	KG	DB	4519	S	9/29/2016	10/7/2016
530385	4VZVU1E94HC082833	2017	KG	DB	4519	S	10/13/2016	10/21/2016
530386	4VZVU1E95HC082887	2017	KG	DB	4584	S	10/11/2016	10/19/2016
530387	4VZVU1E9XHC083193	2017	KG	DB	4533	S	12/22/2016	1/16/2017
530388	4VZVU1E9XHC082805	2017	KG	DB	4519	S	10/5/2016	10/13/2016
530389	4VZVU1E96HC083045	2017	KG	DB	4519	S	12/1/2016	12/9/2016
530390	4VZVU1E90HC083154	2017	KG	DB	4519	S	12/21/2016	1/13/2017
530391	4VZVU1E97HC082888	2017	KG	DB	4519	S	10/20/2016	10/28/2016
530392	4VZVU1E96HC082669	2017	KG	DB	4519	S	10/18/2016	10/26/2016
530393	4VZVU1E94HC083044	2017	KG	DB	4519	S	11/28/2016	12/5/2016
530394	4VZVU1E98HC082978	2017	KG	DB	4519	S	10/24/2016	11/1/2016
530397	4VZVU1E9XHC083114	2017	KG	DB	4598	S	12/14/2016	12/21/2016
530398	4VZVU1E9XHC082982	2017	KG	DB	4519	S	11/15/2016	11/22/2016
530399	4VZVU1E90HC083221	2017	KG	DB	4519	S	1/11/2017	1/19/2017
530400	4VZVU1E99HC083007	2017	KG	DB	4584	S	11/17/2016	11/28/2016
530401	4VZVU1E97HC083006	2017	KG	DB	4519	S	11/22/2016	12/2/2016
530402	4VZVU1E95HC083411	2017	KG	DB	4533	S	3/9/2017	3/17/2017
530403	4VZVU1E92HC083222	2017	KG	DB	4519	S	1/30/2017	2/7/2017
530404	4VZVU1E93HC083083	2017	KG	DB	4519	S	12/7/2016	12/15/2016
530405	4VZVU1E90HC083526	2017	KG	DB	4553	S	3/17/2017	3/27/2017
530406	4VZVU1E92HC083298	2017	KG	DB	4533	S	2/9/2017	2/17/2017
530407	4VZVU1E99JC082865	2018	KG	DB	4534	S	1/16/2017	1/24/2017
530408	4VZVU1E95HC083246	2017	KG	DB	4519	S	2/1/2017	2/9/2017
530409	4VZVU1E93HC083441	2017	KG	DB	4519	S	3/15/2017	3/23/2017
530410	4VZVU1E9XHC083310	2017	KG	DB	4513	S	3/7/2017	3/15/2017
530411	4VZAU1D91HC083440	2017	KG	DB	4598	S	3/13/2017	3/21/2017
530412	4VZVU1E96JC083763	2017	KG	DB	4519	S	5/30/2017	6/7/2017
530413	4VZVU1E95HC083537	2017	KG	DB	4519	S	3/28/2017	4/5/2017
530414	4VZVU1E92JC082867	2018	KG	DB	4531	S	2/21/2017	3/1/2017
530415	4VZVU1E91HC083566	2017	KG	DB	4519	S	4/7/2017	4/18/2017
530416	4VZVU1E95HC083585	2017	KG	DB	4584	S	4/12/2017	4/21/2017
530417	4VZVU1E9XHC083565	2017	KG	DB	4519	S	4/3/2017	4/11/2017
530418	4VZVU1E9XHC083601	2017	KG	DB	4519	S	4/24/2017	5/2/2017
530419	4VZVU1E98HC083645	2017	KG	DB	4519	S	5/1/2017	5/9/2017
530420	4VZVU1E97HC083586	2017	KG	DB	4519	S	4/18/2017	4/26/2017
530421	4VZVU1E9XJC083779	2018	KG	DB	4531	S	5/23/2017	6/5/2017

530422	4VZVU1E95HC083649	2017	KG	DB	4519	S	5/9/2017	5/17/2017
530424	4VZVU1E93JC084420	2018	KG	DB	4553	S	10/12/2017	10/20/2017
530426	4VZVU1E91JC084335	2018	KG	DB	4553	S	9/21/2017	9/29/2017
530427	4VZVU1E91JC083881	2018	KG	DB	4531	S	6/9/2017	6/19/2017
530428	4VZVU1E90JC083788	2018	KG	DB	4531	S	6/2/2017	6/12/2017
530429	4VZVU1E91JC083900	2018	KG	DB	4531	S	6/19/2017	6/28/2017
530430	4VZVU1E90JC083953	2018	KG	DB	4531	S	7/14/2017	7/27/2017
530431	4VZVU1E98JC084011	2018	KG	DB	4534	S	7/24/2017	8/1/2017
530432	4VZVU1E99JC084180	2018	KG	DB	4531	S	8/25/2017	9/1/2017
530433	4VZVU1E91JC084089	2018	KG	DB	4553	S	8/9/2017	8/17/2017
530434	4VZVU1E95JC084306	2018	KG	DB	4531	S	9/15/2017	9/25/2017
530437	4VZVU1E95JC084077	2018	KG	DB	4531	S	7/31/2017	8/8/2017
530438	4VZVU1E93JC084398	2018	KG	DB	4531	S	10/2/2017	10/10/2017
530439	4VZVU1E92JC084179	2018	KG	DB	4534	S	8/22/2017	8/30/2017
530440	4VZVU1E90JC084407	2018	KG	DB	4531	S	10/4/2017	10/12/2017
530442	4VZVU1E93JC083901	2018	KG	DB	4531	S	6/26/2017	7/12/2017
530443	4VZVU1E9XJC084155	2018	KG	DB	4553	S	8/17/2017	8/24/2017
530444	4VZVU1E99JC083966	2018	KG	DB	4531	S	7/17/2017	7/25/2017
530445	4VZVU1E92JC083954	2018	KG	DB	4534	S	7/10/2017	7/18/2017
530446	4VZVU1E9XJC084088	2018	KG	DB	4534	S	8/8/2017	8/15/2017
530447	4VZVU1E93JC084336	2018	KG	DB	4533	S	9/26/2017	10/4/2017
530450	4VZVU1E93JC084188	2018	KG	DB	4553	S	8/30/2017	9/8/2017
530451	4VZVU1E92JC084408	2018	KG	DB	4531	S	10/10/2017	10/18/2017
530452	4VZVU1E98JC084154	2018	KG	DB	4531	S	8/14/2017	8/21/2017
530453	4VZVU1E90JC084245	2018	KG	DB	4553	S	9/6/2017	9/14/2017
530455	4VZVU1E99JC084244	2018	KG	DB	4531	S	8/31/2017	9/11/2017
530457	4VZVU1E91JC084187	2018	KG	DB	4598	S	8/25/2017	9/5/2017
530458	4VZVU1E93JC084305	2018	KG	DB	4534	S	9/8/2017	9/18/2017
530460	4VZVU1E95JC084421	2018	KG	DB	4531	S	10/19/2017	10/27/2017
530461	4VZVU1E97JC084520	2018	KG	DB	4531	S	10/24/2017	11/1/2017
530462	4VZVU1E97JC084422	2018	KG	DB	4533	S	10/23/2017	10/31/2017
530464	4VZVU1E91JC084397	2018	KG	DB	4534	S	9/27/2017	10/5/2017
801196	4VZVU1E99HC081130	2017	EX	DP	4553	S	12/14/2015	1/7/2016
801202	4UZFCTBG1HCHP4120	2017	EX	DP	4533	FL	2/2/2016	2/10/2016
801212	4VZVU1E9XHC082285	2017	EX	DP	4519	S	5/24/2016	6/3/2016
801213	4UZFCTBG1HCJA2888	2017	EX	DP	4519	FL	6/15/2016	6/23/2016
801214	4VZVU1E90HC082313	2017	EX	DP	4519	S	6/6/2016	6/15/2016
801215	4UZFCTBG0HCJA0503	2017	EX	DP	4519	FL	5/26/2016	6/6/2016
801216	4UZFCTBG0HCJA4759	2017	EX	DP	4519	FL	6/28/2016	7/14/2016
801217	4UZFCTBG5HCJB2274	2017	EX	DP	4533	FL	8/8/2016	8/16/2016
801218	4UZFCTBG8HCJA6758	2017	EX	DP	4519	FL	7/20/2016	7/27/2016
801219	4VZVU1E92HC082314	2017	EX	DP	4598	S	9/6/2016	9/14/2016
801220	4VZVU1E9XHC082450	2017	EX	DP	4553	S	9/9/2016	9/19/2016
801221	4VZVU1E94HC082556	2017	EX	DP	4519	S	10/6/2016	10/14/2016
801222	4VZVU1E91HC082563	2017	EX	DP	4533	S	11/10/2016	11/18/2016
801223	4VZVU1E96HC082557	2017	EX	DP	4519	S	10/27/2016	11/4/2016
801224	4UZFCTBG9HCJB3380	2017	EX	DP	4519	FL	11/4/2016	11/11/2016
801225	4UZFCTBG8HCHY0173	2017	EX	DP	4519	FL	1/19/2017	1/26/2017

801226	4VZVU1E98HC083113	2017	EX	DP	4519	S	12/15/2016	1/9/2017
801227	4VZVU1E91HC083082	2017	EX	DP	4519	S	11/22/2016	12/1/2016
801228	4UZFACTBGXHCJB8801	2017	EX	DP	4598	FL	10/28/2016	11/7/2016
801229	4VZVU1E9XHC082562	2017	EX	DP	4584	S	11/7/2016	11/15/2016
801230	4VZVU1E93HC083309	2017	EX	DP	4553	S	1/26/2017	2/3/2017
801231	4VZVU1E94HC083397	2017	EX	DP	4519	S	3/2/2017	3/10/2017
801232	4VZVU1E9XHC083324	2017	EX	DP	4553	S	2/16/2017	2/24/2017
801233	4VZVU1E93HC083245	2017	EX	DP	4553	S	1/24/2017	1/31/2017
801234	4VZVU1E91HC083325	2017	EX	DP	4553	S	2/27/2017	3/7/2017
801237	4VZVU1E96JC082872	2018	EX	DP	4531	S	3/22/2017	3/30/2017
801238	4UZFACTFG2JCJD9867	2018	EX	DP	4536	FL	2/6/2017	2/13/2017
801239	4VZVU1E90JC082866	2018	EX	DP	4537	S	2/14/2017	2/21/2017
801240	4VZVU1E93HC083410	2017	EX	DP	4519	S	3/30/2017	4/7/2017
801241	4VZVU1E98GC083434	2017	EX	DP	4519	S	4/6/2017	4/17/2017
801242	4VZVU1E93HC083584	2017	EX	DP	4553	S	4/19/2017	4/27/2017
801243	4VZVU1E93HC083648	2017	EX	DP	4519	S	5/15/2017	5/23/2017
801244	4UZFACTBG4HCHY3569	2017	EX	DP	4533	FL	4/27/2017	5/5/2017
801245	4UZFACTBGXHCHY6234	2017	EX	DP	4519	FL	5/3/2017	5/11/2017
801246	4UZFACTBG0HCJF6666	2017	EX	DP	4519	FL	5/18/2017	5/30/2017
801247	4UZFACTBG1HCJC8181	2017	EX	DP	4553	FL	5/11/2017	5/19/2017
801248	4UZFACTFG7JCJR6604	2018	EX	DP	4553	FL	5/19/2017	6/1/2017
801249	4VZVU1E92JC084442	2018	EX	DP	4553	S	10/16/2017	10/24/2017
801250	4VZVU1E99JC083787	2018	EX	DP	4531	S	6/21/2017	6/29/2017
801253	4UZFACTFG7JCJR3945	2018	EX	DP	4531	FL	6/15/2017	6/23/2017
801254	4VZVU1E98JC083778	2018	EX	DP	4531	S	6/7/2017	6/15/2017
801255	4VZVU1E96JC084010	2018	EX	DP	4534	S	7/28/2017	8/9/2017
801256	4UZFACTFG3JCJS6792	2018	EX	DP	4531	FL	6/28/2017	7/14/2017
801257	4VZVU1E99JC083899	2018	EX	DP	4553	S	7/11/2017	7/19/2017
801258	4VZVU1E93JC084076	2018	EX	DP	4531	S	8/18/2017	8/25/2017
801259	4VZVU1E91JC084075	2018	EX	DP	4531	S	8/4/2017	8/11/2017
801260	4VZVU1E9XJC084396	2018	EX	DP	4553	S	9/20/2017	9/27/2017
801261	4UZFACTFG5JCJT8412	2018	EX	DP	4531	FL	8/10/2017	8/18/2017
801262	4UZFACTFG0JCJX3648	2018	EX	DP	4531	FL	10/18/2017	10/26/2017
801263	4VZVU1E99JC083952	2018	EX	DP	4531	S	7/19/2017	7/27/2017
801264	4VZVU1E9XJC084009	2018	EX	DP	4531	S	7/26/2017	8/2/2017
801265	4VZVU1E91JC084254	2018	EX	DP	4531	S	9/5/2017	9/13/2017
801266	4UZFACTFG0JCJT1853	2018	EX	DP	4553	FL	8/2/2017	8/10/2017
801267	4VZVU1E98JC084087	2018	EX	DP	4553	S	8/28/2017	9/6/2017
801268	4UZFACTFG3JCJU2250	2018	EX	DP	4531	FL	8/22/2017	8/30/2017
801270	4VZVU1E99JC084406	2018	EX	DP	4531	S	9/29/2017	10/6/2017
801271	4VZVU1E97JC084419	2018	EX	DP	4534	S	10/5/2017	10/13/2017
801272	4VZVU1E90JC084441	2018	EX	DP	4533	S	10/11/2017	10/19/2017
801273	4UZFACTFG0JCJU5039	2018	EX	DP	4534	FL	9/13/2017	9/20/2017
801274	4VZVU1E9XJC084334	2018	EX	DP	4553	S	9/14/2017	9/22/2017