NEWMAR CORPORATION

WARRANTY

DEPARTMENT

TECHNICAL SERVICE BULLETIN MODEL YEAR(S) AFFECTED DATE ISSUED TSB # 12/27/2017 2018 501 MODEL П Essex Bay Star Sport Ventana Dutch Star King Aire Bay Star

Ventana LE 🛛 London Aire 🗖 Other	Canyon Star	Mountain Aire	New Aire
	Ventana LE	London Aire	Other

DESCRIPTION

Newmar and KIB have determined that certain 2018 New Aire coaches may have KIB switches on which the rain sensor override switch does not operate.

Issue: The rain sensor override switch from KIB is not working.

Correction: The switch will need to be reprogrammed per the instructions provided by KIB.

Refer to the attached population list for the affected coach and VIN numbers.

RECOMMENDED ACTION

Call your Service Account Manager to obtain authorization and have the programmer shipped to your dealership. Newmar Part # 026892

Follow the attached instructions from KIB to complete the programming update. Return the programmer to Newmar.

Flat Rate Code: TSB 501 Labor Time: .3 hr

<u>Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.</u>

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.

Pic.1

Purpose:

Step-by-step instructions for re-programing the KIB V-Bus Fantastic Vent Controller.

Required for Job

- Time 10-15 minutes
- Philips screw driver
- KIB V-Bus re-programmer (KIB Part#SW-V-BUS-BRIDGE3-FVC-1A)
 - Note: This programmer has a Blue w/White strip wire and is intended for sliver switch plates ONLY! If you have white switch plates or a programmer with a Red w/white Stripe !!DO NOT PROCEED!! Get the correct re-programmer

Step #1

- Locate V-Bus Lighting Center (Newmar Part#112163-4 & 127130)
- Should be located in the bathroom wardrobe closet
- Remove three screws and open hinged door

Step#2

- 12VDC battery disconnect needs turned on before proceeding
- Plug the V-Bus re-programmer to the RELC-8-6 program port

Step#3

- !!!Do not unplug or shut off power during this step!!!
- !!Lights may turn off randomly during re-programming!!
- Switch plate backlighting may also turn off and on individually
- This step should take around 2-4 minutes
- Press the START button
- Programming LED will flash **RED** while programming
- V-Bus Network status LED will flicker GREEN during this time
- Programming LED will light solid **GREEN** when finished


Step#4


- Un-Plug the V-BUS re-programmer
- Shut hinged door and re-insert three door screws
- Apply supplied "Program completed by" label below product label
- **!!IMPORTANT!!** Be sure to fill out all information on label

Step#5

- Have V-Bus re-programmer "UPS Ground" delivered back to Newmar

For more information please call: (574)262-0518 or visit our website at www.kibelectronics.com

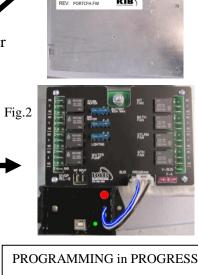

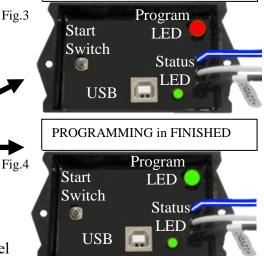



Prod# VIN Number	Year	Brand	Туре	Floor	Chassis	State	Date	Date
710203 4UZACEFCXJCJJ36	35 2018	NA	DP	3341	FL	MI	3/3/2017	3/13/2017
710206 4UZACEFC6JCJN56	674 2018	NA	DP	3341	FL	IN	5/5/2017	5/15/2017
710207 4UZACEFCXJCJR83	48 2018	NA	DP	3341	FL	FL	7/11/2017	7/19/2017
710208 4UZACEFC7JCJS84	66 2018	NA	DP	3341	FL	FL	7/31/2017	8/8/2017
710212 4UZACEFC3JCJU22	2018	NA	DP	3341	FL	CN	8/29/2017	9/6/2017
710214 4UZACEFC9JCJT55	33 2018	NA	DP	3341	FL	CA	8/16/2017	8/24/2017
710221 4UZACEFC1JCJR83	49 2018	NA	DP	3341	FL	ТΧ	7/13/2017	7/21/2017
710227 4UZACEFC2JCJU99	67 2018	NA	DP	3341	FL	OR	9/11/2017	9/19/2017
710229 4UZACEFC1JCJS67	93 2018	NA	DP	3341	FL	MN	7/20/2017	7/28/2017
710238 4UZACEFC0JCJV36	76 2018	NA	DP	3341	FL	CN	9/19/2017	9/27/2017
710243 4UZACEFC9JCJS24	26 2018	NA	DP	3341	FL	NY	7/26/2017	8/3/2017
710244 4UZACEFC5JCJR63	76 2018	NA	DP	3341	FL	NY	7/17/2017	7/25/2017
710250 4UZACEFC3JCJR63	75 2018	NA	DP	3341	FL	ТΧ	6/29/2017	7/17/2017
710286 4UZACEFC5JCJW7	511 2018	NA	DP	3341	FL	MO	10/13/2017	10/23/2017