

# NEWMAR CORPORATION

## WARRANTY

### DEPARTMENT

## RECALL SERVICE BULLETIN

DATE ISSUED

MODEL YEAR(S) AFFECTED

RSB #

1/12/2018

2018

505

### MODEL

Bay Star Sport	<input checked="" type="checkbox"/>	Ventana	<input type="checkbox"/>	Essex	<input type="checkbox"/>
Bay Star	<input checked="" type="checkbox"/>	Dutch Star	<input type="checkbox"/>	King Aire	<input type="checkbox"/>
Canyon Star	<input type="checkbox"/>	Mountain Aire	<input type="checkbox"/>	New Aire	<input type="checkbox"/>
Ventana LE	<input type="checkbox"/>	London Aire	<input type="checkbox"/>	Other	<input type="checkbox"/>

### DESCRIPTION

Newmar Corporation has decided that certain 2018 Bay Star and Bay Star Sport motorhomes fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." On certain motorhomes, the front side marker lights are not connected into the wiring harness.

Additionally, if the headlight high beams are activated, only the high beam bulbs illuminate. The intention of the high beam function on the affected coaches is to have both the high beam and low beam bulbs illuminate together.

**Issue:** Driving a motorhome at night without the proper side marker lighting or the required headlight illumination may reduce the driver's visibility, increasing the risk of a crash and/or property damage.

**Correction:** Dealers will connect the front side marker lights to the wiring harness, and ensure the low beam bulb and the high beam bulbs illuminate together during activation of the high beams.

Refer to the attached population list for specific coach and VIN numbers.

### RECOMMENDED ACTION

**Action:** Inspect the coach to ensure the update is necessary by activating the headlights on the high beam setting while inspecting the headlamps and marker lights.

If the update is necessary, contact your Service Account Manager at Newmar for authorization, and follow the attached work instructions to complete the update.

**Flat Rate Code:** RSB 505

**Labor Time:** .8 hr.

**Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.**



WHEN YOU KNOW THE DIFFERENCE

## NEWMAR CORPORATION

NEWMARCORP.COM

Date: December 22, 2017  
Re: Newmar Corporation – Motor Vehicle Recall Notification

---

Subject: Recall Campaign No.: 17V 797

This notice is sent to you as a Newmar Dealer in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Newmar Corporation has decided that a defect which relates to motor vehicle safety exists in specific Newmar recreational vehicles.

The National Traffic and Motor Vehicle Safety Act requires that each vehicle which is subject to a recall campaign of this type must be satisfactorily repaired within a reasonable time after the owner has tendered it for repair. A failure to adequately repair within 60 days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. To avoid providing these problematic solutions, every effort must be made to promptly schedule an appointment with each owner and to repair their vehicle as soon as possible. Vehicle owners are being notified of this recall. If the condition is not remedied within a reasonable time, they are instructed on how to contact the National Highway Traffic Safety Administration.

### **REASON FOR THIS RECALL**

On certain motorhomes the front side marker lights are not connected into the wiring harness. Driving a motorhome at night without the proper side marker lighting increases the risk of damage to property and/or risk of a crash. Additionally, if the headlight high beams are activated, only the high beam bulbs illuminate. The intention of the high beam function on the affected coaches is to have both the high beam and low beam bulbs illuminate together. Not having the required illumination of the road could reduce the driver's visibility, which could increase the risk of a crash causing injury and/or damage to property. Correction: dealers will connect the front side marker lights to the wiring harness, and ensure the low beam bulb will turn on along with the high beam bulb during activation of the high beams.

Motorhomes included in this recall include: 2018 Bay Star and Bay Star Sport motorhomes built between 1/20/2017 and 11/10/2017.

**These motorhomes require immediate service. Continued use poses a potential safety hazard.**

### **DEALER CAMPAIGN RESPONSIBILITY**

***Dealers are to provide to all customers/owner vehicles the service of completing this campaign at no charge to the customer/owner regardless of vehicle age, vehicle mileage, or ownership at the time of repair.***

### **REPAIR PROCEDURE**

Newmar will provide the work instructions.

**If you should have any questions please contact your service account manager direct or the Newmar service department at: 1-866-290-5371.**

Thank you for your cooperation.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

# NEWMAR CORPORATION

NEWMARCORP.COM

## IMPORTANT SAFETY RECALL

This notice applies to your vehicle VIN. # \_\_\_\_\_

Name

Address

City, State Zip code

Date: December 22, 2017

Motor Vehicle Recall Notification - Recall Campaign No. 17V 797

Dear Valued Customer:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

### **REASON FOR THIS RECALL**

*Newmar Corporation has decided that certain 2018 Bay Star and Bay Star Sport motorhomes fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment".*

On certain motorhomes, the front side marker lights are not connected into the wiring harness. Driving a motorhome at night without the proper side marker lighting increases the risk of damage to property and/or risk of a crash. Additionally, if the headlight high beams are activated, only the high beam bulbs illuminate. The intention of the high beam function on the affected coaches is to have both the high beam and low beam bulbs illuminate together. Not having the required illumination of the road could reduce the driver's visibility, which could increase the risk of a crash causing injury and/or damage to property. Correction: dealers will connect the front side marker lights to the wiring harness, and ensure the low beam bulb will turn on along with the high beam bulb during activation of the high beams.

**These motorhomes require immediate service. Continued use poses a potential safety hazard.**

### **The Safety Risk**

Not having the required side marker lighting or illumination of the road could reduce the driver's visibility, which could increase the risk of a crash causing injury and/or damage to property.

### **WHAT WE WILL DO**

Newmar Corporation will provide owners of all affected motorhomes a remedy for the potential defect at no charge for parts or labor.

### **WHAT YOU NEED TO DO**

As this defect does affect motor vehicle safety, it is recommended that you contact the Newmar service department immediately at **1-800-731-8300**. An associate will assist you in making an appointment to have this repair done by authorized Newmar or Authorized Chassis Service Facility.

**Federal regulations require that any vehicle lessor receiving this recall notification must forward a copy of this notice to the lessee within ten days.**

*If you have had the repair performed before receiving this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy. For additional information contact Newmar Corporation at:*

**Service Department**  
Newmar Corporation  
355 N Delaware St  
Nappanee, IN 46550-0030

Newmar dealers are best equipped to obtain parts and provide service to ensure your vehicle is corrected as promptly as possible. HOWEVER, if you take your vehicle to your dealer on the scheduled date and this condition is not remedied on that date or within five days; please contact the Newmar Corporation Customer Service Department at 1-800-731-8300. You may also submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave., SE., Washington DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.

If you no longer own this vehicle, please furnish us the complete name and address of the person or dealership you sold or traded your vehicle to. Thank you for your cooperation.

Your safety and satisfaction with your Newmar product is important to us and we regret any inconvenience to you.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

# NEWMAR CORPORATION

NEWMARCORP.COM

Date: December 22, 2017

Re: Newmar Corporation – Motor Vehicle Recall Notification

---

Subject: Recall Campaign No.: # 2017-619

This notice is sent to you as a Newmar Dealer in accordance with the requirements of the Canada Motor Vehicle Safety Act. Newmar Corporation has decided that a defect which relates to motor vehicle safety exists in specific Newmar recreational vehicles.

Each vehicle which is subject to a recall campaign of this type must be satisfactorily repaired within a reasonable time after the owner has tendered it for repair. A failure to adequately repair within 60 days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. To avoid providing these problematic solutions, every effort must be made to promptly schedule an appointment with each owner and to repair their vehicle as soon as possible. Vehicle owners are being notified of this recall. If the condition is not remedied within a reasonable time, they are instructed to contact Transport Canada.

## **REASON FOR THIS RECALL**

Newmar Corporation has decided that a defect which relates to motor vehicle safety exists in specific motorhomes.

On certain motorhomes, the front side marker lights are not connected into the wiring harness, which could reduce vehicle conspicuity at night. Additionally, if the headlight high beams are activated, only the high beam bulbs illuminate. The intention of the high beam function on the affected coaches is to have both the high beam and low beam bulbs illuminate together. Not having the required illumination of the road could reduce the driver's visibility, which could increase the risk of a crash causing injury and/or damage to property. Correction: Dealers will connect the front side marker lights to the wiring harness, and ensure the low beam bulb will turn on along with the high beam bulb during activation of the high beams.

**These motorhomes require immediate service. Continued use poses a potential safety hazard.**

This recall applies to certain 2018 Newmar Bay Star and Bay Star Sport motorhomes built between 06/07/2017 and 11/06/2017.

## **DEALER CAMPAIGN RESPONSIBILITY**

**Dealers are to provide to all customers/owner vehicles the service of completing this campaign at no charge to the customer/owner regardless of vehicle age, vehicle mileage, or ownership at the time of repair.**

## **REPAIR PROCEDURE**

Newmar will provide the work instructions.

**If you should have any questions please contact your service account manager direct or the Newmar service department at: 1-866-290-5371.**

Thank you for your cooperation.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

# NEWMAR CORPORATION

NEWMARCORP.COM

VIN#  
Name  
Address  
City, State Zip code

Date: December 22, 2017  
Motor Vehicle Recall Notification - Recall Campaign No. 2017-619

---

Dear Valued Customer:

This notice is sent to you in accordance with the requirements of the Canada Motor Vehicle Safety Act.

## **REASON FOR THIS RECALL**

*Newmar Corporation has determined that a defect which relates to motor vehicle safety exists in specific motorhomes.*

On certain motorhomes, the front side marker lights are not connected into the wiring harness, which could reduce vehicle conspicuity at night. Additionally, if the headlight high beams are activated, only the high beam bulbs illuminate. The intention of the high beam function on the affected coaches is to have both the high beam and low beam bulbs illuminate together. Not having the required illumination of the road could reduce the driver's visibility, which could increase the risk of a crash causing injury and/or damage to property. Correction: Dealers will connect the front side marker lights to the wiring harness, and ensure the low beam bulb will turn on along with the high beam bulb during activation of the high beams.

**These motorhomes require immediate service. Continued use poses a potential safety hazard.**

## **WHAT WE WILL DO**

Newmar Corporation will provide owners of all affected motorhomes a remedy for the potential defect at no charge for parts or labor.

## **WHAT YOU NEED TO DO**

As this defect does affect motor vehicle safety, it is recommended that you contact the Newmar service department immediately at **1-800-731-8300**. An associate will assist you in making an appointment to have this repair done by authorized Newmar or Authorized Chassis Service Facility.

**Federal regulations require that any vehicle lessor receiving this recall notification must forward a copy of this notice to the lessee within ten days.**

*If you have had the repair performed before receiving this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy. For additional information contact Newmar Corporation at:*

**Service Department**  
Newmar Corporation  
355 N Delaware St  
Nappanee, IN 46550-0030

Newmar dealers or Authorized Chassis Service Facility, are best equipped to obtain parts and provide service to ensure your vehicle is corrected as promptly as possible. HOWEVER, if you take your vehicle to your dealer or Authorized Chassis Service Facility on the scheduled date and this condition is not remedied on that date or within five days; please contact the Newmar Corporation Customer Service Department at 1-800-731-8300.

If you no longer own this vehicle, please furnish us the complete name and address of the person or dealership you sold or traded your vehicle to. Thank you for your cooperation.

Your safety and satisfaction with your Newmar product is important to us and we regret any inconvenience to you.

Sincerely,

Newmar Corporation

# MARKER LIGHT AND HEADLIGHT WORK INSTRUCTIONS FOR RECALL 17V 797

## RELEVANT COACHES

Model: Bay Star, Bay Star Sport

Year(s): 2018

Floorplan: All floorplans on coaches built prior to 11/10/2017

## ISSUE

Recall 17V 797: The front side marker lights are not connected into the wiring harness. When the headlight high beams are activated, only the high beam bulbs illuminate. The intention of the high beam function on the affected coaches is to have both the high beam and low beam bulbs illuminate together.



*Marker Lights and Headlights on high beam before the harnesses are installed (left) and after the harnesses are installed (right).*

## ACTION

Follow the service procedure below to correct the condition.

The approximate time to complete this repair is eight-tenths of an hour (.8 hr).

## NECESSARY TOOLS & REPLACEMENT PARTS

Wire Crimper
Wire Cutter/Stripper
Small Torch or Lighter

Part Name	Part Quantity	Newmar Part Number
Marker Light Harness Pigtail	2 ea	142205
Headlight Harness Adapter	2 ea	142206
Cable Tie	2 ea	131223



## SERVICE PROCEDURE

1. Inspect the coach to ensure the update is necessary by activating the headlights on the high beam setting while inspecting the headlamps and marker lights.
2. If the update is necessary, begin the correction process with the headlights and the marker lights turned off.
3. Crawl under the front cap at the headlight area.
4. Find the existing headlight and marker light harnesses.
5. If necessary, cut the cable tie to separate the wire harnesses.



*New Marker Light Harness (Left) and Headlight Harness with Relay (Right)*

6. Cut the wire feeding into the four lower marker lights.
7. Pull the wire ends out of the loom, and strip the end of each wire.
8. Twist the white wires together, and crimp the yellow connector from the new marker light harness to the white wire.
9. Twist the brown wires together, and crimp the yellow connector from the new marker light harness to the brown wire.
10. Cut off the excess flexible conduit.
11. Heat the butt connectors with a small torch or lighter to create a water tight seal.




10. Tape the harness (using black tape), and plug the harness into the marker light location.
11. Locate and remove the existing headlight harness from the headlight.



12. Plug the matching end from the new headlight harness into the headlight plug, and make sure it locks in place.
13. Plug the other end of the new headlight harness into the existing headlight harness, and make sure it locks together.



14. Strap harnesses together with a wire tie.
15. Repeat the process for the opposite headlight, as well as for the marker light.

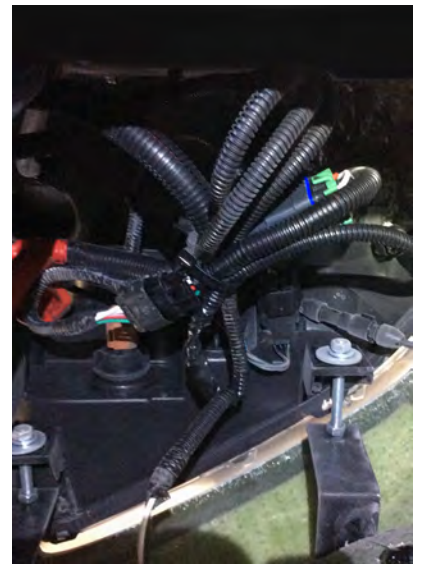

16. Test the headlights and marker lights after the harnesses are installed. If done correctly, both headlights, both marker lights, and the lower four LED lights should all be illuminated when the headlight high beam setting is activated.



*Marker Lights and Headlights on high beam before the harnesses are installed (left) and after the harnesses are installed (right).*

Prod	VIN Number	Model	B	T	Floor	C	Date In	Date Off
112657	1F66F5DY5H0A10396	2018	BS	CA	3414	F	2/8/2017	2/15/2017
112658	1F66F5DY7H0A11033	2018	BT	CA	3307	F	1/20/2017	1/30/2017
112679	1F66F5DY1H0A11934	2018	BT	CA	3312	F	3/6/2017	3/14/2017
112680	1F66F5DY1H0A09505	2018	BS	CA	3532	F	2/28/2017	3/8/2017
112751	1F65F5DYXJ0A00965	2018	BT	CA	2702	F	7/24/2017	8/1/2017
112752	1F66F5DY8J0A03755	2018	BT	CA	2903	F	10/23/2017	10/30/2017
112753	1F66F5DY0J0A00574	2018	BS	CA	3124	F	6/19/2017	6/27/2017
112754	1F66F5DY1J0A00972	2018	BS	CA	3124	F	7/24/2017	7/31/2017
112755	1F65F5DY6H0A13562	2018	BT	CA	2702	F	6/5/2017	6/13/2017
112758	1F66F5DY2H0A08038	2018	BS	CA	3113	F	6/13/2017	6/21/2017
112759	1F66F5DY5H0A15081	2018	BT	CA	2812	F	7/10/2017	7/18/2017
112760	1F66F5DY5H0A15873	2018	BT	CA	2812	F	6/23/2017	7/12/2017
112762	1F66F5DY9J0A01948	2018	BS	CA	3518	F	7/24/2017	8/1/2017
112763	1F66F5DY1H0A14302	2018	BT	CA	2903	F	6/9/2017	6/19/2017
112764	1F66F5DY2H0A15877	2018	BT	CA	2903	F	7/25/2017	8/1/2017
112765	1F65F5DY0H0A16747	2018	BT	CA	2702	F	6/14/2017	6/22/2017
112766	1F65F5DY9H0A14303	2018	BT	CA	2702	F	6/7/2017	6/15/2017
112769	1F66F5DY9J0A00136	2018	BS	CA	3401	F	6/1/2017	6/9/2017
112770	1F66F5DY3J0A00133	2018	BS	CA	3113	F	6/6/2017	6/14/2017
112771	1F66F5DY0H0A08037	2018	BS	CA	3124	F	6/14/2017	6/22/2017
112772	1F66F5DY2J0A00575	2018	BS	CA	3124	F	6/20/2017	6/28/2017
112773	1F66F5DY9J0A01884	2018	BS	CA	3518	F	7/18/2017	7/26/2017
112775	1F66F5DY6H0A17356	2018	BT	CA	3113	F	9/6/2017	9/14/2017
112777	1F65F5DY2J0A01883	2018	BT	CA	2702	F	10/10/2017	10/18/2017
112778	1F66F5DY5J0A03356	2018	BT	CA	3312	F	9/26/2017	10/3/2017
112779	1F66F5DY4H0A17355	2018	BT	CA	2903	F	9/7/2017	9/15/2017
112784	1F66F5DY9J0A03361	2018	BT	CA	3312	F	10/16/2017	10/24/2017
112789	1F66F5DY8J0A00578	2018	BS	CA	3113	F	6/26/2017	7/13/2017
112790	1F66F5DY4J0A01887	2018	BS	CA	3113	F	8/7/2017	8/15/2017
112791	1F66F5DY3J0A02139	2018	BS	CA	3124	F	8/11/2017	8/21/2017
112792	1F66F5DY1J0A03368	2018	BS	CA	3401	F	9/15/2017	9/22/2017
112794	1F66F5DY2J0A05291	2018	BS	CA	3532	F	10/27/2017	11/6/2017
112795	1F66F5DY6J0A01888	2018	BS	CA	3401	F	8/9/2017	8/17/2017
112796	1F66F5DY1J0A02141	2018	BS	CA	3113	F	8/22/2017	8/30/2017
112797	1F66F5DYXJ0A02137	2018	BS	CA	3113	F	8/8/2017	8/16/2017
112798	1F66F5DYXJ0A03367	2018	BS	CA	3124	F	9/13/2017	9/21/2017
112799	1F66F5DY1J0A00132	2018	BT	CA	2903	F	9/11/2017	9/19/2017
112800	1F66F5DY0J0A03359	2018	BT	CA	2903	F	10/11/2017	10/19/2017
112801	1F66F5DY6H0A15882	2018	BT	CA	2903	F	8/14/2017	8/22/2017
112803	1F66F5DY6H0A16756	2018	BT	CA	2812	F	9/1/2017	9/11/2017
112804	1F66F5DY9H0A16458	2018	BT	CA	3113	F	7/28/2017	8/7/2017
112806	1F66F5DY2H0A15880	2018	BT	CA	3113	F	8/9/2017	8/17/2017
112807	1F66F5DY2H0A16754	2018	BT	CA	3312	F	8/28/2017	9/6/2017
112808	1F66F5DY9H0A16749	2018	BT	CA	3312	F	8/23/2017	8/31/2017
112809	1F66F5DY7H0A16748	2018	BT	CA	3307	F	8/25/2017	9/1/2017
112810	1F66F5DY0H0A16753	2018	BT	CA	3307	F	8/25/2017	9/5/2017

Prod	VIN Number	Model	B	T	Floor	C	Date In	Date Off
112812	1F66F5DYXJ0A02140	2018 BS	CA		3403	F	8/15/2017	8/22/2017
112813	1F66F5DY8J0A02878	2018 BS	CA		3403	F	8/30/2017	9/8/2017
112814	1F66F5DY8J0A02881	2018 BS	CA		3113	F	9/1/2017	9/12/2017
112815	1F66F5DY9J0A05515	2018 BS	CA		3113	F	10/26/2017	11/2/2017
112817	1F66F5DY4J0A02876	2018 BS	CA		3401	F	8/30/2017	9/8/2017
112818	1F66F5DY9J0A02632	2018 BS	CA		3124	F	8/30/2017	9/7/2017
112824	1F66F5DY3H0A15080	2018 BT	CA		2903	F	6/27/2017	7/14/2017
112825	1F66F5DY8H0A15544	2018 BT	CA		3113	F	7/12/2017	7/20/2017
112826	1F66F5DYXJ0A00971	2018 BS	CA		3124	F	7/25/2017	8/2/2017
112827	1F66F5DY5J0A00134	2018 BS	CA		3403	F	6/8/2017	6/16/2017
112828	1F66F5DY7H0A15874	2018 BT	CA		2903	F	6/29/2017	7/17/2017
112829	1F66F5DYXJ0A01358	2018 BS	CA		3009	F	8/9/2017	8/17/2017
112830	1F66F5DY4J0A01355	2018 BS	CA		3403	F	7/31/2017	8/8/2017
112831	1F65F5DY7H0A12632	2018 BT	CA		2702	F	6/8/2017	6/16/2017
112832	1F66F5DYXH0A13942	2018 BT	CA		2903	F	5/31/2017	6/8/2017
112833	1F66F5DY0H0A12329	2018 BT	CA		3307	F	6/1/2017	6/9/2017
112834	1F66F5DY1H0A18009	2018 BS	CA		3124	F	6/1/2017	6/9/2017
112835	1F66F5DY7J0A00135	2018 BS	CA		3401	F	6/2/2017	6/12/2017
112836	1F66F5DY8H0A17357	2018 BT	CA		3307	F	9/5/2017	9/13/2017
112837	1F66F5DY8J0A03724	2018 BS	CA		3113	F	9/21/2017	9/29/2017
112838	1F66F5DY4J0A04997	2018 BS	CA		3401	F	10/2/2017	10/10/2017
112839	1F66F5DY3H0A13944	2018 BT	CA		2903	F	6/14/2017	6/23/2017
112840	1F65F5DY1J0A01180	2018 BT	CA		2702	F	8/16/2017	8/24/2017
112841	1F66F5DY1J0A02138	2018 BS	CA		3009	F	8/15/2017	8/23/2017
112842	1F66F5DY9J0A00573	2018 BS	CA		3113	F	6/20/2017	6/28/2017
112843	1F66F5DY6H0A15543	2018 BT	CA		2903	F	6/20/2017	6/29/2017
112844	1F66F5DY9H0A15519	2018 BT	CA		3113	F	6/15/2017	6/26/2017
112846	1F66F5DY7J0A02628	2018 BS	CA		3124	F	8/21/2017	8/29/2017
112847	1F66F5DY8J0A02136	2018 BS	CA		3406	F	8/10/2017	8/18/2017
112848	1F66F5DY5J0A01185	2018 BS	CA		3518	F	7/21/2017	7/31/2017
112849	1F66F5DY5H0A06364	2018 BS	CA		3124	F	6/15/2017	6/23/2017
112851	1F66F5DY7J0A01950	2018 BS	CA		3532	F	8/16/2017	8/24/2017
112852	1F66F5DY5J0A02630	2018 BS	CA		3403	F	8/24/2017	8/31/2017
112853	1F66F5DYXJ0A03725	2018 BS	CA		3401	F	9/20/2017	9/28/2017
112854	1F66F5DY6J0A02877	2018 BS	CA		3401	F	8/29/2017	9/7/2017
112855	1F66F5DY2J0A04495	2018 BS	CA		3124	F	10/3/2017	10/10/2017
112856	1F66F5DY8H0A15883	2018 BT	CA		3113	F	8/16/2017	8/23/2017
112858	1F66F5DY6J0A03110	2018 BT	CA		3307	F	9/19/2017	9/27/2017
112861	1F66F5DY9H0A16752	2018 BT	CA		3312	F	8/31/2017	9/11/2017
112862	1F66F5DY4H0A15881	2018 BT	CA		2903	F	8/18/2017	8/28/2017
112863	1F66F5DY3J0A02142	2018 BS	CA		3124	F	8/24/2017	9/1/2017
112864	1F66F5DY4J0A00576	2018 BS	CA		3414	F	6/21/2017	6/29/2017
112870	1F66F5DY8J0A03366	2018 BS	CA		3124	F	9/13/2017	9/21/2017
112874	1F66F5DY0J0A05001	2018 BS	CA		3124	F	10/13/2017	10/23/2017
112875	1F66F5DY7J0A05514	2018 BS	CA		3403	F	10/17/2017	10/25/2017
112879	1F66F5DY8J0A03111	2018 BT	CA		3307	F	9/22/2017	10/2/2017

Prod	VIN Number	Model	B	T	Floor	C	Date In	Date Off
112880	1F66F5DY3J0A02884	2018	BS	CA	3124	F	9/14/2017	9/22/2017
112881	1F66F5DY5J0A03759	2018	BS	CA	3532	F	9/8/2017	9/18/2017
112882	1F66F5DYXJ0A00579	2018	BS	CA	3401	F	6/28/2017	7/14/2017
112883	1F66F5DY6J0A00580	2018	BS	CA	3113	F	7/13/2017	7/21/2017
112884	1F66F5DY0J0A01885	2018	BS	CA	3113	F	8/11/2017	8/21/2017
112885	1F66F5DY9J0A01349	2018	BS	CA	3113	F	8/1/2017	8/9/2017
112886	1F66F5DY9J0A02629	2018	BS	CA	3401	F	8/25/2017	9/5/2017
112887	1F66F5DY7J0A00572	2018	BS	CA	3113	F	6/21/2017	7/10/2017
112888	1F66F5DY5J0A00571	2018	BS	CA	3113	F	6/22/2017	7/10/2017
112889	1F66F5DY8J0A04064	2018	BS	CA	3113	F	9/26/2017	10/4/2017
112891	1F66F5DY3J0A05512	2018	BS	CA	3124	F	10/18/2017	10/26/2017
112895	1F66F5DY3J0A01184	2018	BS	CA	3414	F	7/26/2017	8/3/2017
112896	1F65F5DY0J0A00568	2018	BT	CA	2702	F	7/25/2017	8/2/2017
112898	1F66F5DY7J0A01351	2018	BS	CA	3124	F	8/3/2017	8/10/2017
112899	1F65F5DY3J0A00130	2018	BT	CA	2702	F	7/14/2017	7/24/2017
112900	1F66F5DY7H0A15082	2018	BT	CA	2903	F	7/13/2017	7/21/2017
112901	1F66F5DY8J0A00967	2018	BS	CA	3124	F	7/14/2017	7/24/2017
112902	1F66F5DY8J0A00970	2018	BS	CA	3414	F	7/20/2017	7/28/2017
112903	1F66F5DY7J0A01947	2018	BS	CA	3532	F	7/20/2017	7/28/2017
112904	1F66F5DYXJ0A04065	2018	BS	CA	3401	F	9/27/2017	10/5/2017
112905	1F66F5DY6J0A01356	2018	BS	CA	3414	F	8/2/2017	8/9/2017
112906	1F66F5DY0J0A01949	2018	BS	CA	3532	F	7/27/2017	8/4/2017
112907	1F66F5DY1J0A03371	2018	BS	CA	3113	F	9/20/2017	9/28/2017
112908	1F66F5DY1J0A03113	2018	BT	CA	2903	F	9/27/2017	10/5/2017
112910	1F66F5DY9J0A03358	2018	BT	CA	3307	F	9/29/2017	10/9/2017
112911	1F66F5DYXJ0A01182	2018	BT	CA	3312	F	9/12/2017	9/20/2017
112918	1F66F5DY7J0A03357	2018	BT	CA	2812	F	10/3/2017	10/11/2017
112919	1F65F5DY1J0A02135	2018	BT	CA	2702	F	9/27/2017	10/4/2017
112921	1F66F5DY4H0A15878	2018	BT	CA	3113	F	7/26/2017	8/3/2017
112923	1F66F5DYXJ0A00131	2018	BT	CA	2903	F	9/14/2017	9/21/2017
112924	1F66F5DY2J0A00138	2018	BS	CA	3414	F	6/8/2017	6/19/2017
112925	1F66F5DY3J0A00973	2018	BS	CA	3532	F	6/28/2017	7/17/2017
112926	1F66F5DY6J0A03754	2018	BT	CA	2903	F	9/28/2017	10/6/2017
112927	1F66F5DY8J0A01181	2018	BT	CA	3113	F	9/14/2017	9/22/2017
112928	1F66F5DY1J0A04066	2018	BS	CA	3009	F	10/3/2017	10/11/2017
112930	1F66F5DY1H0A12629	2018	BS	CA	3124	F	7/28/2017	8/7/2017
112931	1F66F5DY8J0A01357	2018	BS	CA	3414	F	8/3/2017	8/11/2017
112932	1F66F5DY5H0A15520	2018	BT	CA	2903	F	7/19/2017	7/27/2017
112933	1F66F5DY0J0A04060	2018	BT	CA	3307	F	10/25/2017	11/2/2017
112934	1F66F5DY0J0A04494	2018	BS	CA	3124	F	10/4/2017	10/12/2017
112935	1F66F5DY1J0A05511	2018	BS	CA	3124	F	10/18/2017	10/26/2017
112936	1F66F5DY4J0A00139	2018	BS	CA	3532	F	10/19/2017	10/27/2017
112937	1F66F5DY4J0A05289	2018	BS	CA	3518	F	9/28/2017	10/6/2017
112938	1F66F5DY7H0A15079	2018	BT	CA	3307	F	6/22/2017	7/11/2017
112939	1F66F5DY6J0A00577	2018	BS	CA	3124	F	6/22/2017	7/11/2017
112941	1F66F5DY5H0A16750	2018	BT	CA	2903	F	8/31/2017	9/8/2017



Prod	VIN Number	Model	B	T	Floor	C	Date In	Date Off
112942	1F66F5DY5J0A01350	2018 BS	CA		3124	F	8/4/2017	8/11/2017
112943	1F66F5DY8H0A16757	2018 BT	CA		2903	F	9/7/2017	9/15/2017
112944	1F66F5DY7H0A16751	2018 BT	CA		3307	F	8/29/2017	9/6/2017
112945	1F66F5DY1J0A01183	2018 BS	CA		3401	F	7/27/2017	8/3/2017
112947	1F66F5DY3J0A03761	2018 BS	CA		3532	F	9/15/2017	9/25/2017
112948	1F66F5DY6J0A04497	2018 BS	CA		3414	F	10/4/2017	10/12/2017
112953	1F66F5DY3J0A00570	2018 BS	CA		3401	F	6/9/2017	6/19/2017
112954	1F66F5DY2J0A01886	2018 BS	CA		3009	F	8/17/2017	8/25/2017
112956	1F65F5DY5J0A02624	2018 BT	CA		2702	F	10/24/2017	11/1/2017
112957	1F66F5DYXJ0A03756	2018 BT	CA		3307	F	10/24/2017	11/1/2017
112960	1F66F5DY4H0A16755	2018 BT	CA		2812	F	9/6/2017	9/13/2017
112961	1F66F5DY0J0A02387	2018 BT	CA		2812	F	9/21/2017	9/29/2017
112964	1F65F5DY5J0A01179	2018 BT	CA		2702	F	8/18/2017	8/28/2017
112968	1F66F5DY4J0A04062	2018 BT	CA		3307	F	10/30/2017	11/7/2017
112972	1F66F5DY6J0A00966	2018 BS	CA		3124	F	7/10/2017	7/19/2017
112973	1F66F5DY6J0A02880	2018 BS	CA		3113	F	9/6/2017	9/14/2017
112974	1F66F5DY3J0A03355	2018 BT	CA		3307	F	9/28/2017	10/6/2017
112977	1F66F5DY5J0A03762	2018 BS	CA		3532	F	9/18/2017	9/26/2017
112979	1F66F5DY9H0A15875	2018 BT	CA		2903	F	7/27/2017	8/4/2017
112992	1F66F5DY0H0A16459	2018 BT	CA		3022	F	8/4/2017	8/14/2017
112994	1F66F5DY1J0A00969	2018 BS	CA		3124	F	7/14/2017	7/24/2017
112995	1F66F5DYXJ0A05510	2018 BS	CA		3124	F	10/20/2017	10/30/2017
112996	1F66F5DY0H0A15876	2018 BT	CA		2903	F	7/21/2017	7/31/2017
113010	1F66F5DYXJ0A03112	2018 BT	CA		2812	F	9/22/2017	10/2/2017
113022	1F66F5DY7J0A02631	2018 BS	CA		3113	F	8/28/2017	9/6/2017
113025	1F66F5DY1J0A03757	2018 BS	CA		3124	F	9/25/2017	10/3/2017
113026	1F66F5DYXJ0A02882	2018 BS	CA		3403	F	9/1/2017	9/12/2017
113051	1F66F5DY7J0A03360	2018 BT	CA		3113	F	10/12/2017	10/20/2017
113058	1F66F5DYXJ0A03370	2018 BS	CA		3406	F	9/12/2017	9/19/2017
113063	1F66F5DY0J0A04995	2018 BS	CA		3406	F	10/5/2017	10/13/2017
113065	1F66F5DY4J0A05521	2018 BS	CA		3406	F	10/31/2017	11/8/2017
113069	1F66F5DY6J0A05519	2018 BS	CA		3403	F	11/1/2017	11/9/2017
113070	1F66F5DY2J0A05520	2018 BS	CA		3403	F	11/1/2017	11/9/2017
113075	1F66F5DY4J0A05518	2018 BS	CA		3333	F	11/1/2017	11/9/2017
113076	1F66F5DY2J0A04061	2018 BT	CA		2812	F	11/2/2017	11/10/2017
113090	1F66F5DY5J0A02885	2018 BS	CA		3124	F	9/12/2017	9/20/2017
113092	1F66F5DY7J0A03682	2018 BS	CA		3124	F	9/15/2017	9/25/2017
113093	1F66F5DY0J0A05290	2018 BS	CA		3403	F	10/24/2017	11/1/2017
113094	1F66F5DY3J0A04067	2018 BS	CA		3113	F	10/5/2017	10/13/2017
113096	1F66F5DY0J0A03362	2018 BT	CA		2903	F	10/23/2017	10/31/2017
113099	1F66F5DY0J0A05516	2018 BS	CA		3124	F	10/23/2017	10/31/2017
113103	1F66F5DY7H0A16460	2018 BT	CA		3307	F	8/18/2017	8/28/2017
113185	1F66F5DY3J0A03758	2018 BS	CA		3009	F	9/22/2017	10/2/2017
113186	1F66F5DY3J0A03369	2018 BS	CA		3401	F	9/8/2017	9/18/2017
113191	1F66F5DY9J0A05000	2018 BS	CA		3113	F	10/6/2017	10/16/2017
113192	1F66F5DY1J0A02883	2018 BS	CA		3406	F	9/5/2017	9/13/2017

Prod	VIN Number	Model	B	T	Floor	C	Date In	Date Off
113193	1F66F5DY1J0A03760	2018	BS	CA	3406	F	9/11/2017	9/19/2017
113194	1F66F5DYXJ0A02879	2018	BS	CA	3009	F	9/1/2017	9/12/2017
113203	1F66F5DY9J0A05725	2018	BS	CA	3113	F	10/27/2017	11/6/2017
113207	1F66F5DY2J0A04996	2018	BS	CA	3414	F	10/6/2017	10/16/2017
113237	1F66F5DY8J0A04999	2018	BS	CA	3113	F	10/9/2017	10/17/2017
113238	1F66F5DY3J0A02626	2018	BT	CA	2903	F	9/18/2017	9/25/2017
113245	1F66F5DY2J0A05002	2018	BS	CA	3401	F	10/9/2017	10/17/2017
113250	1F66F5DY3J0A05509	2018	BS	CA	3124	F	10/13/2017	10/23/2017
113251	1F66F5DY6J0A04998	2018	BS	CA	3113	F	10/10/2017	10/18/2017
113269	1F66F5DY6J0A05004	2018	BS	CA	3124	F	10/16/2017	10/24/2017

#### Canadian units

112767	1F66F5DY6H0A17549	2018	BS	CA	3532	F	6/13/2017	6/22/2017
112767	1F66F5DY6H0A17549	2018	BS	CA	3532	F	6/13/2017	6/22/2017
112768	1F66F5DY7H0A18015	2018	BS	CA	3518	F	6/26/2017	7/12/2017
112768	1F66F5DY7H0A18015	2018	BS	CA	3518	F	6/26/2017	7/12/2017
112811	1F65F5DY7J0A00129	2018	BT	CA	2702	F	6/16/2017	6/26/2017
112820	1F66F5DY0J0A00137	2018	BS	CA	3414	F	6/7/2017	6/15/2017
112821	1F66F5DY5J0A02143	2018	BS	CA	3414	F	8/17/2017	8/25/2017
112822	1F66F5DY5J0A00974	2018	BS	CA	3518	F	7/12/2017	7/20/2017
112823	1F66F5DY6J0A00773	2018	BS	CA	3532	F	6/27/2017	7/13/2017
112890	1F66F5DYXJ0A00968	2018	BS	CA	3414	F	7/13/2017	7/21/2017
112890	1F66F5DYXJ0A00968	2018	BS	CA	3414	F	7/13/2017	7/21/2017
112965	1F66F5DY6H0A15879	2018	BT	CA	3113	F	8/10/2017	8/18/2017
113013	1F66F5DYXJ0A03109	2018	BT	CA	2903	F	9/19/2017	9/26/2017
113018	1F66F5DY4J0A04496	2018	BS	CA	3401	F	10/5/2017	10/12/2017
113020	1F66F5DY4J0A05003	2018	BS	CA	3406	F	10/12/2017	10/20/2017
113256	1F66F5DY2J0A05517	2018	BS	CA	3009	F	10/30/2017	11/6/2017