

NEWMAR CORPORATION

WARRANTY

DEPARTMENT

PRODUCT INFORMATION BULLETIN

DATE ISSUED	MODEL YEAR(S) AFFECTED	PIB #
12/18/18	2015 - 2019	538

MODEL

Bay Star Sport	<input type="checkbox"/>	Ventana	<input checked="" type="checkbox"/>	Essex	<input checked="" type="checkbox"/>
Bay Star	<input type="checkbox"/>	Dutch Star	<input checked="" type="checkbox"/>	King Aire	<input checked="" type="checkbox"/>
Canyon Star	<input checked="" type="checkbox"/>	Mountain Aire	<input checked="" type="checkbox"/>	New Aire	<input checked="" type="checkbox"/>
Ventana LE	<input type="checkbox"/>	London Aire	<input checked="" type="checkbox"/>	Other	<input type="checkbox"/>

PRODUCT INFORMATION

Newmar has made a change to the water pump circuit fuse on certain coaches to improve customer experience. In most cases, the 10 amp fuse installed by the factory is sufficient. However, some coaches equipped with a ShurFlo water pump (Newmar part # 127488) blow the 10 amp water pump fuse.

This ShurFlo water was installed on the following coaches:

- 2015-2019 King Aire
- 2015-2019 Essex
- 2017 Canyon Star (floor plan 3925 only)
- 2018 Canyon Star (floor plan 3928 only)
- 2017 Mountain Aire (floor plan 4525 only)
- 2017 London Aire (floor plan 4525 only)
- 2018-2019 Dutch Star
- 2018-2019 London Aire
- 2017-2019 Ventana (4310 floor plan only)

If a customer owns one of the listed coaches and is experiencing this issue, inspect the water pump. If the pump label reads "Fuse: 15A required," order the 15 amp fuse (Newmar part # 22238) and 15A label from the Newmar Parts Department. Then install the 15 amp fuse and label the fuse panel accordingly.

Note: The wiring is sufficient for the new 15 amp fuse.

Flat Rate: PIB 538

Labor Time: .2 hr.

Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.