

Newmar Corporation

PO Box 30
Nappanee, IN 46550



WHEN YOU KNOW THE DIFFERENCE.

RSB 584
Sep 30, 2022

NHTSA #22V 583
TC #2022-436

RECALL SERVICE BULLETIN

AFFECTED MODELS

2022 :: Ventana, Super Star, London Aire
2022 – 2023 :: Dutch Star, New Aire, Mountain Aire, Essex

DESCRIPTION

Due to ITR releasing a technical bulletin MTB-229-20, Newmar has released a recall bulletin NHTSA # 22V 583 and TC# 2022-436. On certain Newmar motorhomes equipped with International Thermal Research powered heaters, ITR may have installed an incorrect fuel line on the heater, which may leak fuel.

ISSUE

Any fuel leak is undesirable, and a fuel leak in the presence of an ignition source can increase the risk of a fire.

UNITS AFFECTED

Please refer to the attached population list for affected units and VINs.

DEALER CORRECTIVE ACTION

Verify and document the Oasis serial number, inspect the fuel line, and follow the repair procedure per the attached ITR bulletin. Call your SAM for the correct time authorization and to order the part if needed. Provide picture(s) of the bad fuel line and another after the fuel line replacement has been completed.

PARTS NEEDED

Item Description	Quantity	Newmar Part #
Fuel line kit	1	034521

FLAT RATE CODE: 22V 583

LABOR TIME:

- .1 hr. - Inspection only (if heater has the correct fuel line)
- .5 hr. - Inspect and change fuel line

NOTE

The fuel line kit must be ordered through Newmar for Newmar-affected coaches, even though ITR may directly supply fuel line kits for other OEMs.

IMPORTANT: Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.

NOTICE: Any technical information published in this bulletin is intended for use only by a qualified, Newmar-authorized service technician. Newmar is not responsible for the misuse of this information.



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

Date: 09/26/2022

Re: Newmar Corporation – Motor Vehicle Recall Notification

Subject: Recall Campaign No.: 22V-583

This notice is sent to you as a Newmar Dealer in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific Newmar recreational vehicles.

The National Traffic and Motor Vehicle Safety Act requires that each vehicle, which is subject to a recall campaign of this type, must be satisfactorily repaired within a reasonable time after the owner has tendered it for repair. A failure to adequately repair within 60 days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. To avoid providing these problematic solutions, every effort must be made to promptly schedule an appointment with each owner and to repair their vehicle as soon as possible. Vehicle owners are being notified of this recall. If the condition is not remedied within a reasonable time, they are instructed on how to contact the National Highway Traffic Safety Administration.

REASON FOR THIS RECALL

Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific motorhomes built with International Thermal Research powered heater system.

On certain Newmar Motorhomes, equipped with International Thermal Research powered heaters, these heaters may have an incorrect fuel line installed that may leak. A fuel leak in the presence of an ignition source can increase the risk of a fire.

Motorhomes included in this recall include:

- 2022 Super Star Class C motorhomes.
- 2022 Ventana Class A motorhomes.
- 2022, 2023 Dutch Star Class A motorhomes.
- 2022, 2023 Mountain Aire Class A motorhomes.
- 2022 London Aire Class A motorhomes.
- 2022, 2023 New Aire Class A motorhomes.
- 2022, 2023 Essex Class A motorhomes.

These motorhomes require immediate service. Continued use poses a potential safety hazard.

DEALER CAMPAIGN RESPONSIBILITY

Dealers are to provide to all customers/owner vehicles the service of completing this campaign at no charge to the customer/owner regardless of vehicle age, vehicle mileage, or ownership at the time of repair.

REPAIR PROCEDURE

International Thermal Research will provide the work instructions.

If you should have any questions please contact your service account manager direct or the Newmar service department at: 1-866-290-5371.

Thank you for your cooperation.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

IMPORTANT SAFETY RECALL

This notice applies to your vehicle VIN. # _____

Name

Address

City, State Zip code

Date: 09/26/2022

Motor Vehicle Recall Notification - Recall Campaign No. 22V-583

Dear Valued Customer:

This notice is being sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

REASON FOR THIS RECALL

Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific motorhomes equipped with a International Thermal Research powered heater system.

On certain Newmar Motorhomes, equipped with International Thermal Research powered heaters, these heaters may have a incorrect fuel line installed that may leak. A fuel leak in the presence of an ignition source can increase the risk of a fire.

These motorhomes require immediate service. Continued use poses a potential safety hazard.

The Safety Risk

An incorrect fuel line that could leak may have been installed with motorhomes equipped with a International Thermal Research powered heater. A fuel leak in the presence of an ignition source can increase the risk of a fire.

WHAT WE WILL DO

The dealership will inspect the fuel hose on the heater, and replace it, as necessary. Dealer will notify owner at time of contact for service an estimated time for repairs. However, due to scheduling times the service provider may need the vehicle longer.

WHAT YOU NEED TO DO

As this defect does affect motor vehicle safety, it is recommended that you call Newmar service department immediately at **1-800-731-8300**. An associate will assist you in making an appointment to have this repair completed.

Federal regulations require that any vehicle lessor receiving this recall notification must forward a copy of this notice to the lessee within ten days.

If you have had the repair performed before receiving this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy. For additional information, contact Newmar Corporation at:

Service Department
Newmar Corporation
355 N Delaware St
Nappanee, IN 46550-0030

Newmar dealers are best equipped to obtain parts and provide service to ensure your vehicle is corrected as promptly as possible. HOWEVER, if you take your vehicle to your dealer on the scheduled date and this condition is not remedied on that date or within five days; please contact the Newmar Corporation Customer Service Department at 1-800-731-8300. You may also submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey

Ave., SE., Washington DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.

If you no longer own this vehicle, please furnish us the complete name, phone number, e-mail and physical address of the person or dealership you sold or traded your vehicle to. Thank you for your cooperation.

Your safety and satisfaction with your Newmar product is important to us and we regret any inconvenience to you.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

Date: 9/26/2022

Re: Newmar Corporation – Motor Vehicle Recall Notification

Subject: Recall Campaign No.: #2022-436

This notice is sent to you as a Newmar Dealer in accordance with the requirements of the *Canada Motor Vehicle Safety Act*. Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific Newmar recreational vehicles.

Each vehicle, which is subject to a recall campaign of this type, must be satisfactorily repaired within a reasonable time after the owner has tendered it for repair. A failure to adequately repair within 60 days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. To avoid providing these problematic solutions, every effort must be made to promptly schedule an appointment with each owner and to repair their vehicle as soon as possible. Vehicle owners are being notified of this recall. If the condition is not remedied within a reasonable time, they are instructed to contact Transport Canada.

REASON FOR THIS RECALL

Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific motorhomes built with a International Thermal Research powered heater system.

Issue:

On a small number of motorhomes, an incorrect fuel hose may have been installed on the heater. As a result, the fuel hose could develop a leak.

Note: This recall only affects certain motorhomes equipped with an International Thermal Research powered heater system.

Safety Risk:

A fuel leak can create the risk of a fire.

Corrective Actions:

Newmar will notify owners by mail and instruct you to bring your motorhome to a dealership inspect the fuel hose on the heater and replace it, as necessary. Dealer will notify owner at time of contact for service an estimated time for repairs. However, due to scheduling times the service provider may need the vehicle longer.

This recall applies to Newmar 2022 Dutch Star motorhomes.

The motorhomes require immediate service. Continued use poses a potential safety hazard.

DEALER CAMPAIGN RESPONSIBILITY

Dealers are to provide to all customers/owner vehicles the service of completing this campaign at no charge to the customer/owner regardless of vehicle age, vehicle mileage, or ownership at the time of repair.

REPAIR PROCEDURE

International Thermal Research will provide the work instructions.

If you should have any questions please contact, your service account manager direct or the Newmar service department at: 1-866-290-5371.

Thank you for your cooperation.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

VIN#
make, model, model year
Name
Address
City, State Zip code

Date: 9/26/2022
Motor Vehicle Recall Notification - Recall Campaign No. 2022-436

Dear Valued Customer:

This notice is sent to you in accordance with the requirements of the *Canada Motor Vehicle Safety Act*.

This is to inform you that your vehicle may contain a defect that could affect the safety of a person.

REASON FOR THIS RECALL

Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific motorhome built with a International Thermal Research powered heater system.

Issue:

On a small number of motorhomes, an incorrect fuel hose may have been installed on the heater. As a result, the fuel hose could develop a leak.

Note: This recall only affects certain motorhomes equipped with an International Thermal Research powered heater system.

Safety Risk:

A fuel leak can create the risk of a fire.

Corrective Actions: *Newmar will notify owners by mail and instruct you to bring your motorhome to a dealership inspect the fuel hose on the heater and replace it, as necessary.*

The motorhomes require immediate service. Continued use poses a potential safety hazard.

WHAT WE WILL DO

The dealership will inspect the fuel hose on the heater, and replace it, as necessary. Dealer will notify owner at time of contact for service an estimated time for repairs. However, due to scheduling times the service provider may need the vehicle longer.

WHAT YOU NEED TO DO

As this defect does affect motor vehicle safety, it is recommended that you contact the Newmar service department immediately at 1-800-731-8300. An associate will assist you in making an appointment to have this repair completed.

Federal regulations require that any vehicle lessor receiving this recall notification must forward a copy of this notice to the lessee within ten days.

If you have had the repair performed before receiving this letter and paid any expenses for repairs, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy. For additional information, contact Newmar Corporation at:

Service Department
Newmar Corporation
355 N Delaware St
Nappanee, IN 46550-0030

Authorized Service Facilities, are best equipped to obtain parts and provide service to ensure your vehicle is corrected as promptly as possible. HOWEVER, if you take your vehicle to your Authorized Service Facility on the scheduled date and this condition is not remedied on that date or within five days; please contact the Newmar Corporation Customer Service Department at 1-800-731-8300.

If you no longer own this vehicle, please furnish us the complete name, phone number, e-mail and physical address of the person or dealership you sold or traded your vehicle to. Thank you for your cooperation.

Your safety and satisfaction with your Newmar product is important to us and we regret any inconvenience to you.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

NIV #
la fabrique, le modèle, l'année de modèle
Nom
Adresse
Ville, Code postal de l'État

Date: 26/09/2022
Avis de rappel de véhicules automobiles - Campagne de rappel no 2022-436

Cher client apprécié:

Le présent avis vous est envoyé conformément aux exigences de la [Loi sur la sécurité automobile du Canada](#).

La présente a pour but de vous informer que votre véhicule est susceptible de présenter un défaut qui pourrait porter atteinte à la sécurité des personnes.

RAISON DE CE RAPPEL

Newmar Corporation a décidé qu'un défaut, qui se rapporte à la sécurité des véhicules automobiles, existe dans une autocaravane spécifique construite avec un système de chauffage alimenté par International Thermal Research.

Question en litige :

Sur un petit nombre de camping-cars, un tuyau de carburant incorrect peut avoir été installé sur le chauffage. Par conséquent, le tuyau de carburant pourrait développer une fuite.

Remarque : Le présent rappel ne vise que certains camping-cars équipés d'un système de chauffage alimenté par International Thermal Research.

Risque pour la sécurité :

Une fuite de carburant peut créer un risque d'incendie.

Mesures correctives : Newmar avisera les propriétaires par la poste et vous demandera d'apporter votre camping-car chez un concessionnaire inspecter le tuyau de carburant sur le chauffage et le remplacer, au besoin.

Les camping-cars nécessitent un entretien immédiat. L'utilisation continue présente un danger potentiel pour la sécurité.

CE QUE NOUS ALLONS FAIRE

Le concessionnaire inspectera le tuyau de carburant du chauffage et le remplacera, au besoin. Le concessionnaire informera le propriétaire au moment du contact avec le service d'une estimation du temps pour les réparations. Cependant, en raison des heures de planification, le fournisseur de services peut avoir besoin du véhicule plus longtemps.

CE QUE VOUS DEVEZ FAIRE

Comme cette défectuosité a une incidence sur la sécurité des véhicules automobiles, il est recommandé de communiquer immédiatement avec le service de Newmar au 1-800-731-8300. Un associé vous aidera à prendre rendez-vous pour que cette réparation soit terminée.

La réglementation fédérale exige que tout locateur de véhicule recevant cet avis de rappel transmette une copie de cet avis au locataire dans les dix jours.

Si vous avez fait effectuer la réparation avant de recevoir cette lettre et que vous avez payé des dépenses pour des réparations, vous pourriez être admissible à recevoir un remboursement pour le coût de l'obtention d'un recours préalable à la notification. Pour de plus amples renseignements, veuillez communiquer avec Newmar Corporation à l'adresse suivante :

Département des services
Newmar Corporation
355, rue Delaware Nord
Nappanee, IN 46550-0030

Les installations de service autorisées sont les mieux équipées pour obtenir des pièces et fournir un service afin de s'assurer que votre véhicule est corrigé le plus rapidement possible. TOUTEFOIS, si vous aérez votre véhicule à votre centre de service autorisé à la date prévue et que cette condition n'est pas corrigée à cette date ou dans les cinq jours; veuillez communiquer avec le service à la clientèle de Newmar Corporation au 1-800-731-8300.

Si vous n'êtes plus propriétaire de ce véhicule, veuillez nous fournir le nom complet, le numéro de téléphone, le courriel et l'adresse physique de la personne ou du concessionnaire à qui vous avez vendu ou échangé votre véhicule. Je vous remercie de votre coopération.

Votre sécurité et votre satisfaction à l'égard de votre produit Newmar sont importantes pour nous et nous regrettons tout inconvénient pour vous.

Cordialement,

Newmar Corporation

TECHNICAL BULLETIN

Heating Systems	June 2, 2022	Bulletin Identification No.: MTB-229-20
Release Type: Public		Standard Repair Time: 30 minutes

Affected Model(s): All heaters with 1/4" fuel line

Potential Serial Numbers: OCK59600-1131-2377
OCK59600-1231-2556


Description: Incorrect Fuel Line

Short description of problem:

It was recently discovered that a general purpose hose was inadvertently used in place of the 1/4" fuel line in ITR's powered heaters. It is unclear in which models this general purpose line was installed, but it would be within the range of the date codes in the above serial numbers.



The above fuel line is the correct type. It has "FUEL LINE SAE30R7" marked on it. The incorrect hose can be identified by either marking of "VALUFLEX/GS" or by what appear to be holes in the hose as shown below.

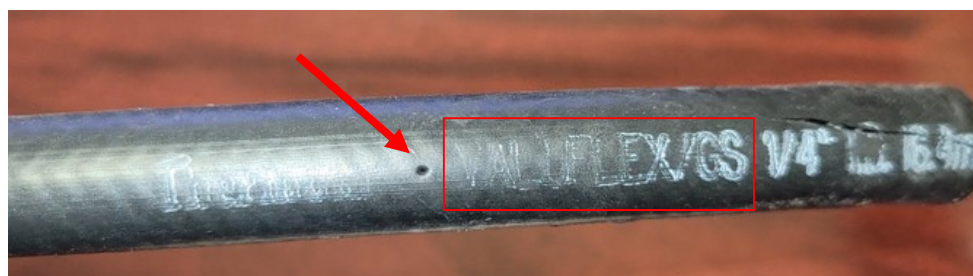


This hose is subject to leaking. If a heater is discovered to have this hose, it must be changed out with the appropriate fuel line as per the instructions below.

TECHNICAL BULLETIN

Heating Systems	June 2, 2022	Bulletin Identification No.: MTB-229-20
Release Type: Public		Standard Repair Time: 30 minutes

Step 1:

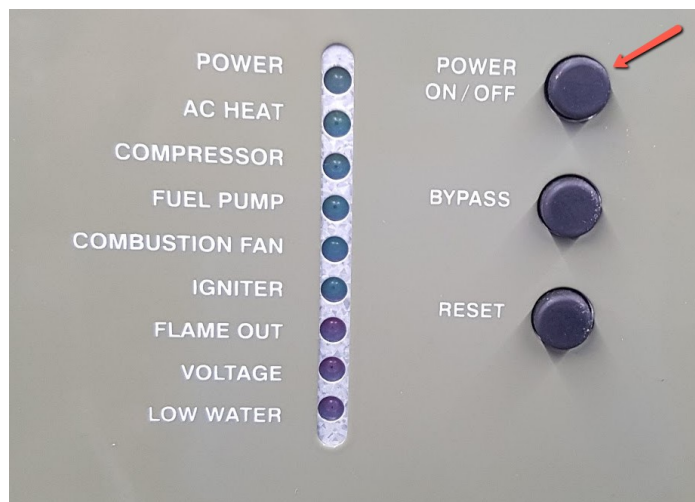

Press the power button and make sure the Power LED has turned off. Wait until the combustion fan turns off. This will take 2-4 minutes.


Step 2:



Remove these screws to gain access to the inside of the heater.

Heating Systems	June 2, 2022	Bulletin Identification No.: MTB-229-20
Release Type: Public		Standard Repair Time: 30 minutes

Step 3:

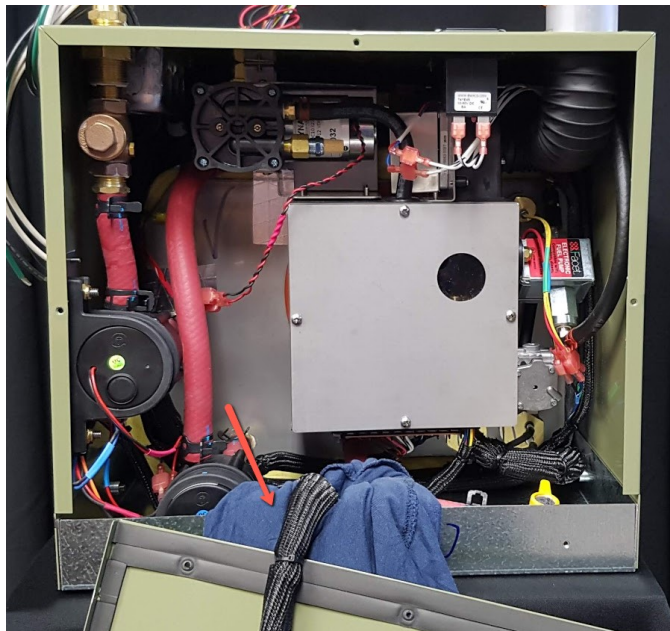

1. Place a rag underneath the wires to protect them from getting damaged on the edge of the bottom tray, and fold down the front cover.
2. Place a spacer underneath the front cover to ensure the buttons don't get pushed accidentally during service.

Step 4:



Remove the three screws from the combustion fan intake and pull it down and out to provide better access to the fuel line.

TECHNICAL BULLETIN

Heating Systems	June 2, 2022	Bulletin Identification No.: MTB-229-20
Release Type: Public		Standard Repair Time: 30 minutes

Step 5:



1. Mark the fuel inlet line and clamp off the fuel inlet and return lines above the quick connects.
2. Push the grey button on the quick disconnect fittings and pull them apart, using a rag to catch any fuel that spills.

Heating Systems	June 2, 2022	Bulletin Identification No.: MTB-229-20
Release Type: Public		Standard Repair Time: 30 minutes

Step 6:



1. Using angled needle nose pliers, move the clamp off both fuel pump fittings and pull out both generic hoses, using a rag to catch any fuel that spills.
2. Install the proper fuel lines and clamp them in place. You will need to use silicone spray to get the fuel lines to slide through the grommets.
3. Connect the clamped off fuel lines to the newly installed fuel lines, being careful to connect the marked fuel line to the fuel inlet connection.

TECHNICAL BULLETIN

Heating Systems	June 2, 2022	Bulletin Identification No.: MTB-229-20
Release Type: Public		Standard Repair Time: 30 minutes

Step 7:

1. Re-install the combustion fan inlet collar and put the combustion hose back in place.
2. Turn on the power button and turn on the burner and check the newly installed fuel lines for leaks while the burner is running.
3. Once it has been confirmed that no leaks are present at any of the fuel line fittings, close up the front cover.

The replacement hose kit is part number 21015



Prod#	VIN Number	Year	Brand	Type	Floor	Chassis	Date In	Date Off
USA Units								
230258	1FVACYFE3NHHH4033	2022	SS	CC	3727	FS	1/27/2022	2/11/2022
230319	1FVACYFE5NHHH4017	2022	SS	CC	3727	FS	12/15/2021	1/11/2022
230348	1FVACYFE9NHHH4036	2022	SS	CC	4061	FS	1/20/2022	2/7/2022
230359	1FVACYFEXNHHH4028	2022	SS	CC	4059	FS	1/17/2022	1/25/2022
415477	4UZFCHFE3NCNU2617	2022	VT	DP	4326	FL	12/15/2021	1/11/2022
415478	4UZFCHFE7NCNU4158	2022	VT	DP	4037	FL	1/11/2022	1/20/2022
415496	4UZFCHFE5NCNS7861	2022	VT	DP	4369	FL	12/2/2021	12/13/2021
415534	4UZFCHFE9NCNT8667	2022	VT	DP	4326	FL	1/7/2022	1/18/2022
415555	4VZAT1D93NC091876	2022	VT	DP	4369	S	12/8/2021	12/16/2021
415581	4VZDR1A95NC091815	2022	VT	DP	3407	S	12/15/2021	1/10/2022
415638	4UZACHFC5NCNU2613	2022	VT	DP	3709	FL	12/14/2021	1/10/2022
415686	4UZACHFC5NCNW8287	2022	VT	DP	3407	FL	1/11/2022	1/21/2022
415688	4UZFCHFE5NCNU2618	2022	VT	DP	4369	FL	12/14/2021	1/5/2022
415692	4UZFCHFE2NCNT8669	2022	VT	DP	4369	FL	12/7/2021	12/15/2021
415746	4UZFCHFE7NCNU2619	2022	VT	DP	4369	FL	1/10/2022	1/20/2022
415761	4VZAT1D97NC091878	2022	VT	DP	4369	S	1/5/2022	1/14/2022
415841	4VZAT1D9XNC091843	2022	VT	DP	4326	S	12/6/2021	12/15/2021
415859	4UZFCHFE7NCNT8666	2022	VT	DP	4369	FL	1/3/2022	1/13/2022
415887	4VZAT1D95NC091877	2022	VT	DP	4369	S	1/3/2022	1/13/2022
415915	4VZDR1A98NC091002	2022	VT	DP	3717	S	12/3/2021	12/14/2021
415940	4VZAT1D92NC091755	2022	VT	DP	4037	S	12/16/2021	1/11/2022
415947	4UZACHFC9NCNW8289	2022	VT	DP	3407	FL	1/20/2022	2/7/2022
501881	4VZVU1E91NC091856	2022	LA	DP	4551	S	12/8/2021	1/3/2022
501970	4VZVU1E9XNC091984	2022	LA	DP	4551	S	12/15/2021	1/10/2022
501975	4VZVU1R16NC092036	2022	LA	DP	4551	S	1/27/2022	2/14/2022
501979	4VZVU1E9XNC091855	2022	LA	DP	4579	S	12/3/2021	12/14/2021
609667	4UZFCHFE3NCNU5372	2022	DS	DP	4081	FL	1/5/2022	1/18/2022
609687	4VZAU1D98NC092163	2022	DS	DP	4081	S	1/25/2022	2/10/2022
609716	4VZAU1D97NC091845	2022	DS	DP	4326	S	1/26/2022	2/11/2022
609758	4UZFCHFE6NCNT8674	2022	DS	DP	4369	FL	12/9/2021	1/4/2022
609790	4VZAU1D99NC091605	2022	DS	DP	4369	S	12/7/2021	12/15/2021
609901	4UZFCHFE1NCNY3909	2022	DS	DP	4081	FL	1/18/2022	1/27/2022
609905	4UZFCHFE1NCNT8677	2022	DS	DP	4311	FL	12/9/2021	1/3/2022
609984	4VZAU1D99NC091765	2022	DS	DP	4081	S	12/15/2021	1/10/2022
610060	4VZAU1D97NC091621	2022	DS	DP	4328	S	12/15/2021	1/11/2022
610086	4UZFCHFE4NCNW8160	2022	DS	DP	4369	FL	1/19/2022	1/27/2022
610100	4UZFCHFE0NCNU2624	2022	DS	DP	4081	FL	12/8/2021	1/3/2022
610162	4VZAU1D93NC091762	2022	DS	DP	4081	S	12/2/2021	12/13/2021
610163	4VZAU1D94NC091818	2022	DS	DP	4081	S	1/18/2022	1/27/2022
610190	4UZFCHFE3NCNU4061	2022	DS	DP	4081	FL	12/14/2021	1/10/2022
610409	4UZFCHFE4NCNW8157	2022	DS	DP	4311	FL	1/17/2022	1/26/2022
610426	4UZFCHFE1NCNU4060	2022	DS	DP	4369	FL	12/16/2021	1/11/2022

Prod#	VIN Number	Year	Brand	Type	Floor	Chassis	Date In	Date Off
610429	4UZFCHFEXNCNU4056	2022	DS	DP	4369	FL	12/13/2021	1/5/2022
610433	4UZACHFE7NCNU5370	2022	DS	DP	3709	FL	1/7/2022	1/18/2022
610438	4VZAU1D95NC091827	2022	DS	DP	4369	S	1/17/2022	1/26/2022
610440	4UZFCHFE1NCNU5371	2022	DS	DP	4081	FL	1/5/2022	1/18/2022
610445	4VZAU1D93NC091826	2022	DS	DP	4369	S	1/24/2022	2/8/2022
610456	4UZACHFE0NCNU5369	2022	DS	DP	3717	FL	1/4/2022	1/13/2022
610457	4UZFCHFE9NCNU5375	2022	DS	DP	4081	FL	1/10/2022	1/20/2022
610466	4UZFCHFE3NCNU4058	2022	DS	DP	4369	FL	1/10/2022	1/20/2022
610473	4UZFCHFE8NCNU5366	2022	DS	DP	4369	FL	1/17/2022	1/26/2022
610484	4VZAU1D90NC091606	2022	DS	DP	4369	S	12/7/2021	12/16/2021
610490	4UZFCHFE1NCNU4057	2022	DS	DP	4369	FL	1/4/2022	1/13/2022
610491	4UZFCHFE4NCNT8673	2022	DS	DP	4369	FL	12/6/2021	12/15/2021
610495	4VZAU1D99NC091619	2022	DS	DP	4369	S	12/6/2021	12/15/2021
610496	4VZAU1D95NC091763	2022	DS	DP	4081	S	12/6/2021	12/14/2021
610497	4VZAU1D91NC091825	2022	DS	DP	4369	S	1/5/2022	1/14/2022
610498	4VZAU1D96NC091822	2022	DS	DP	4326	S	1/3/2022	1/13/2022
610504	4VZAU1D96NC091819	2022	DS	DP	4328	S	1/7/2022	1/19/2022
610511	4UZFCHFE8NCNT4920	2022	DS	DP	4369	FL	12/3/2021	12/14/2021
610515	4VZAU1D97NC091764	2022	DS	DP	4020	S	12/3/2021	12/13/2021
610516	4VZAU1D99NC091622	2022	DS	DP	4369	S	1/3/2022	1/12/2022
610518	4UZFCHFE5NCNU5373	2022	DS	DP	4081	FL	1/10/2022	1/19/2022
610519	4UZFCHFE7NCNU5374	2022	DS	DP	4081	FL	12/16/2021	1/12/2022
610522	4VZAU1D9XNC091824	2022	DS	DP	4369	S	1/7/2022	1/19/2022
610547	4VZAU1D95NC091620	2022	DS	DP	4369	S	12/9/2021	1/4/2022
610557	4VZAU1D90NC091847	2022	DS	DP	4369	S	2/7/2022	2/14/2022
610574	4VZAU1D98PC091260	2023	DS	DP	4325	S	1/20/2022	2/7/2022
711120	4VZAT1D95NC091989	2022	NA	DP	3543	S	1/12/2022	1/21/2022
711127	4UZACEFE7NCNU2628	2022	NA	DP	3543	FL	1/19/2022	2/7/2022
711192	4UZACEFE3NCNU4053	2022	NA	DP	3543	FL	12/14/2021	1/10/2022
711195	4VZAT1D95NC091992	2022	NA	DP	3543	S	1/4/2022	1/14/2022
711211	4VZAT1D98NC091887	2022	NA	DP	3543	S	1/18/2022	1/27/2022
711225	4UZACEFEXNCNU4051	2022	NA	DP	3543	FL	1/3/2022	1/13/2022
711258	4UZACEFE5NCNU1767	2022	NA	DP	3543	FL	1/3/2022	1/12/2022
711287	4VZAT1D9XNC092085	2022	NA	DP	3543	S	1/24/2022	2/9/2022
711291	4UZACEFE5NCNU2627	2022	NA	DP	3543	FL	12/13/2021	1/5/2022
711293	4VZAT1D97NC091993	2022	NA	DP	3543	S	1/10/2022	1/19/2022
711298	4VZAT1D96NC091886	2022	NA	DP	3543	S	1/5/2022	1/18/2022
711346	4UZACEFE1NCNU4052	2022	NA	DP	3543	FL	12/16/2021	1/11/2022
711348	4VZAT1D99NC091851	2022	NA	DP	3543	S	12/13/2021	1/4/2022
711349	4UZACEFE3NCNU1766	2022	NA	DP	3543	FL	12/9/2021	1/3/2022
711350	4UZACEFE1NCNU1765	2022	NA	DP	3545	FL	12/3/2021	12/13/2021
711369	4UZACEFEXNCNU1764	2022	NA	DP	3543	FL	1/20/2022	2/8/2022
711373	4VZAT1D97PC091253	2023	NA	DP	3545	S	1/17/2022	1/26/2022

Prod#	VIN Number	Year	Brand	Type	Floor	Chassis	Date In	Date Off
801457	4VZVU1E98NC091983	2022	EX	DP	4551	S	12/9/2021	1/4/2022
801493	4VZVU1E97NC092039	2022	EX	DP	4551	S	1/13/2022	1/25/2022
801523	4VZVU1R10PC091256	2023	EX	DP	4521	S	1/12/2022	1/25/2022
905006	4VZVU1E92NC092031	2022	MA	DP	4118	S	1/4/2022	1/14/2022
905007	4VZVU1E1XNC092322	2022	MA	DP	4118	S	1/18/2022	1/26/2022
905008	4VZVU1E99NC091829	2022	MA	DP	4551	S	12/16/2021	1/11/2022
905019	4VZVU1E91PC091259	2023	MA	DP	4118	S	1/27/2022	2/11/2022
CANADIAN Units								
610075	4UZFCHFE5NCNU4062	2022	DS	DP	4081	FL	12/15/2021	1/10/2022
610533	4UZFCHFE2NCNX7682	2022	DS	DP	4081	FL	1/13/2022	1/25/2022