

Newmar Corporation

PO Box 30
Nappanee, IN 46550



WHEN YOU KNOW THE DIFFERENCE.

RSB 613
November 1, 2024

NHTSA #24V 787
TC #2024-629

RECALL SERVICE BULLETIN

AFFECTED MODELS

2023 – 2025 :: Super Star

DESCRIPTION

On certain motorhomes, the tire valve extensions for the inner wheels may get damaged by contact with the outer wheels, which may cause the inner tire to gradually lose air pressure.

ISSUE

Low pressure on the inner rear tire could overload the outer tire and cause a rear tire failure, which may cause the coach's rear to sway and increase the risk of a crash.

UNITS AFFECTED

Please refer to the attached population list for affected units and VINs.

CORRECTIVE ACTION

Customers may perform this recall by using the QR code to access quick and easy instructions for valve extension removal.

Customers completing the recall must fill out the form opened by the QR code to complete this recall and close the open recall.

Customers unable to complete the recall need to schedule an appointment and take the letter to an authorized Newmar dealer or authorized service center for them to perform the recall.



DEALER ACTION

If the customer needs assistance removing the valve stem extension, follow the attached instructions and file a warranty claim with pictures once the recall is completed. You may also fill out the verification form via the QR code if desired; however, the claim will still need to be submitted. If you need assistance, contact your Newmar Service Account Manager.

FLAT RATE CODE: 24V 787

LABOR TIME: .2 hr.

CUSTOMER NOTE

If you need further assistance, contact your Newmar Brand Specialist.

IMPORTANT: Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.

NOTICE: Any technical information published in this bulletin is intended for use only by a qualified, Newmar-authorized service technician. Newmar is not responsible for the misuse of this information.



WHEN YOU KNOW THE DIFFERENCE.

IMPORTANT SAFETY RECALL NOTICE

Date: October 29, 2023

Subject: Recall Campaign 24V-787: Loss of rear tire air pressure

Newmar Campaign No.: 613 RSB

This notice is sent to you as a Newmar Dealer in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific Newmar recreational vehicles.

REASON FOR THIS RECALL

On certain motorhomes, the tire valve extensions for the inner wheels may get damaged by contact with the outer wheels. If this happens, the inner tire could gradually lose air pressure. This could overload the outer tire and cause it to fail.

A rear tire failure could cause the rear of the coach to sway and increase the risk of crash.

Motorhomes included in this recall include:

2023-2024 Super Star Class C motorhomes.

2025 Super Star Class C motorhome.

OWNER NOTIFICATION

Newmar will direct any customers in the population of this recall to have the inner wheel tire valve stem extension removed. This can be done by taking their unit to a Newmar authorized service center to have the rear inner wheel tire valve extension removed, or by the customer removing the valve stem extension themselves per the remedy instructions that will be provided with the customer notification letters. All repairs will be at no cost to the customer.

DEALER CAMPAIGN RESPONSIBILITY

Dealers are to provide to all customers/owner vehicles the service of completing this campaign at no charge to the customer/owner regardless of vehicle age, vehicle mileage, or ownership at the time of repair.

PLEASE NOTE: Federal law requires dealers to complete this recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty. Correct all vehicles in your new vehicle inventory before delivery.

REPAIR PROCEDURE

Newmar will provide the work instructions, the work instructions will be published on Newpar. The estimated date for work instructions to be published is 10/29/2023.

The National Traffic and Motor Vehicle Safety Act requires that each vehicle, which is subject to a recall campaign of this type, must be satisfactorily repaired within a reasonable time after the owner has tendered it for repair. Every effort must be made to promptly schedule an appointment with each owner and to repair their vehicle as soon as possible. Vehicle owners are being notified of this recall and have been instructed to contact Newmar and/or the National Highway Traffic Safety Administration if the condition is not remedied within a reasonable time.

If you should have any questions, please contact your service account manager direct or the Newmar service department at: 1-866-290-5371.

Thank you for your cooperation.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE.

IMPORTANT SAFETY RECALL

This notice applies to your vehicle VIN. # _____
Name _____
Address _____
City, State Zip code _____

Date: December 10, 2024

Motor Vehicle Recall Notification – NHSTA Recall Campaign No. 24V-787, Newmar Campaign No. 613 RSB

Dear Valued Customer:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

REASON FOR THIS RECALL

Newmar Corporation has decided that on certain motorhomes, the tire valve extensions for the rear inner wheels may get damaged by contact with the outer wheels. If this happens, the inner tire could gradually lose air pressure. This could overload the outer tire and cause it to fail.

These motorhomes require immediate service. Continued use poses a potential safety hazard.

The Safety Risk

Overloading may cause the rear tire to fail, increasing the risk of a crash.

WHAT WE WILL DO

Newmar will direct any customers in the population of this recall to have the inner wheel tire valve stem extension removed. This can be done by taking your unit to a Newmar authorized service center to have the rear inner wheel tire valve extension removed, or by the customer removing the valve stem extension themselves per the remedy instructions that will be provided with the customer notification letters. All repairs will be at no cost to the customer.

WHAT YOU NEED TO DO

As this defect does affect motor vehicle safety, it is recommended that you call Newmar service department immediately at **1-800-731-8300**. An associate will assist you in making an appointment to have this repair completed or assist you with how to handle the documentation of the recall completion if you choose to remove the valve stem extension yourself per the remedy instructions provided.

Federal regulations require that any vehicle lessor receiving this recall notification must forward a copy of this notice to the lessee within ten days.

If you have had the repair performed before receiving this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy. For additional information, contact Newmar Corporation at:

Service Department
Newmar Corporation
355 N Delaware St
Nappanee, IN 46550-0030

Newmar dealers are best equipped to provide service to ensure your vehicle is corrected as promptly as possible. HOWEVER, if you take your vehicle to your dealer on the scheduled date and this condition is not remedied on that date or within five days; please contact the Newmar Corporation Customer Service Department at 1-800-731-8300. You may also submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave., SE., Washington DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.

If you no longer own this vehicle, please furnish us the complete name, phone number, e-mail and physical address of the person or dealership you sold or traded your vehicle to. Thank you for your cooperation.

Your safety and satisfaction with your Newmar product is important to us and we regret any inconvenience to you.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE.

IMPORTANT SAFETY RECALL NOTICE

Date: October 24, 2024

Subject: Transport Canada Recall Campaign No. 2024-629, Newmar Campaign No. 613 RSB

This notice is sent to you as a Newmar Dealer in accordance with the requirements of the *Canada Motor Vehicle Safety Act*. Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific Newmar recreational vehicles.

REASON FOR THIS RECALL

Issue:

On a small number of motorhomes, the tire valve stem extensions for the inner wheels may become damaged by contact with the outer wheels. If this happens, the inner tire could lose air pressure. This could overload the outer tire and cause it to fail.

Safety Risk:

A tire failure could cause a loss of control and increase the risk of a crash

Corrective Actions:

Newmar will notify owners by mail and provide you with instructions for how to remove the inner valve stem extensions. Alternatively, you may schedule an appointment to have the inner valve stem extensions removed at a Newmar dealership.

The vehicle models involved in this recall are:

2023-2024 Super Star Class C motorhomes.

DEALER CAMPAIGN RESPONSIBILITY

Dealers are to provide to all customers/owner vehicles the service of completing this campaign at no charge to the customer/owner regardless of vehicle age, vehicle mileage, or ownership at the time of repair.

PLEASE NOTE: Dealers are required to complete this recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty. Correct all vehicles in your new vehicle inventory before delivery.

REPAIR PROCEDURE

Newmar will direct any customers in the population of this recall to have the inner wheel tire valve stem extension removed. This can be done by taking their unit to a Newmar authorized service center to have the rear inner wheel tire valve extension removed, or by the customer removing the valve stem extension themselves per the remedy instructions that will be provided with the customer notification letters. All repairs will be at no cost to the customer.

Each vehicle, which is subject to a recall campaign of this type, must be satisfactorily repaired within a reasonable time after the owner has tendered it for repair. Every effort must be made to promptly schedule an appointment with each owner and to repair their vehicle as soon as possible. Vehicle owners are being notified of this recall and have been instructed to contact Newmar and/or Transport Canada if the condition is not remedied within a reasonable time.

If you should have any questions, please contact your service account manager direct or the Newmar service department at: 1-866-290-5371.

Thank you for your cooperation.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE.

VIN#
make, model, model year
Name
Address
City, State Zip code

Date: 12/10/2024
Motor Vehicle Recall Notification - Recall Campaign No. 2024-629

Dear Valued Customer:

This notice is sent to you in accordance with the requirements of the *Canada Motor Vehicle Safety Act*.

This is to inform you that your vehicle may contain a defect that could affect the safety of a person.

REASON FOR THIS RECALL

Newmar Corporation has decided that a defect, which relates to motor vehicle safety, exists in specific motorhome built on Freightliner Trucks North America Chassis.

Issue:

On a small number of motorhomes, the tire valve stem extensions for the inner wheels may become damaged by contact with the outer wheels. If this happens, the inner tire could lose air pressure. This could overload the outer tire and cause it to fail.

Safety Risk:

A tire failure could cause a loss of control and increase the risk of a crash.

Corrective Actions:

Newmar will notify owners by mail and provide you with instructions for how to remove the inner valve stem extensions. Alternatively, you may schedule an appointment to have the inner valve stem extensions removed at a Newmar dealership.

The motorhomes require immediate service. Continued use poses a potential safety hazard.

WHAT WE WILL DO

Newmar will direct any customers in the population of this recall to have the inner wheel tire valve stem extension removed. This can be done by taking your unit to a Newmar authorized service center to have the rear inner wheel tire valve extension removed, or by the customer removing the valve stem extension themselves per the remedy instructions that will be provided with the customer notification letters. All repairs will be at no cost to the customer.

WHAT YOU NEED TO DO

As this defect does affect motor vehicle safety, it is recommended that you call Newmar service department immediately at **1-800-731-8300**. An associate will assist you in making an appointment to have this repair completed.

Federal regulations require that any vehicle lessor receiving this recall notification must forward a copy of this notice to the lessee within ten days.

If you have had the repair performed before receiving this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy. For additional information contact Newmar Corporation at:

Service Department
Newmar Corporation
355 N Delaware St
Nappanee, IN 46550-0030

Authorized Service Facilities, are best equipped to obtain parts and provide service to ensure your vehicle is corrected as promptly as possible. HOWEVER, if you take your vehicle to your Authorized Service Facility on the scheduled date and this condition is not remedied on that date or within five days; please contact the Newmar Corporation Customer Service Department at 1-800-731-8300.

If you no longer own this vehicle, please furnish us the complete name and address of the person or dealership you sold or traded your vehicle to. Thank you for your cooperation.

Your safety and satisfaction with your Newmar product is important to us and we regret any inconvenience to you.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE.

NIV#

la fabrique, le modèle, l'année de modèle

Nom

Adresse

Ville, code postal de l'État

Date : 12/10/2024

Avis de rappel de véhicules automobiles - Campagne de rappel no 2024-629

Cher client apprécié :

Le présent avis vous est envoyé conformément aux exigences de la *Loi sur la sécurité automobile*.

La présente a pour but de vous informer que votre véhicule est susceptible d'avoir un défaut qui pourrait porter atteinte à la sécurité humaine.

RAISON DE CE RAPPEL

Newmar Corporation a décidé qu'un défaut, qui se rapporte à la sécurité des véhicules automobiles, existe dans un camping-car spécifique construit sur le châssis Freightliner Trucks North America.

Question en litige :

Sur un petit nombre de camping-cars, les extensions de tige de soupape de pneu pour les roues intérieures peuvent être endommagées par le contact avec les roues extérieures. Si cela se produit, le pneu intérieur pourrait perdre de la pression d'air. Cela pourrait surcharger le pneu extérieur et le faire tomber en panne.

Risque pour la sécurité :

Une défaillance de pneu pourrait causer une perte de maîtrise et augmenter le risque d'accident.

Mesures correctives :

Newmar avisera les propriétaires par la poste et vous fournira des instructions sur la façon de retirer les extensions de tige de la valve interne. Vous pouvez également prendre rendez-vous pour faire enlever les extensions de tige de soupape intérieure chez un concessionnaire Newmar.

Les camping-cars nécessitent un service immédiat. L'utilisation continue présente un danger potentiel pour la sécurité.

CE QUE NOUS ALLONS FAIRE

Newmar ordonnera à tous les clients de la population de ce rappel de faire retirer le prolongement de la tige de la soupape de roue intérieure. Cela peut être fait en amenant votre unité à un centre de service autorisé Par Newmar pour faire retirer l'extension de la soupape de pneu de la roue intérieure arrière, ou en retirant le client lui-même l'extension de tige de soupape selon les instructions de recours qui seront fournies avec les lettres d'avis aux clients. Toutes les réparations seront sans frais pour le client.

CE QUE VOUS DEVEZ FAIRE

Comme ce défaut affecte la sécurité des véhicules automobiles, il est recommandé d'appeler immédiatement le service de Newmar au **1-800-731-8300**. Un associé vous aidera à prendre rendez-vous pour que cette réparation soit terminée.

La réglementation fédérale exige que tout locateur de véhicule recevant cet avis de rappel transmette une copie de cet avis au locataire dans les dix jours.

Si vous avez fait effectuer la réparation avant de recevoir cette lettre, vous pourriez être admissible à recevoir un remboursement pour le coût de l'obtention d'un recours préalable à la notification. Pour de plus amples renseignements, veuillez communiquer avec Newmar Corporation à l'adresse suivante :

Département des services
Newmar Corporation
355 N Delaware St
Nappanee, IN 46550-0030

Les installations de service autorisées sont les mieux équipées pour obtenir des pièces et fournir un service afin de s'assurer que votre véhicule est corrigé le plus rapidement possible. TOUTEFOIS, si vous apprenez votre véhicule à votre centre de service autorisé à la date prévue et que cette condition n'est pas corrigée à cette date ou dans les cinq jours ; veuillez communiquer avec le service à la clientèle de Newmar Corporation au 1-800-731-8300.

Si vous n'êtes plus propriétaire de ce véhicule, veuillez nous fournir le nom complet et l'adresse de la personne ou du concessionnaire à qui vous avez vendu ou échangé votre véhicule. Je vous remercie de votre coopération.

Votre sécurité et votre satisfaction à l'égard de votre produit Newmar sont importantes pour nous et nous regrettons tout inconvénient pour vous.

Cordialement,

Newmar Corporation

Instructions for Valve Stem Extension Recall 24V 787


Inspect the rear wheels to see if valve stem extensions are installed on your coach.

If valve stem extensions are installed, take pictures of each wheel. Then submit your information and the photos via Newmar's recall form. If valve stem extensions are installed, proceed with the following recall instructions to remove the valve stem extension(s). There is no need to take the coach to a dealership to have the recall completed.

Determine if you are willing to complete the recall yourself or would like a dealer to complete the recall for you. If you do not want to complete the recall yourself, contact a Newmar-authorized dealer or service center to schedule the recall.

If performing the recall yourself:

1. Remove the valve stem cap.
2. Remove the rubber grommet from the outer rim.
3. Remove the valve stem extension from the rear inner dual tire by rotating the extension counterclockwise.
4. Test and adjust the rear inner tire pressure to ensure correct air pressure and that air loss did not occur while removing the extension. This can be checked using a long, truck-style tire pressure gauge and a long, truck-style air chuck.
5. Install the valve stem cap you previously removed using long nose pliers or a valve capper tool.
6. Take a photo of the rear tire and rim showing the extension and grommet have been removed.
7. Scan the QR code or use web link below to fill out the recall form. Remember to attach the pictures you took to verify the recall has been completed.

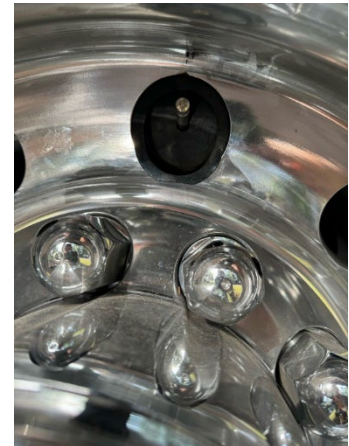

Smart Device (Phone or Tablet) – Easiest Option

Scan the QR code to access the form. When you reach the photo submission line in the form, click "Browse Files" and when prompted, either select the files or camera option.



- If you took a photo previously, select it using the files option to attach it to the form.
- If you need to take a photo, select the camera option, and allow access to the camera when prompted.

Once the photo is attached, complete the form, and then make sure to click "Submit." If any required fields are not completed, you will be prompted to fill in any missing information.

Computer

In an internet browser, type in the web link to access the form:

<https://app.smartsheet.com/b/form/f1927c03f4cf4bd9b618f66101533c04>.

When you reach the photo submission line in the form, click "Browse Files," and attach the photos you took. Once the photo is attached, complete the form, and then make sure to click "Submit." If any required fields are not completed, you will be prompted to fill in any missing information.

For dealers and authorized service centers, follow the steps 1-6 above and submit a warranty claim with pictures to Newmar.

Instructions pour le rappel d'extension de tige de valve 2024-629

Inspectez les roues arrière pour voir si des extensions de tige de soupape sont installées sur votre voiture.

Si des extensions de tige de soupape sont installées, prenez des photos de chaque roue.

Ensuite, soumettez vos informations et les photos via le rappel de Newmar forme.

Si des extensions de tige de vanne sont installées, procédez comme suit

Consignes de rappel pour enlever la ou les extensions de tige de vanne.

Il n'y a pas de besoin d'emmener l'autocar chez un concessionnaire pour que le

rappel soit terminé.

Déterminez si vous êtes prêt à effectuer le rappel vous-même ou si vous le feriez comme un concessionnaire pour compléter le rappel pour vous. Si vous ne voulez pas effectuer le rappel vous-même, communiquer avec un concessionnaire agréé par Newmar ou centre de service pour planifier le rappel.

Si vous effectuez le rappel vous-même :

1. Retirez le capuchon de la tige de la vanne.
2. Retirez l'œillet en caoutchouc de la jante extérieure.
3. Retirez l'extension de la tige de soupape du pneu double intérieur arrière en faisant pivoter le extension dans le sens antihoraire.
4. Testez et ajustez la pression intérieure arrière des pneus pour assurer une pression d'air correcte et cet air la perte ne s'est pas produite pendant le retrait de l'extension. Cela peut être vérifié à l'aide d'un long, manomètre de pneu de style camion et un long mandrin à air de style camion.
5. Installez le capuchon de tige de soupape que vous avez précédemment retiré à l'aide de longues pinces à nez ou d'une vanne outil capper.
6. Prenez une photo du pneu arrière et de la jante montrant l'extension et l'œillet ont été supprimé.




7. Scannez le code QR ou utilisez le lien Web ci-dessous pour remplir le formulaire de rappel.
N'oubliez pas de

joignez les photos que vous avez prises pour vérifier que le rappel est terminé.

Appareil intelligent (téléphone ou tablette) – Option la plus simple

Scannez le code QR pour accéder au formulaire. Lorsque vous atteignez la ligne de soumission de photos

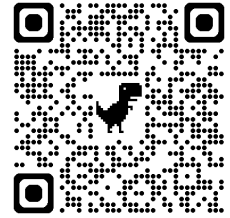

dans le formulaire, cliquez sur « Parcourir les fichiers » et lorsque vous y êtes invité, sélectionnez les fichiers ou

option de caméra.

- Si vous avez déjà pris une photo, sélectionnez-la à l'aide de l'option fichiers pour la joindre au formulaire.
- Si vous devez prendre une photo, sélectionnez l'option de l'appareil photo et autorisez l'accès à l'appareil photo

lorsque vous y êtes invité.

Une fois la photo jointe, remplissez le formulaire, puis assurez-vous de cliquer sur « Soumettre ». Le cas échéant

les champs obligatoires ne sont pas remplis, vous serez invité à remplir toute information manquante.

Ordinateur

Dans un navigateur Internet, tapez le lien Web pour accéder au formulaire :

<https://app.smartsheet.com/b/form/f1927c03f4cf4bd9b618f66101533c04>.

Lorsque vous atteignez la ligne de soumission de photos dans le formulaire, cliquez sur « Parcourir les fichiers » et joignez le bouton

les photos que vous avez prises. Une fois la photo jointe, remplissez le formulaire, puis assurez-vous de cliquer sur

« Soumettez. » Si des champs obligatoires ne sont pas remplis, vous serez invité à remplir tous les champs manquants

l'information.

Pour les concessionnaires et les centres de service autorisés, suivez les étapes 1 à 6 ci-dessus et soumettez un

réclamation de garantie avec des photos à Newmar.

Prod#	VIN Number	Year	Brand	Type	Floor	Chassis	Date	Date
USA Units								
230391	3ALACYFE8RDUR6395	2023	SS	CC	4061	FS	5/22/2023	6/1/2023
230394	3ALACYFE3RDUR6403	2023	SS	CC	4065	FS	5/25/2023	6/7/2023
230400	3ALACYFE3RDUR6398	2023	SS	CC	3729	FS	5/22/2023	6/2/2023
230401	3ALACYFEXRDUR6396	2023	SS	CC	3727	FS	6/2/2023	6/12/2023
230409	3ALACYFE1RDUR6402	2023	SS	CC	4059	FS	4/25/2023	5/4/2023
230417	3ALACYFE5RDUR6399	2023	SS	CC	4059	FS	5/25/2023	6/6/2023
230419	1FVACYFE2PHNW3998	2023	SS	CC	4061	FS	3/13/2023	3/22/2023
230434	1FVACYFE2PHNW3970	2023	SS	CC	4059	FS	4/11/2023	4/19/2023
230435	1FVACYFE2PHNW4004	2023	SS	CC	4065	FS	3/23/2023	4/13/2023
230441	1FVACYFE8PHNW3990	2023	SS	CC	4059	FS	3/9/2023	3/20/2023
230442	1FVACYFEXPHNW4008	2023	SS	CC	3729	FS	3/14/2023	3/23/2023
230443	3ALACYFE7RDUR6405	2023	SS	CC	4059	FS	4/26/2023	5/8/2023
230444	1FVACYFE3PHNW3993	2023	SS	CC	4059	FS	3/14/2023	3/27/2023
230445	3ALACYFEXPDNW4015	2023	SS	CC	4065	FS	4/13/2023	4/24/2023
230447	3ALACYFEXRDUR6432	2023	SS	CC	4061	FS	8/8/2023	8/17/2023
230451	1FVACYFE7PHNW3995	2023	SS	CC	3727	FS	4/17/2023	4/26/2023
230452	3ALACYFE9PDNW4023	2023	SS	CC	4059	FS	4/27/2023	5/9/2023
230454	1FVACYFE1PHNW4009	2023	SS	CC	4059	FS	3/16/2023	3/30/2023
230455	3ALACYFE7RDUR6422	2023	SS	CC	4065	FS	7/21/2023	8/1/2023
230456	1FVACYFEXPHNW4011	2023	SS	CC	4059	FS	3/27/2023	4/14/2023
230457	1FVACYFE8PHNW4010	2023	SS	CC	4065	FS	4/12/2023	4/20/2023
230458	3ALACYFE7PDNW4019	2023	SS	CC	3727	FS	5/1/2023	5/10/2023
230461	3ALACYFE2PDNW4025	2023	SS	CC	4059	FS	4/14/2023	4/25/2023
230471	3ALACYFE2RDUR6389	2023	SS	CC	4059	FS	5/24/2023	6/5/2023
230472	3ALACYFE8PDNW4014	2023	SS	CC	3727	FS	5/3/2023	5/15/2023
230473	3ALACYFE0RDUR6410	2023	SS	CC	3729	FS	6/12/2023	6/21/2023
230474	3ALACYFE0PDNW4024	2023	SS	CC	3729	FS	5/4/2023	5/17/2023
230475	3ALACYFE9RDUR6390	2023	SS	CC	3727	FS	6/5/2023	6/13/2023
230477	3ALACYFE2RDUR6408	2023	SS	CC	4059	FS	6/14/2023	7/11/2023
230482	3ALACYFEXRDUR6415	2023	SS	CC	3727	FS	7/18/2023	7/26/2023
230483	3ALACYFE2RDUR6425	2023	SS	CC	3727	FS	8/18/2023	8/30/2023
230484	3ALACYFE6RDUR6427	2023	SS	CC	4059	FS	8/23/2023	9/5/2023
230486	3ALACYFEXRDUR5300	2023	SS	CC	4059	FS	7/13/2023	7/21/2023
230487	3ALACYFE7RDUR6419	2023	SS	CC	4059	FS	8/10/2023	8/21/2023
230488	3ALACYFE9RDUR6406	2023	SS	CC	4065	FS	6/8/2023	6/16/2023
230491	3ALACYFE1RDUR5301	2023	SS	CC	4065	FS	7/14/2023	7/24/2023
230492	3ALACYFE7RDUR5304	2023	SS	CC	4061	FS	8/3/2023	8/15/2023
230494	1FVACYFE1PHNW4012	2023	SS	CC	4061	FS	3/27/2023	4/14/2023
230495	3ALACYFE3RDUR6434	2023	SS	CC	4059	FS	9/1/2023	9/12/2023
230497	3ALACYFE8RDUR6400	2023	SS	CC	4061	FS	5/3/2023	5/15/2023
230501	3ALACYFE5RDUR6404	2023	SS	CC	3727	FS	6/6/2023	6/14/2023
230502	3ALACYFE6RDUR6413	2023	SS	CC	3729	FS	6/13/2023	6/22/2023

Prod#	VIN Number	Year	Brand	Type	Floor	Chassis	Date	Date
230503	3ALACYFE1RDUR6416	2023	SS	CC	4059	FS	7/24/2023	8/2/2023
230507	1FVACYFE1PHNW3992	2023	SS	CC	4061	FS	3/15/2023	3/29/2023
230508	3ALACYFE2RDUR6392	2023	SS	CC	4059	FS	5/8/2023	5/17/2023
230513	3ALACYFE9RDUR6423	2023	SS	CC	3727	FS	8/14/2023	8/22/2023
230514	3ALACYFE0RDUR6407	2023	SS	CC	4059	FS	6/14/2023	6/22/2023
230515	3ALACYFE5RDUR5303	2023	SS	CC	4059	FS	7/27/2023	8/7/2023
230516	3ALACYFE4RDUR6409	2023	SS	CC	4059	FS	6/21/2023	7/17/2023
230517	3ALACYFE7PDNW4022	2023	SS	CC	4059	FS	3/28/2023	4/17/2023
230518	3ALACYFE1RDUR6433	2023	SS	CC	4059	FS	8/2/2023	8/15/2023
230520	3ALACYFEXRDUR6401	2023	SS	CC	4059	FS	7/12/2023	7/20/2023
230522	3ALACYFE6RDUR6430	2023	SS	CC	3727	FS	8/17/2023	8/29/2023
230523	3ALACYFE8RDUR6431	2023	SS	CC	4061	FS	8/30/2023	9/8/2023
230526	1FVACYFE1PHNW3989	2023	SS	CC	3729	FS	3/8/2023	3/16/2023
230527	3ALACYFE1PDNW4016	2023	SS	CC	4065	FS	4/20/2023	5/2/2023
230528	3ALACYFE1RDUR6397	2023	SS	CC	4059	FS	5/16/2023	5/30/2023
230529	3ALACYFE4RDUR6393	2023	SS	CC	4059	FS	5/15/2023	5/25/2023
230531	1FVACYFE5PHNW4045	2023	SS	CC	4059	FS	3/30/2023	4/18/2023
230533	3ALACYFE5RDUR6421	2023	SS	CC	4059	FS	7/20/2023	7/31/2023
230534	3ALACYFE3RDUR5302	2023	SS	CC	4061	FS	7/27/2023	8/8/2023
230535	3ALACYFE4PDNW4026	2023	SS	CC	4059	FS	4/24/2023	5/3/2023
230536	3ALACYFE8RDUR6414	2023	SS	CC	4065	FS	6/22/2023	7/18/2023
230537	3ALACYFE5RDUR6418	2023	SS	CC	4065	FS	7/21/2023	8/1/2023
230538	3ALACYFE2RDUR6411	2023	SS	CC	4059	FS	6/9/2023	6/19/2023
230539	3ALACYFE4RDUR6412	2023	SS	CC	4059	FS	6/1/2023	6/12/2023
230541	3ALACYFE8RDUR6428	2023	SS	CC	4065	FS	8/9/2023	8/18/2023
230542	3ALACYFE4RDUR6426	2023	SS	CC	4059	FS	8/2/2023	8/14/2023
230543	3ALACYFE3RDUR6420	2023	SS	CC	3727	FS	8/15/2023	8/23/2023
230544	1FVACYFE5RHVA6757	2024	SS	CC	3731	FS	10/3/2023	10/12/2023
230545	1FVACYFE2RHUR6449	2024	SS	CC	3731	FS	10/12/2023	10/20/2023
230546	1FVACYFE5RHVA6760	2024	SS	CC	4065	FS	10/20/2023	10/31/2023
230547	1FVACYFE2RHVA6764	2024	SS	CC	4059	FS	11/1/2023	11/9/2023
230548	1FVACYFE2RHVA6750	2024	SS	CC	4059	FS	11/7/2023	11/14/2023
230549	1FVACYFE3RHVA6756	2024	SS	CC	4059	FS	11/8/2023	11/16/2023
230550	1FVACYFE4RHVA6751	2024	SS	CC	4059	FS	9/11/2023	9/28/2023
230551	1FVACYFE9RHVA6745	2024	SS	CC	4065	FS	10/11/2023	10/19/2023
230552	1FVACYFE2RHVA6747	2024	SS	CC	3727	FS	8/1/2023	8/10/2023
230555	1FVACYFE9RHVA6762	2024	SS	CC	3731	FS	9/26/2023	10/5/2023
230556	3ALACYFE5RDVE7993	2024	SS	CC	4065	FS	12/21/2023	1/19/2024
230558	1FVACYFE7RHUR6463	2024	SS	CC	3727	FS	12/1/2023	12/12/2023
230560	3ALACYFE1RDVE7988	2024	SS	CC	4059	FS	12/13/2023	12/21/2023
230561	1FVACYFE6RHUR6437	2024	SS	CC	4059	FS	11/22/2023	12/7/2023
230562	1FVACYFE3RHUR6458	2024	SS	CC	3727	FS	11/17/2023	12/1/2023
230563	3ALACYFE3RDUR6417	2023	SS	CC	4059	FS	7/26/2023	8/7/2023

Prod#	VIN Number	Year	Brand	Type	Floor	Chassis	Date	Date
230564	1FVACYFE0RHVA6746	2024	SS	CC	4059	FS	10/26/2023	11/7/2023
230565	1FVACYFE1RHUR6443	2024	SS	CC	3727	FS	10/6/2023	10/16/2023
230566	1FVACYFE9RHUR6447	2024	SS	CC	4059	FS	12/7/2023	12/18/2023
230567	1FVACYFEXRHVA6754	2024	SS	CC	4059	FS	10/5/2023	10/13/2023
230568	1FVACYFE6RHVA6752	2024	SS	CC	3727	FS	9/14/2023	10/4/2023
230570	1FVACYFE8RHVA6767	2024	SS	CC	3727	FS	9/27/2023	10/6/2023
230571	1FVACYFE4RHUR6467	2024	SS	CC	4059	FS	12/19/2023	1/16/2024
230572	1FVACYFE7RHVA6744	2024	SS	CC	4059	FS	9/7/2023	9/26/2023
230573	1FVACYFE9RHVA6759	2024	SS	CC	4061	FS	11/15/2023	11/29/2023
230574	1FVACYFE9RHUR6464	2024	SS	CC	3727	FS	12/15/2023	1/11/2024
230575	1FVACYFE5RHUR6462	2024	SS	CC	3731	FS	12/5/2023	12/14/2023
230576	1FVACYFEXRHUR6442	2024	SS	CC	4059	FS	12/12/2023	12/20/2023
230577	1FVACYFE4RHVA6765	2024	SS	CC	4065	FS	11/2/2023	11/10/2023
230578	1FVACYFE7RHUR6446	2024	SS	CC	4065	FS	11/14/2023	11/22/2023
230579	3ALACYFE0RDUR6424	2023	SS	CC	4065	FS	8/7/2023	8/16/2023
230580	3ALACYFEXRDUR6429	2023	SS	CC	4065	FS	8/22/2023	9/1/2023
230581	1FVACYFE3RHUR6444	2024	SS	CC	3727	FS	10/18/2023	10/26/2023
230582	1FVACYFE6RHVA6766	2024	SS	CC	4059	FS	11/8/2023	11/16/2023
230583	1FVACYFE4RHUR6436	2024	SS	CC	4059	FS	11/21/2023	12/4/2023
230584	1FVACYFE3RHUR6461	2024	SS	CC	3731	FS	11/6/2023	11/14/2023
230585	1FVACYFE1RHVA6755	2024	SS	CC	4065	FS	10/10/2023	10/18/2023
230588	1FVACYFEXRHUR6439	2024	SS	CC	3727	FS	10/25/2023	11/6/2023
230590	1FVACYFE7RHVA6761	2024	SS	CC	4059	FS	11/13/2023	11/21/2023
230591	1FVACYFE8RHUR6441	2025	SS	CC	4059	FS	11/2/2023	11/13/2023
230592	1FVACYFE8RHUR6438	2024	SS	CC	4059	FS	12/4/2023	12/13/2023
230598	3ALACYFE7RDVE7994	2024	SS	CC	4061	FS	12/20/2023	1/18/2024

Canadian Units

230446	1FVACYFE0PHNW4003	2023	SS	CC	4059	FS	3/9/2023	3/21/2023
230459	1FVACYFE0PHNW3997	2023	SS	CC	4061	FS	3/10/2023	3/22/2023
230478	1FVACYFE4PHNW3999	2023	SS	CC	4059	FS	4/18/2023	4/27/2023
230479	3ALACYFE3PDNW4017	2023	SS	CC	4061	FS	5/31/2023	6/8/2023
230506	3ALACYFE0RDUR6391	2023	SS	CC	4061	FS	5/10/2023	5/24/2023
230519	1FVACYFE6PHNW4006	2023	SS	CC	4059	FS	3/21/2023	4/11/2023
230530	3ALACYFE5PDNW4021	2023	SS	CC	3727	FS	5/9/2023	5/22/2023
230532	3ALACYFE6RDUR6394	2023	SS	CC	4059	FS	5/2/2023	5/11/2023
230557	1FVACYFE6RHVA6749	2024	SS	CC	4059	FS	6/20/2023	7/13/2023