



Technical Service Bulletin

BULLETIN INFORMATION

DATE ISSUED	MODEL YEAR(S) AFFECTED	MODEL(S) AFFECTED	TSB #
May 6, 2005	2004-2006	Essex / MADP	252

SYSTEMS AFFECTED

- | | |
|--|---|
| <input type="checkbox"/> Air Conditioning & Heating | <input type="checkbox"/> Electrical Components |
| <input checked="" type="checkbox"/> Appliances & Accessories | <input type="checkbox"/> Exterior Components |
| <input type="checkbox"/> Cabinets & Furniture | <input type="checkbox"/> Interior Components |
| <input type="checkbox"/> Chassis Components | <input type="checkbox"/> Plumbing & Bath Components |
| <input type="checkbox"/> Construction Components | <input type="checkbox"/> Windows, Awnings, Vents, & Doors |

PROBLEM DESCRIPTION

Poor refrigerator performance on certain units with Dometic refrigerator. Performance decreased by poor air flow across refer cooling unit because of restricted air movement by roof mounted vent. Norcold vent cover was installed on some models with Dometic refrigerators. Norcold vent does not allow for sufficient air movement to allow adequate ventilation of the cooling unit on the back of the refrigerator.

RECOMMENDED SOLUTION

On units equipped with Dometic refrigerator and Norcold roof mounted refer vent, change to less restrictive Dometic roof mounted refer vent. See attached photos for identification purposes, and order as necessary. Prior authorization required.

Dometic Refer Vent: Cap:20985p
Base: 06441

Repair Time: 1.0 labor

Labor Code: 0289

Photo required; discard old part when completed.

