72185 COUNTY ROAD 3 NAPPANEE, IN 46550

## NEWMAR CORPORATION WARRANTY DEPARTMENT

	800.858.4924
FAX	219.773.2007

TECHNICAL SERVICE BULLETIN								
DATE ISSUED	Model Year(s) Aff	ECTED	Model(s) Affected		TSB#			
10/20/2006	9/20/05 – 1/2/	05	All		268			
	Brand			Түре				
All	American Star		Mountain Aire		All	ТТП		
	Dutch Star		Kountry Aire		$\operatorname{F} \operatorname{W} \square$	САП		
	Kountry Star		Essex		DP 🗆	DB□		
Scottsdale $\square$	Northern Star		London Aire					
☐ Air Conditioning & Heating ☐ Electrical Components								
■ Appliances & Acce	☐ Exterior Components							
☐ Cabinets & Furniture ☐			☐ Interior Components					
☐ Chassis Components ☐			☐ Plumbing & Bath Components					
☐ Construction Components ☐ Windows, Awnings, Vents, & Doors					rs			
DESCRIPTION OF PROBLEM								
In a small number of double sidewall vent installations has recently been observed that a down draft can be created in the flue tube while the RV is traveling down the road and the refrigerator is operating in gas mode. The downdraft condition is caused by the location of the refrigerator compartment in the coach and air currents created as the RV moves. In extreme cases, the downdraft can force the flame to abnormally heat the area around the burner box causing the temperature sensor to trip, which in turn shuts down the refrigerator.								
RECOMMENDED SOLUTION								
Norcold has created a flu tube cap that will block these downdrafts. See manufactures attached repair directions. Contact manufacturer directly for additional information or instructions.								