72185 COUNTY ROAD 3 NAPPANEE, IN 46550

# NEWMAR CORPORATION WARRANTY DEPARTMENT

800.858.4924 Fax 219.773.2007

TECHNICAL SERVICE BULLETIN									
DATE ISSUED		MODEL YEAR(S) AFFECTED			Model(s) Affe	TSB#			
3/24/08		2007		I	All Spartan DP	3.33			
					w/Cummins engines				
BRAND					Түре				
All		American Star			Mountain Aire		All $\square$	ТТП	
Cypress		Dutch Star			Kountry Aire		$FW\square$	САП	
Northern Star		Kountry Star		-	Essex		D₽■	DB■	
Scottsdale		King Aire		-	London Aire		D1 —	<i>D D</i> –	
All Sta	ar ME	Ventana							
☐ Air Conditioning & Heating					☐ Electrical Components				
	l Appliances & Accessories				☐ Exterior Components				
	☐ Cabinets & Furniture				☐ Interior Components				
	Chassis Components				☐ Plumbing & Bath Components				
	Construction Components				☐ Windows, Awnings, Vents, & Doors				
DESCRIPTION OF PROBLEM									
"Engine Brake" light function was programmed "Disabled" in "Engine Programming Parameters".									
RECOMMENDED SOLUTION									
Re-program engine electronics via laptop. See attached Chassis Manufacturers procedure. Contact Spartan Motors if you have any questions regarding this Technical Service Bulletin. Spartan TSB08-570-001.									

**TSB08-570-001**February, 2008
Page 1 of 2

## TECHNICAL SERVICE BULLETIN

**SUBJECT**: Communication Systems – Engine Programming

APPLIES TO: Certain Spartan Motorhomes equipped with a 2007 emissions

engine and having a VDM (Vehicle Date of Manufacture) of

September 21, 2006 through September 02, 2007.

**CONDITION:** Engine brake light function was programmed "disable" in engine

programming parameters.

**SPECIAL** 

**EQUIPMENT:** PC equipped with Cummins Insite<sup>TM</sup> software.

PLEASE READ THE ENTIRE BULLETIN BEFORE PROCEEDING WITH ANY WORK. CONTACT SPARTAN CHASSIS IF THERE ARE ANY CONCERNS WITH THE PROCEDURES CONTAINED IN THIS DOCUMENT.

#### PART / SERVICE INFORMATION:

A CUMMINS AUTHORIZED DISTRIBUTOR IS REQUIRED TO PERFORM THE ENGINE CALIBRATION UPDATE.

Labor Time: 1.0 Hrs.

#### STEP-BY-STEP INSTRUCTIONS:

- 1. Observe all industry safety standards, disconnect any necessary power source and secure vehicle for engine parameters update.
- 2. Connect PC (with Insite<sup>TM</sup>) to the engine diagnostic port.
- 3. Refer to FIG. 2-1. Locate **Features and Parameters** and Expand the **Engine Brake Control** folder.

Technical Service Bulletins are intended for use by Professional Technicians only. They are written to guide Professional Technicians in performing service to vehicles of product specific nature in conjunction with industry standards. Professional Technicians are appropriately trained on industry standards and have the tools and equipment to perform procedures safely and properly.




# SPARTAN CHASSIS, INC.

TSB08-570-001

February, 2008 Page 2 of 2

### TECHNICAL SERVICE BULLETIN

- 4. Refer to FIG. 2-1. Locate the Engine Brake Lamp feature and change the ECM Value to read "Enable".
- Send change to engine and follow appropriate procedures to disconnect from the diagnostic port.

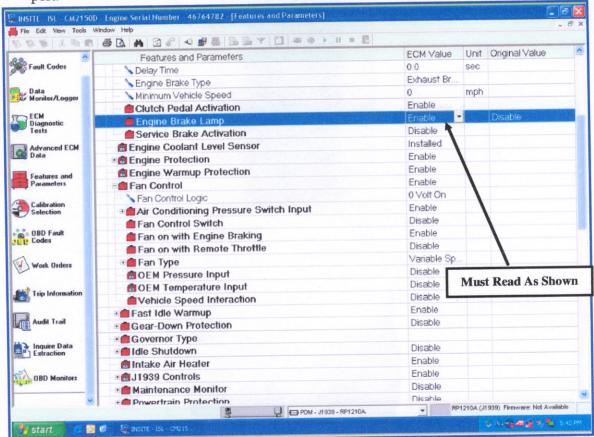

#### ENGINE BRAKE LAMP PARAMETER <u>FIG. 2-1</u>

Technical Service Bulletins are intended for use by Professional Technicians only. They are written to guide Professional Technicians in performing service to vehicles of product specific nature in conjunction with industry standards. Professional Technicians are appropriately trained on industry standards and have the tools and equipment to perform procedures safely and properly.