

NEWMAR CORPORATION WARRANTY DEPARTMENT

TECHNICAL SERVICE BULLETIN									
DATE ISSUED		MODEL YEAR(S) AFFECTED			MODEL(S) AFFECTED			TSB #	
11/14/96		1996-1997			ALL			136	
BRAND					TYPE				
All <input type="checkbox"/>	American Star <input type="checkbox"/>	Kountry Star <input checked="" type="checkbox"/>	Dutch Star <input type="checkbox"/>	All <input type="checkbox"/>	T T <input type="checkbox"/>	F W <input type="checkbox"/>			
NewAire <input type="checkbox"/>	Mountain Aire <input checked="" type="checkbox"/>	Kountry Aire <input checked="" type="checkbox"/>	London Aire <input checked="" type="checkbox"/>	C A <input checked="" type="checkbox"/>	D P <input checked="" type="checkbox"/>	D B <input type="checkbox"/>			
<input type="checkbox"/> Air Conditioning & Heating					<input type="checkbox"/> Electrical Components				
<input type="checkbox"/> Appliances & Accessories					<input type="checkbox"/> Exterior Components				
<input type="checkbox"/> Cabinets & Furniture					<input type="checkbox"/> Interior Components				
<input type="checkbox"/> Chassis Components					<input type="checkbox"/> Plumbing & Bath Components				
<input type="checkbox"/> Construction Components					<input checked="" type="checkbox"/> Windows, Awnings, Vents, & Doors				
DESCRIPTION OF PROBLEM									
Wind noise at passenger side entrance door by passenger side seat.									
RECOMMENDED SOLUTION									
Add l-shape trim under the front side of the door to divert air pass the hinges. Loosen the door on the hinge side by removing the screws and install the lip of the l-shape trim. Put the screws back in and reseal the door frame. L-shape trim is available through the Newmar parts department. This repair will take about one hour to complete.									

□

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.