

NEWMAR CORPORATION WARRANTY DEPARTMENT

TECHNICAL SERVICE BULLETIN			
DATE ISSUED	MODEL YEAR(S) AFFECTED	MODEL(S) AFFECTED	TSB #
2/24/99	1998-1999	ALL	171
BRAND		TYPE	
All <input checked="" type="checkbox"/> American Star <input type="checkbox"/> Kountry Star <input type="checkbox"/> Dutch Star <input type="checkbox"/>		All <input checked="" type="checkbox"/> T T <input type="checkbox"/> F W <input type="checkbox"/>	
NewAire <input type="checkbox"/> Mountain Aire <input type="checkbox"/> Kountry Aire <input type="checkbox"/> London Aire <input type="checkbox"/>		C A <input type="checkbox"/> D P <input type="checkbox"/> D B <input type="checkbox"/>	
<input type="checkbox"/> Air Conditioning & Heating			
<input type="checkbox"/> Electrical Components			
<input type="checkbox"/> Appliances & Accessories			
<input type="checkbox"/> Exterior Components			
<input type="checkbox"/> Cabinets & Furniture			
<input type="checkbox"/> Interior Components			
<input type="checkbox"/> Chassis Components			
<input checked="" type="checkbox"/> Plumbing & Bath Components			
<input type="checkbox"/> Construction Components			
<input type="checkbox"/> Windows, Awnings, Vents, & Doors			
DESCRIPTION OF PROBLEM			
SeaLand Technology technical bulletins 1002 and 1007.			
RECOMMENDED SOLUTION			
See the attached bulletins.			

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.

NEWMAR CORPORATION WARRANTY DEPARTMENT



Technical Bulletin

P. O. Box 38, Fourth Street, Big Prairie, Ohio 44611 USA
Telephone: 330/496-3211 . 800/321-9886 . Fax: 330/496-3097

Bulletin Number : 1002
Effective Date: August 1, 1998

Traveler® Toilet Odor



Product Affected: All 500, 900, and 2000 series Traveler toilets.

Symptom: Odor comes out of the overflow holes in the toilet bowl when the RV is in a forward motion.

Cause: On some toilet installations, the toilet bowl may have been rotated to compensate for a misaligned floor flange. If the bowl was not separated from the base when rotated, the seals may have rotated with the bowl causing the seals to be out of alignment with the water trap tube. This misalignment could create a path for odor to travel from the holding tank through the overflow holes.

Corrective Action: If odor is present, remove the bowl from the base and realign the seal hole with the base hole.

To eliminate this problem from occurring in the future, SeaLand Technology has redesigned the water trap tube to index the seals in the correct position. The tube previously fit below the seals and now extends up into them. The tube helps prevent the seals from being moved out of position if the bowl is not separated from the base before rotating. Figures below illustrate the old water trap tube and the new redesigned water trap tube.

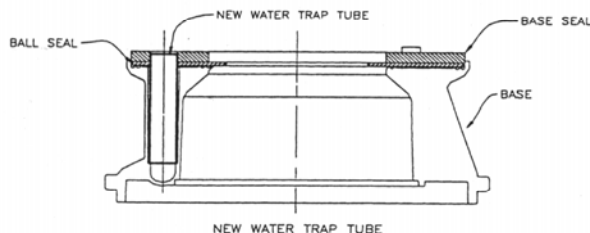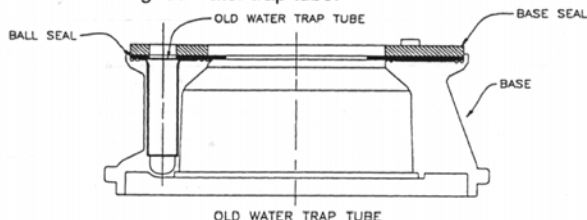

Additional Information: Call SeaLand's Customer Service Department at 800/321-9886, 8 AM to 5 PM Eastern time if you have questions or need additional information.

©Registered Trademark of SeaLand Technology, Inc.
©1998 SeaLand Technology, Inc.

NEWMAR CORPORATION WARRANTY DEPARTMENT



Technical Bulletin

P. O. Box 38, Fourth Street, Big Prairie, Ohio 44611 USA
Telephone: 330/496-3211. 800/321-9886. Fax: 330/496-3097

Bulletin Number : 1007
Effective Date: First 6 months, 1999

Traveler® Toilets Elimination of Overflow Holes

Product Affected: All Traveler® Models

Description of Change: Due to a change in RV plumbing codes (IAPMO TSC 1-98X, Section 4.5), SeaLand will be eliminating the overflow holes in its china toilet bowls. This change creates a more airtight system which eliminates the possibility of odors being emitted inside the motorcoach through the overflow holes. In addition, the toilet bowl will be even easier to clean and will remain clean longer.



Model No. Affected:

Item Numbers Affected:

<u>510/511</u>		<u>2010/2011</u>		<u>910/911</u>	
451001	551001	421001	521001	491001	591001
451003	551003	421003	521003	491003	591003
451006	551006	421008	521008	491101	591101
451008	551008	421101	521101	491103	591103
451011	551011	421103	521103		
451101	551101	421108	521108		
451103	551103				
451106	551106				
451108	551108				
451111	551111				

Ordering Information: SeaLand item numbers will remain the same. This running change will occur in the first six months of 1999.

Additional Information: Call SeaLand's Customer Service Department at 800/321-9886, 8 AM to 5 PM Eastern time if you have questions or need additional information.

®Registered Trademark of SeaLand Technology, Inc.
©1998 SeaLand Technology, Inc.

□

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.