

NEWMAR CORPORATION

WARRANTY DEPARTMENT

TECHNICAL SERVICE BULLETIN									
DATE ISSUED		MODEL YEAR(S) AFFECTED			MODEL(S) AFFECTED			TSB #	
9/22/99		1999 & 2000			MA DP			179	
BRAND						TYPE			
All <input type="checkbox"/> American Star <input type="checkbox"/> Kountry Star <input type="checkbox"/> Dutch Star <input type="checkbox"/>						All <input type="checkbox"/> T T <input type="checkbox"/> F W <input type="checkbox"/>			
NewAire <input type="checkbox"/> Mountain Aire <input checked="" type="checkbox"/> Kountry Aire <input type="checkbox"/> London Aire <input type="checkbox"/>						C A <input type="checkbox"/> D P <input checked="" type="checkbox"/> D B <input type="checkbox"/>			
<input type="checkbox"/> Air Conditioning & Heating						<input checked="" type="checkbox"/> Electrical Components			
<input type="checkbox"/> Appliances & Accessories						<input type="checkbox"/> Exterior Components			
<input type="checkbox"/> Cabinets & Furniture						<input type="checkbox"/> Interior Components			
<input type="checkbox"/> Chassis Components						<input type="checkbox"/> Plumbing & Bath Components			
<input type="checkbox"/> Construction Components						<input type="checkbox"/> Windows, Awnings, Vents, & Doors			
DESCRIPTION OF PROBLEM									
<p>Possible grommet failure in battery compartment where all battery cables come through back of the box. This would pertain to all Mountain Aire Diesel Pushers for the model years 1999 and 2000 built prior to September 15, 1999.</p>									
RECOMMENDED SOLUTION									
<p>Slide the battery tray out, remove the house batteries, cut and remove the fourth rubber grommet. Install the Newmar supplied plastic grommet in place of the rubber one. Cut plastic grommet in half and install bottom half then the top half into the opening. Attach with 5/16" X 3/4" bolts through the back of the battery box. Reinstall the battery.</p> <p>The grommet part number is 02272. This is to be ordered from the Newmar Parts Department.</p> <p>During this process if a metal band around wires is found, please remove and replace with plastic wire ties.</p> <p>THIS TSB MUST BE PERFORMED OR INSPECTED ON ALL UNITS ON YOUR LOT OR THROUGH YOUR SERVICE SHOP.</p>									

□

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.