TECHNICAL SERVICE BULLETIN													
DATE ISSUED			MODEL YEAR(S) AFFECTED				Model(s) Affec)	TSB #		
6/6/86			1985-1986					ĹL		2			
	BRAND								Түре				
All		Ameri	can Star 🛛	Kountry Star]]	Dute	ch Star		All 🗖	Т	Т 🗖	FW 🗖	
NewAire 🗖 Mountain Aire 🗖 Kountry Aire 🗖						Lon	London Aire ■ C A ■ D P □				P□	DB 🗖	
	□ Air Conditioning & Heating ■ Electrical Components												
	Appliances & Accessories \Box Exterior								omponents				
	Cabinets & Furniture							Interior Components					
	Chassis Co		Plumbing & Bath Components										
	Constructi	ponents			Windows, Awnings, Vents, & Doors								
DESCRIPTION OF PROBLEM													
Generator slide out brackets. Some units may be equipped with generator slide out brackets that the ball bearings fall out due to improper alignment, causing the track not to slide out properly and could also result in the generator dropping down.													
RECOMMENDED SOLUTION													
A visual inspection of the slide mechanism while moving the generator in and out of the storage location should allow one to determine if the slides have been properly installed. Some of the slides may be tipped out at the top causing the slides to work hard or may even cause the bearings to fall out.													
T C 1													

If the slides are on an angle, using flat washers to shim out. If ball bearings have dropped out, then the slides must be replaced. Old slides must be returned for credit.

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.