72185 COUNTY ROAD 3 NAPPANEE IN 46550

NEWMAR CORPORATION FAX. WARRANTY DEPARTMENT


800.858.4924 FAX. 219.773.2007

TECH	NICAL	SERVICE	RIIII	ETIN
IECH	NICAL	SERVICE	DUL	_E

	Date Issued 09/13/01	Model Year(s) Affected 2001-2002	Model(s) Affected 35 LKSA	TSB # 226				
		Туре						
ALL O	American Star	○ Kountry Star ●	Dutch Star O	All O TTO FW®				
	Mountain Aire	€ Kountry Aire ○	London Aire O	CAO DPO DBO				
O A	Air Conditioning & Dappliances & Accessor Cabinets & Furniture Chassis Components Construction Compo	ories e		omponents				
Description of Problem								
	cient return air duct d up to August 24, 2		nis will pertain to 35 l	LKSA models only that were				

Recommended Solution

Remove the forward end panel from the soffit area and install a board 18" back from the front edge. Next, seal off the perimeter of the soffit area around the board. Install two 4" louvered vents and cut 6" X 6" access to return air duct through the ceiling board. Tape the edges to seal from the duct to the opening in the soffit cavity. Install filter material over the 6" X 6" opening and re-install the end panel. When you are finished, test the system. This should pull return air into the cavity. Please use the attached diagram as a reference.

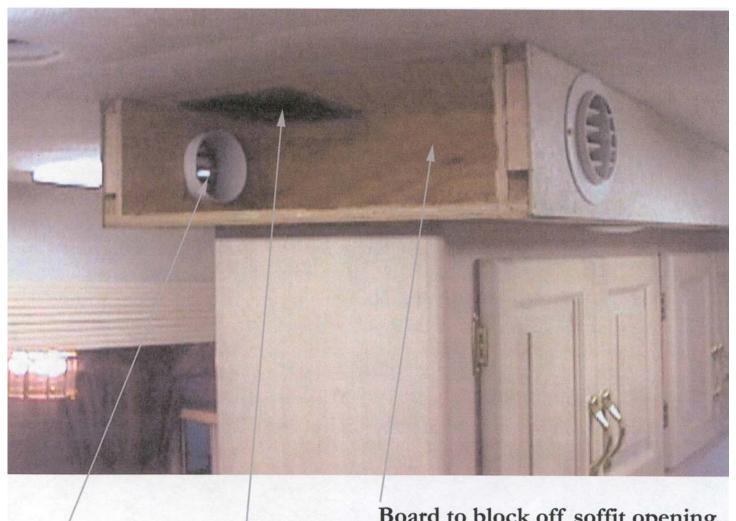

Board to block off soffit opening.

6" X 6" opening.

4" round vent.

Newmar Corporation TSB #226 Page 1