
TECHNICAL SERVICE BULLETIN							
MODEL YEAR(S) AFFECTED)	MODEL(S) AFFECTED			TSB #	
2002			DUTCH	STAR DP		229	
BRAND				Түре			
can Star 🛛	Kountry Star 🛛	Dut	ch Star	All 🗖	ТТС	FW 🗖	
tain Aire 🗖 🗄	Kountry Aire 🛛	Lon	don Aire□	САП	DP	DB 🗖	
□ Air Conditioning & Heating □ Electrical Components							
Image: DescriptionImage: DescriptionImage: DescriptionImage: DescriptionImage: DescriptionDescriptionExterior Control				omponents			
□ Cabinets & Furniture □ Interior 0				omponents			
Chassis Components			Plumbing & Bath Components				
Construction Components			Windows, A	ows, Awnings, Vents, & Doors			
DESCRIPTION OF PROBLEM							
RECOMMENDED SOLUTION							
Replace the original grommet with a plastic grommet and kazoo tube. First, remove the grommet from the bottom of the air intake box and install a plastic grommet over the existing hole. Apply sealant to the edges and sides of the grommet. Slide the kazoo rubber over the grommet until it is seated into the sealant. Seal around the top outside edge of the kazoo material and allow it to dry. The flat rate code for this replacement is #40450308 and the time allowed is .8. To complete this repair you will need a plastic grommet, part #10420, and a ½ foot of kazoo tube, part #22104.							
	MODEL YE BRA can Star can Star cain Aire % Heating essories ure nts ponents or the air intake or the air intake or the air intake	MODEL YEAR(S) AFFECTED 2002 BRAND can Star □ Kountry Star □ can Star □ Kountry Aire □ can Aire □ Kountry Aire □ can Aire □ Kountry Aire □ Country Aire □ & Heating essories Ure Its DESCRIPTION (Or the air intake box. RECOMMENDE Ommet with a plastic grommet and e box and install a plastic grommet and e box and install a plastic grommet folide the kazoo rubber over the gr the kazoo material and allow it to his replacement is #40450308 and	MODEL YEAR(S) AFFECTED 2002 BRAND can Star Kountry Star Dute can Star Kountry Aire Lon & Heating Image: Sories Image: Sories Image: Sories ure Image: Sories Image: Sories Image: Sories ure Image: Sories Image: Sories Image: Sories ure Image: Sories Image: Sories Image: Sories oponents Image: Sories Image: Sories Image: Sories oponents <t< td=""><td>MODEL YEAR(S) AFFECTED MODEL(S) 2002 DUTCH is BRAND </td><th>MODEL YEAR(S) AFFECTED MODEL(S) AFFECTED 2002 DUTCH STAR DP BRAND </th><th>MODEL YEAR(S) AFFECTED MODEL(S) AFFECTED 2002 DUTCH STAR DP BRAND TYPI can Star Kountry Star Dutch Star All TT can Star Kountry Aire London Aire C A D P & Heating Electrical Components essories Exterior Components ure Interior Components nts Plumbing & Bath Components nponents Windows, Awnings, Vents, & DO DESCRIPTION OF PROBLEM DESCRIPTION OF PROBLEM or the air intake box. State or ubber over the existing hole. Apply sealant to Slide the kazoo rubber over the grommet until it is seated into the sealant. the kazoo material and allow it to dry. his replacement is #40450308 and the time allowed is .8. To complete this</th></t<>	MODEL YEAR(S) AFFECTED MODEL(S) 2002 DUTCH is BRAND	MODEL YEAR(S) AFFECTED MODEL(S) AFFECTED 2002 DUTCH STAR DP BRAND	MODEL YEAR(S) AFFECTED MODEL(S) AFFECTED 2002 DUTCH STAR DP BRAND TYPI can Star Kountry Star Dutch Star All TT can Star Kountry Aire London Aire C A D P & Heating Electrical Components essories Exterior Components ure Interior Components nts Plumbing & Bath Components nponents Windows, Awnings, Vents, & DO DESCRIPTION OF PROBLEM DESCRIPTION OF PROBLEM or the air intake box. State or ubber over the existing hole. Apply sealant to Slide the kazoo rubber over the grommet until it is seated into the sealant. the kazoo material and allow it to dry. his replacement is #40450308 and the time allowed is .8. To complete this	

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.

72185 COUNTY ROAD 3 NAPPANEE, IN 46550

NEWMAR CORPORATION WARRANTY DEPARTMENT 800.858.4924

FAX 219.773.2007

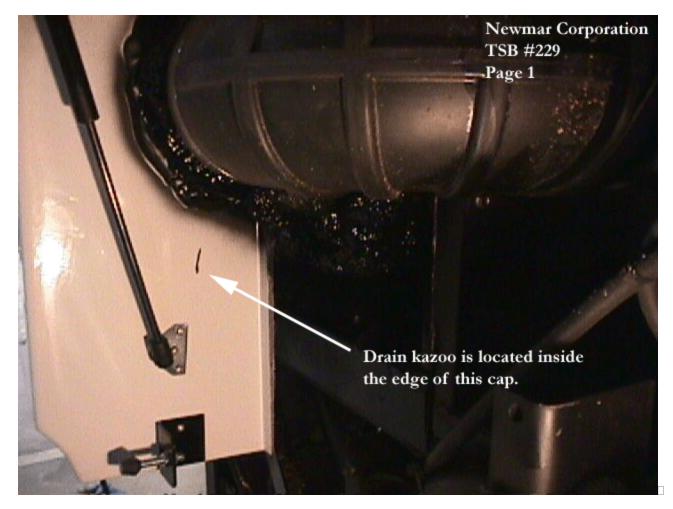

NEWMAR CORPORATION WARRANTY DEPARTMENT

