

NEWMAR CORPORATION WARRANTY DEPARTMENT

TECHNICAL SERVICE BULLETIN						
DATE ISSUED	MODEL YEAR(S) AFFECTED	MODEL(S) AFFECTED	TSB #			
9/5/02	2002-2003	Class A's	241			
BRAND		TYPE				
All <input type="checkbox"/>	American Star <input type="checkbox"/>	Kountry Star <input checked="" type="checkbox"/>	Dutch Star <input checked="" type="checkbox"/>	All <input type="checkbox"/>	T T <input type="checkbox"/>	F W <input type="checkbox"/>
Scottsdale <input checked="" type="checkbox"/>	Mountain Aire <input checked="" type="checkbox"/>	Kountry Aire <input type="checkbox"/>	London Aire <input type="checkbox"/>	C A <input checked="" type="checkbox"/>	D P <input type="checkbox"/>	D B <input type="checkbox"/>
<input type="checkbox"/> Air Conditioning & Heating				<input type="checkbox"/> Electrical Components		
<input type="checkbox"/> Appliances & Accessories				<input type="checkbox"/> Exterior Components		
<input type="checkbox"/> Cabinets & Furniture				<input type="checkbox"/> Interior Components		
<input checked="" type="checkbox"/> Chassis Components				<input type="checkbox"/> Plumbing & Bath Components		
<input type="checkbox"/> Construction Components				<input type="checkbox"/> Windows, Awnings, Vents, & Doors		
DESCRIPTION OF PROBLEM						
Workhorse harness clamp.						
RECOMMENDED SOLUTION						
<p>This clamp is a transition point taking the Workhorse Chassis wire from the engine to the frame and is secured to the driver platform by Newmar. The torque of the engine pulls the harness towards the passenger side causing harness movement at this clamp, which may result in harness damage due to the design of this clamp.</p> <p>Please replace this Workhorse harness clamp with a rubber coated clamp. The Newmar part number is 31091 and the description is a 2 ½ rubber coated wire loom clamp. The time allowed for this repair is .4 and the flat rate code is 20910205.</p>						

□

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.