

# NEWMAR CORPORATION

## WARRANTY DEPARTMENT

TECHNICAL SERVICE BULLETIN							
DATE ISSUED		MODEL YEAR(S) AFFECTED		MODEL(S) AFFECTED		TSB #	
11/11/02		2002-2003		Diesel Pusher		244	
BRAND				TYPE			
All <input type="checkbox"/>	American Star <input type="checkbox"/>	Kountry Star <input checked="" type="checkbox"/>	Dutch Star <input checked="" type="checkbox"/>	All <input type="checkbox"/>	T T <input type="checkbox"/>	F W <input type="checkbox"/>	
Scottsdale <input type="checkbox"/>	Mountain Aire <input type="checkbox"/>	Kountry Aire <input type="checkbox"/>	London Aire <input type="checkbox"/>	C A <input type="checkbox"/>	D P <input checked="" type="checkbox"/>	D B <input type="checkbox"/>	
<input type="checkbox"/> Air Conditioning & Heating				<input type="checkbox"/> Electrical Components			
<input checked="" type="checkbox"/> Appliances & Accessories				<input type="checkbox"/> Exterior Components			
<input type="checkbox"/> Cabinets & Furniture				<input type="checkbox"/> Interior Components			
<input type="checkbox"/> Chassis Components				<input type="checkbox"/> Plumbing & Bath Components			
<input type="checkbox"/> Construction Components				<input type="checkbox"/> Windows, Awnings, Vents, & Doors			
DESCRIPTION OF PROBLEM							
Inoperative ADTH back-up monitors.							
RECOMMENDED SOLUTION							
<p>The clips which hold the wires secure and intact for the ADTH back-up monitors were not installed. Vibration over time can loosen the wires away from the back of the monitor and cause it to become inoperative. Before replacing a monitor, please make sure the wires have a good connection and install the wire clip to prevent future problems.</p> <p>For this correction, use flat rate code number 20 42 30 02. The time allowed is .5. The Newmar part number for the clip is 04541.</p>							

□

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.