| Technical Service Bulletin | | | | | | | | | | | |
|----------------------------|--|---|------------------------|--|---|------------------------------------|------|-------|-------|--|--|
| | Date Issued | Ν | Model Year(s) Affected | | | Model(s) Affected | | | TSB # | | |
| | 10/20/2006 | | 2/10/03 - 3/11/04 | | | Spartan MM Chassis | | 281 | | | |
| | Brand | | | | | | Туре | | | | |
| All | |] | American Star | | Ī | Mountain Aire | | All 🗖 | ТТ 🗖 | | |
| | | | Dutch Star | |] | Kountry Aire | | FW□ | САП | | |
| | | | Kountry Star | |] | Essex | | D P 📕 | D B 🗖 | | |
| Sco | ttsdale E |] | Northern Star | |] | London Aire | | | | | |
| | Air Conditioning & Heating Electrical Components | | | | | | | | | | |
| | □ Appliances & Accessories | | | | | Exterior Components | | | | | |
| | Cabinets & Furniture | | | | | □ Interior Components | | | | | |
| | Chassis Components | | | | | Plumbing & Bath Components | | | | | |
| | Construction Components | | | | | □ Windows, Awnings, Vents, & Doors | | | | | |
| | Description of Problem | | | | | | | | | | |

Transmission Fluid level differs between touch pad and the dipstick.:

APPLIES TO: Newmar MM Chassis with MH 3000 Transmission using dipstick p/n 352-TT2-010 or 0352-TT2-010T with dipstick tube p/n 0442-TT2-001 VDM Range 2-10-03 and 3-11-04.

The touch pad will indicate transmission fluid level is 3 quarts low, but the transmission dipstick will indicate that the fluid level is full.

Recommended Solution

- Remove the existing transmission dipstick from the dipstick tube and discard.
- Replace the transmission dipstick with p/n 0473-TT2-001 (Dipstick only).
- See Manufacturers attached repair directions. Contact manufacturer directly for additional information or instructions.

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.



Tech Tips

| | | #: PSR MH 295 | | | | | | | | |
|--|---|------------------------|--------------------|----------|--|--|--|--|--|--|
| | | | DATE: | 10-29-04 | | | | | | |
| | | | REV: | Release | | | | | | |
| SUBJECT: | ween touch pa | d and the dipstick | | | | | | | | |
| APPLIES TO: Newmar MM Chassis with MH 3000 Transmission using dipa 352-TT2-010 or 0352-TT2-010T with dipstick tube p/n 0442- VDM Range 2-10-03 and 3-11-04 | | | | | | | | | | |
| FOR INTERNAL USE ONLY: No | | | | | | | | | | |
| VOCATION: | Motor Hon | ome | | | | | | | | |
| REASON CLASSI | FICATION: | E2 if within our warra | if out of warranty | | | | | | | |
| LABOR TIME: | 5 Minutes | | | | | | | | | |
| PROBLEM: | On Newmar MM chassis with MH 3000 transmissions the fluid level reads 3 quarts low on the touch pad, while the dipstick reads full. | | | | | | | | | |

Please Read the Entire Tech Tip Before Proceeding With Any Work.

Verify The Complaint:

Ensure this is a Newmar MM chassis with a MH 3000 Allison Transmission with SO # between 43160 and 47790 (VDM Between 2-10-03 and 3-11-04) using dipstick part numbers 0352-TT2-010 or 0352-TT2-010T with dipstick tube part number 0442-TT2-001.

Problem Identification:

The touch pad will indicate transmission fluid level is 3 quarts low, but the transmission dipstick will indicate that the fluid level is full.

Problem Correction:

- Remove the existing transmission dipstick from the dipstick tube and discard.
- Replace the transmission dipstick with p/n 0473-TT2-001 (Dipstick only).

Tech Tip Bulletins are intended for use by professional technicians only. They are written to guide professional technicians in performing service to vehicles of product specific nature in conjunction with industry standards. Professional technicians are appropriately trained on industry standards and have the tools and equipment to perform procedures safely and properly.