


NEWMAR CORPORATION WARRANTY DEPARTMENT

TECHNICAL SERVICE BULLETIN						
DATE ISSUED	MODEL YEAR(S) AFFECTED	MODEL(S) AFFECTED	TSB #			
9/14/98	1998-1999	ALL	162			
BRAND		TYPE				
All <input type="checkbox"/>	American Star <input type="checkbox"/>	Kountry Star <input type="checkbox"/>	Dutch Star <input checked="" type="checkbox"/>	All <input type="checkbox"/>	T T <input type="checkbox"/>	F W <input type="checkbox"/>
NewAir <input type="checkbox"/>	Mountain Air <input checked="" type="checkbox"/>	Kountry Air <input checked="" type="checkbox"/>	London Air <input checked="" type="checkbox"/>	C A <input type="checkbox"/>	D P <input checked="" type="checkbox"/>	D B <input type="checkbox"/>
<input type="checkbox"/> Air Conditioning & Heating				<input checked="" type="checkbox"/> Electrical Components		
<input type="checkbox"/> Appliances & Accessories				<input type="checkbox"/> Exterior Components		
<input type="checkbox"/> Cabinets & Furniture				<input type="checkbox"/> Interior Components		
<input checked="" type="checkbox"/> Chassis Components				<input type="checkbox"/> Plumbing & Bath Components		
<input type="checkbox"/> Construction Components				<input type="checkbox"/> Windows, Awnings, Vents, & Doors		
DESCRIPTION OF PROBLEM						
Intermittent operation of jacks and steps caused by low voltage on Freightliner chassis produced from 9-97 – 9-98.						
RECOMMENDED SOLUTION						
Inspect wiring from battery to front fuse panel for proper gauge wires. See the attached diagram.						

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.

NEWMAR CORPORATION WARRANTY DEPARTMENT

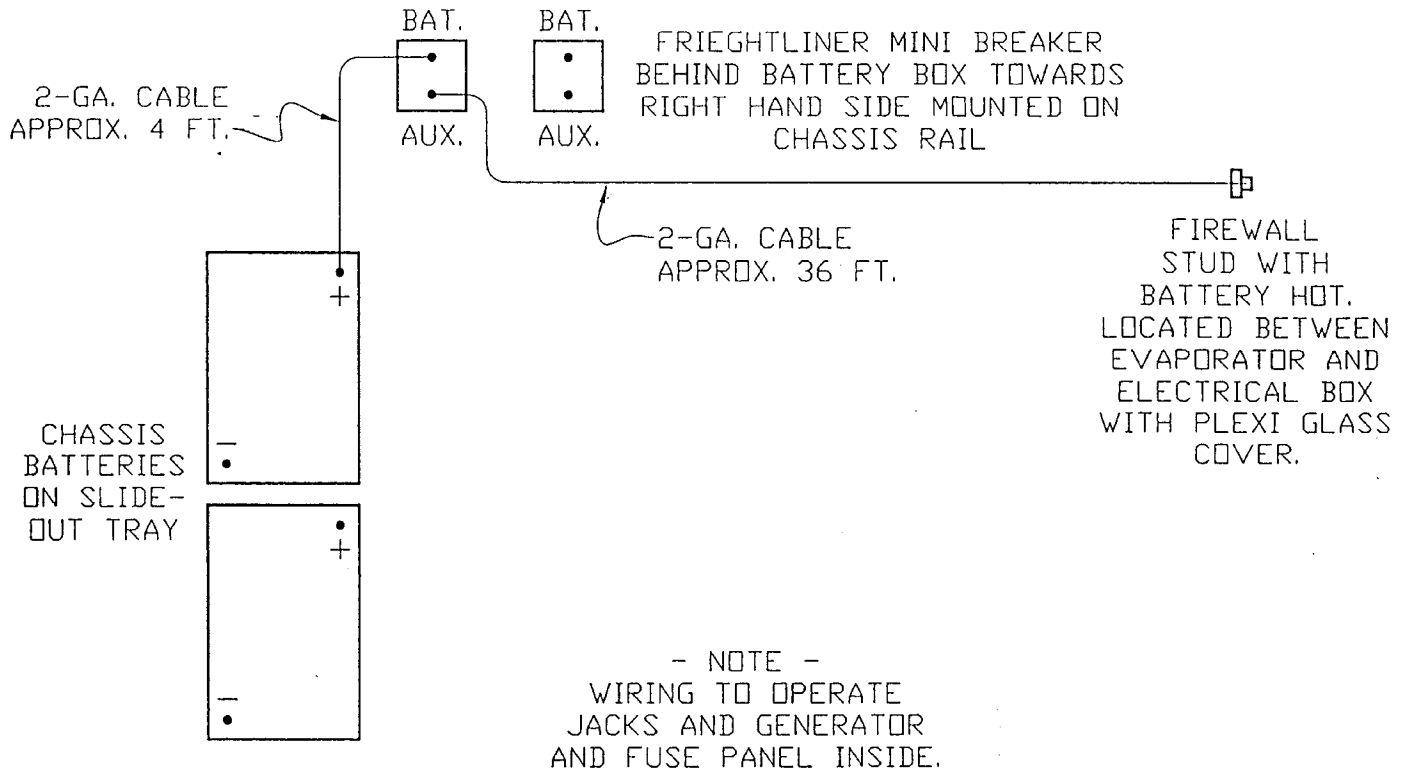

NEWMAR CORP P.O. Box 30, Nappanee, IN. 46550 Title block--1-STB	Model: DS/MA/LA DP'S FRIEGHTLINER	Sheet 1 OF 1	Drawn by: MIKE D.	Checked by:	Revision:	By:
	Title: NEWMAR 2-GA. WIRE ADDITION	I.D. # MOT\CODE\ELEC\2GA_WIRE	Date: 9/3/98	Date:	Revision:	Date:
						By: