

NEWMAR CORPORATION WARRANTY DEPARTMENT

TECHNICAL SERVICE BULLETIN							
DATE ISSUED	MODEL YEAR(S) AFFECTED	MODEL(S) AFFECTED	TSB #				
05/17/01	1996-2001	ALL	219				
BRAND		TYPE					
All <input checked="" type="checkbox"/>	American Star <input type="checkbox"/>	Kountry Star <input type="checkbox"/>	Dutch Star <input type="checkbox"/>	All <input checked="" type="checkbox"/>	T T <input type="checkbox"/>	F W <input type="checkbox"/>	
NewAire <input type="checkbox"/>	Mountain Aire <input type="checkbox"/>	Kountry Aire <input type="checkbox"/>	London Aire <input type="checkbox"/>	C A <input type="checkbox"/>	D P <input type="checkbox"/>	D B <input type="checkbox"/>	
<input checked="" type="checkbox"/> Air Conditioning & Heating				<input type="checkbox"/> Electrical Components			
<input type="checkbox"/> Appliances & Accessories				<input type="checkbox"/> Exterior Components			
<input type="checkbox"/> Cabinets & Furniture				<input type="checkbox"/> Interior Components			
<input type="checkbox"/> Chassis Components				<input type="checkbox"/> Plumbing & Bath Components			
<input type="checkbox"/> Construction Components				<input type="checkbox"/> Windows, Awnings, Vents, & Doors			
DESCRIPTION OF PROBLEM							
Newmar is finding that roof A/C gasket installation work in the field is not being re-installed properly causing the A/C to freeze up.							
RECOMMENDED SOLUTION							
Install the perimeter gasket, along with a secondary gasket, to seal the output area from the intake area. Please see the attached drawing and if you have any questions, please call a Newmar representative.							

□

If you have any questions regarding this T.S.B., please contact a Warranty Service Representative at Newmar Corporation.


NEWMAR CORPORATION WARRANTY DEPARTMENT

Newmar Corporation

TSB #219

Page 1/1

Air Conditioner Sealing Gasket Front of Unit

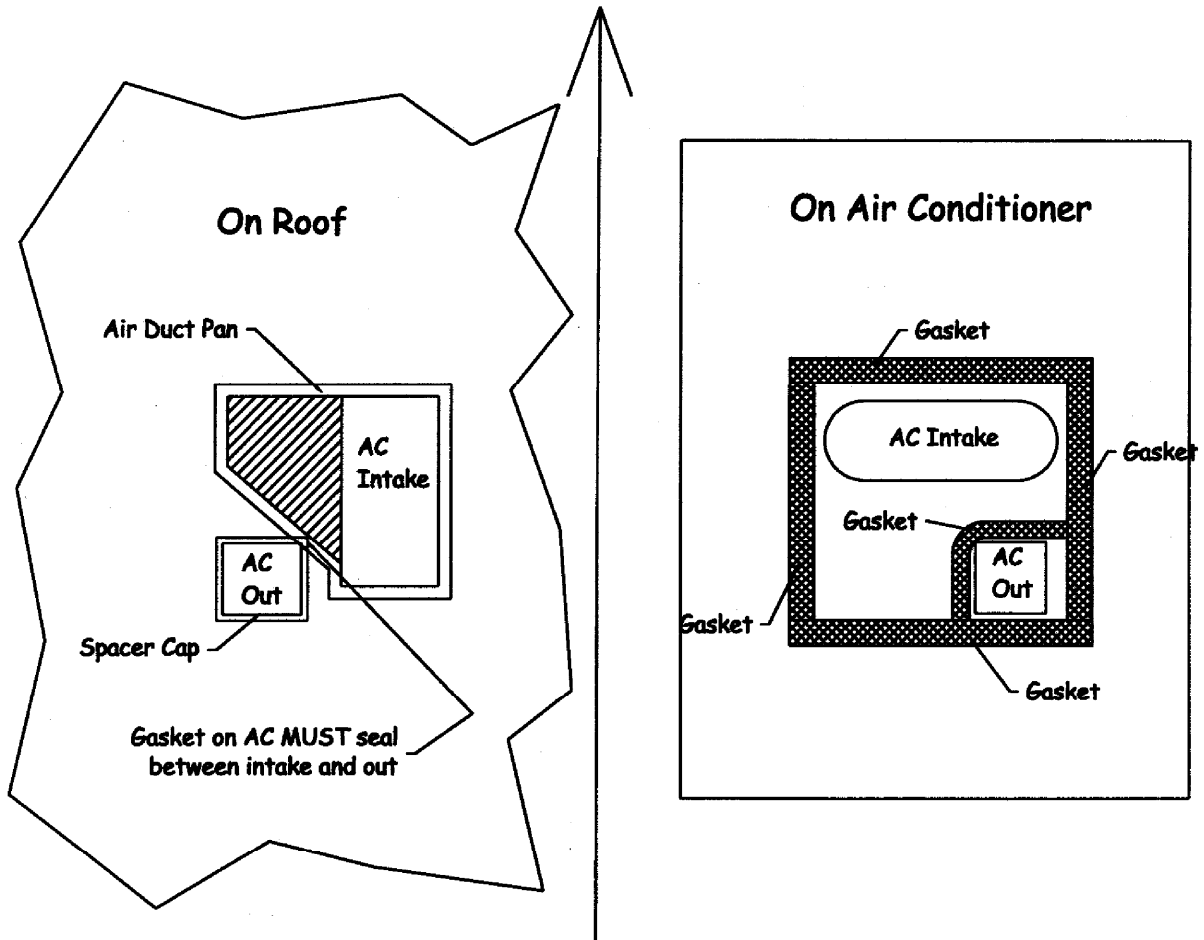

□