

INTERNATIONAL LTD
THERMAL RESEARCH

TECHNICAL BULLETIN

Heating Systems	August 17, 2018	Bulletin Identification No.: MTB-207-10
Release Type: Public		

Affected Model(s): Oasis NE-S
Effective Date: August 17, 2017
Effective serial number: NES-XXXX-1055 (including 1026, 1040, 1048)

Description: High Limit Aquastat Change


Old Part No. 1128
New Part No. 1138

Short description of change:

If the high limit aquastat on the Oasis NE-S trips, the air compressor light will flash. The current aquastat used as the high limit aquastat is too close to the cycling temperature of the heater. This high limit aquastat needs to be replaced with one of a higher value.




Figure 1: New High Limit Aquastat (196F)

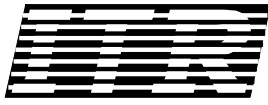

INTERNATIONAL LTD
THERMAL RESEARCH

TECHNICAL BULLETIN

Heating Systems	August 17, 2018	Bulletin Identification No.: MTB-207-10
Release Type: Public		

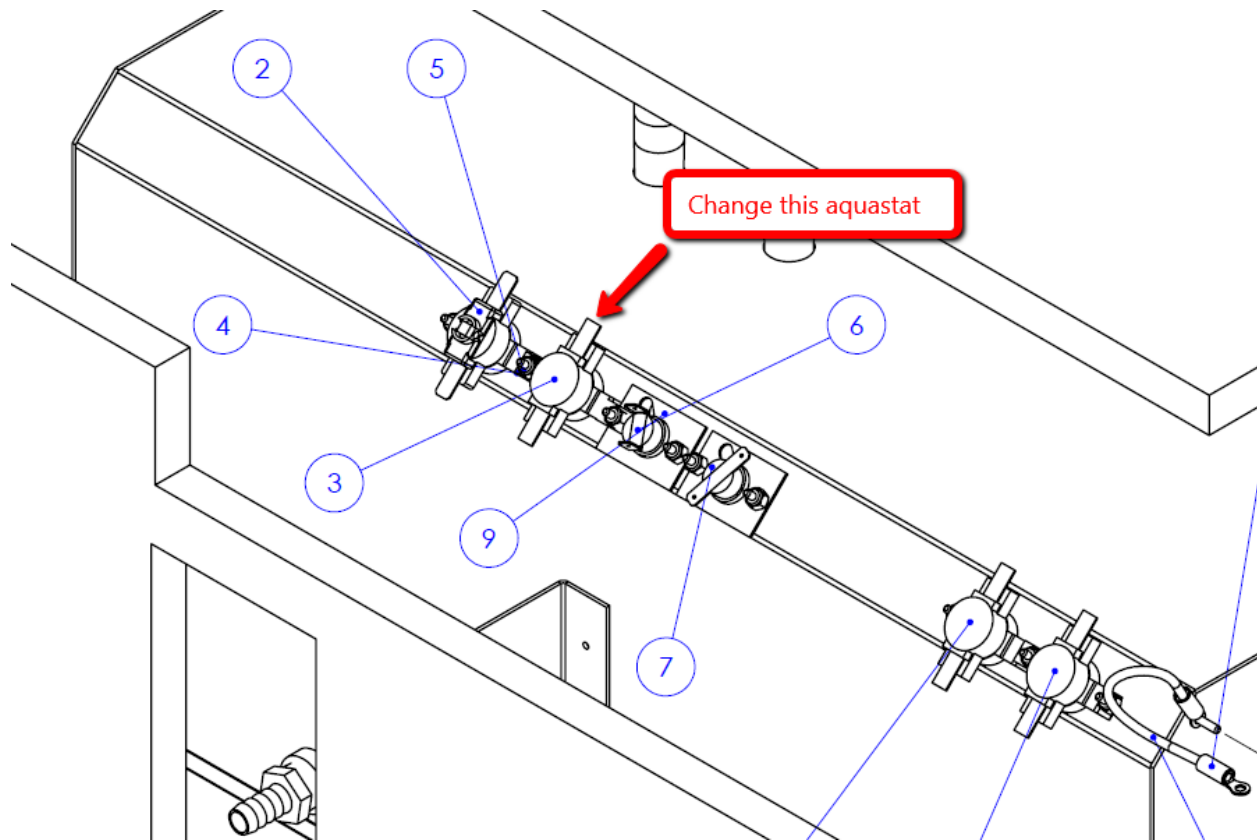

When the Aquastat is being replaced, be sure to add thermal compound to the bottom of the new aquastat before securing it in place. Also, when tightening the bolts onto the tank studs, do not over tighten. Using too much force may break the studs from the tank.