

Newmar Corporation

PO Box 30
Nappanee, IN 46550



WHEN YOU KNOW THE DIFFERENCE.

TSB 587
Aug. 23, 2022

TECHNICAL SERVICE BULLETIN

AFFECTED MODELS

2020 – 2022 :: Super Star, Supreme Aire

DESCRIPTION

The seat belt bracket(s) may have been tightened with the brackets improperly oriented. The seat belt(s) are still functional; however, the intent is to correct the orientation of the seat belt bracket if it is out of the tolerance given in the attached work instructions.

UNITS AFFECTED

Please refer to the attached population list for affected units and VINs.

CORRECTIVE ACTION

Follow the attached instructions to inspect and orient the seat belt brackets as intended.

FLAT RATE CODE: TSB 587


LABOR TIME: .3 hr to inspect and reorient seat belt brackets for both seats

IMPORTANT: Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.

NOTICE: Any technical information published in this bulletin is intended for use only by a qualified, Newmar-authorized service technician. Newmar is not responsible for the misuse of this information.

Work Instructions for Super C Seat Belt Bracket Orientation (Coaches built and shipped before 4/1/2022)

Check to see if the seat belt bracket is out of tolerance, as it must be within 15 degrees of 20/60 degree specification.

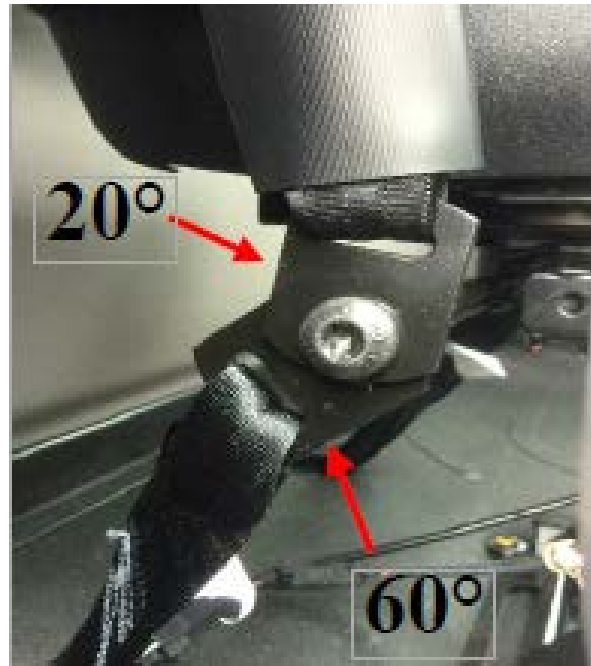


Loosen the bolt with a T-45 bit.

Set the correct angle of the seat belt brackets. The belt from the floor should be at a 60-degree angle, and the belt from the wall should be at a 20-degree angle.

After the seat belt bracket(s) have been oriented correctly, tighten the bolt all the way down with the T-45 bit and torque wrench. Both sides of the seat belt bolts should be torqued to 35-45 ft. lbs.



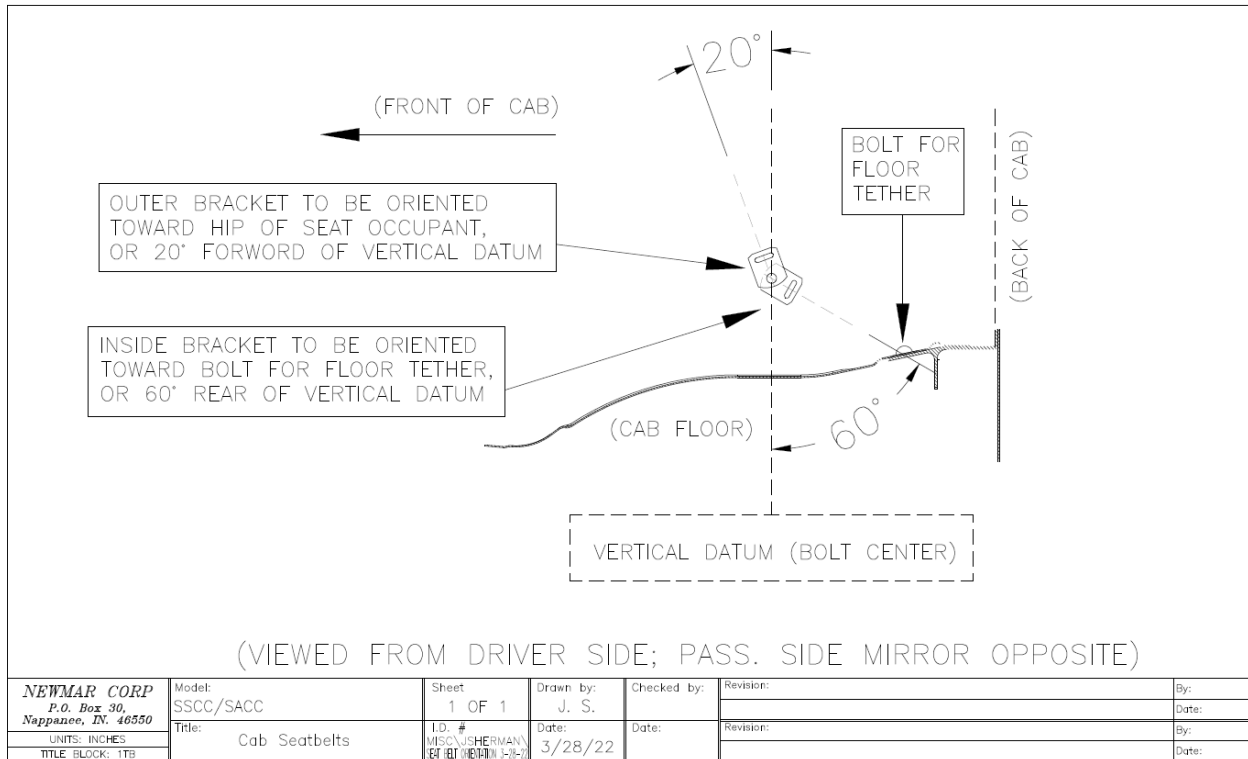

Example of incorrect seatbelt orientation

VIN Number	Prod#	Year	Brand	Type	Floor	Chassis	Date In	Date Off
USA Units								
1FVACYFE2MHMT2212	230174	2021	SS	CC	4051	FS	1/26/2021	2/3/2021
1FVHC5DV3LHLP3251	270104	2020	SA	CC	4573	FS	9/19/2019	9/30/2019
1FVHC5DV7MHMA9407	270130	2021	SA	CC	4573	FS	5/5/2021	5/14/2021
1FVACYFE4MHMT2213	230201	2021	SS	CC	3746	FL	4/20/2021	4/27/2021
1FVACYFE6NHNH7711	230284	2022	SS	CC	4059	FS	4/5/2022	4/19/2022
3ALACYFE6LDLP3282	230120	2020	SS	CC	3746	FS	10/29/2019	11/5/2019
1FVACYFE0LHLP3286	230131	2020	SS	CC	4051	FS	9/10/2019	9/18/2019
1FVACYFE6MHMA9396	230160	2021	SS	CC	4051	FL	9/21/2020	9/30/2020
1FVHC5DV6MHMA9401	270117	2021	SA	CC	4051	FS	7/27/2020	8/4/2020
3ALACYFE9KDKR9211	230101	2020	SS	CC	4061	FS	1/18/2019	1/28/2019
3ALACYFE7LDLP3274	230119	2020	SS	CC	3746	FS	8/8/2019	8/16/2019
3ALACYFE2LDMG5954	230150	2020	SS	CC	4061	FS	3/17/2020	5/4/2020
1FVACYFE8NHNC3532	230222	2022	SS	CC	4059	FS	7/30/2021	8/9/2021
1FVACYFE6NHNH4043	230377	2022	SS	CC	4061	FS	3/24/2022	4/6/2022
1FVACYFE5NHNC3536	230239	2022	SS	CC	4059	FS	9/15/2021	9/23/2021
3ALACYFE5LDLP3273	230117	2020	SS	CC	3746	FS	7/18/2019	7/26/2019
1FVHC5DV5LHLP3297	270113	2020	SA	CC	4573	FS	1/29/2020	2/6/2020
1FVACYFE0MHMT2211	230191	2021	SS	CC	4058	FS	3/1/2021	3/9/2021
1FVACYFE6LHLP3292	230143	2020	SS	CC	4058	FS	1/27/2020	2/4/2020
1FVACYFEXMHMT2216	230198	2021	SS	CC	4061	FS	3/10/2021	3/18/2021
1FVACYFE1PHNL7733	230366	2022	SS	CC	4059	FS	5/5/2022	5/17/2022
1FVACYFE5NHNS1435	230339	2022	SS	CC	4059	FS	1/25/2022	2/9/2022
1FVACYFE5NHNH4017	230319	2022	SS	CC	3727	FS	12/15/2021	1/11/2022
1FVACYFE7PHNL7736	230379	2022	SS	CC	4059	FS	6/2/2022	6/10/2022
3ALACYFEXNDNH3984	230342	2022	SS	CC	3727	FS	9/2/2021	9/14/2021
3ALACYFE6NDNH3979	230343	2022	SS	CC	3727	FS	9/27/2021	10/6/2021
1FVACYFE8NHNH4030	230314	2022	SS	CC	3727	FS	3/17/2022	3/29/2022
3ALACYFE7NDNH3988	230231	2022	SS	CC	4061	FS	10/7/2021	10/20/2021
3ALHC5DV2LDLP3246	270109	2020	SA	CC	4573	FS	7/25/2019	8/5/2019
3ALACYFE7NDNH3991	230227	2022	SS	CC	4059	FS	9/24/2021	10/5/2021
1FVACYFE3MHMA9419	230180	2021	SS	CC	3746	FS	1/20/2021	1/27/2021
1FVHC5DVXMHMA9403	270123	2021	SA	CC	4573	FS	11/3/2020	11/12/2020
3ALHC5DV8NDNH3997	270174	2022	SA	CC	4573	FS	11/8/2021	11/16/2021
3ALHC5DV6LDLP3248	270112	2020	SA	CC	4573	FS	8/20/2019	8/28/2019
1FVHC5DV7LHLP3298	270114	2020	SA	CC	4573	FS	2/12/2020	2/20/2020
1FVHC5DV9LHLP3299	270119	2021	SA	CC	4573	FS	8/20/2020	8/28/2020
1FVACYFE8MHMU9810	230190	2021	SS	CC	4061	FS	3/8/2021	3/16/2021
1FVACYFE5NHNH4020	230347	2022	SS	CC	4061	FS	12/2/2021	12/13/2021
1FVACYFE2MHMA9427	230186	2021	SS	CC	3746	FS	4/15/2021	4/22/2021
1FVHC5DV2MHMR7836	270126	2022	SA	CC	4573	FS	3/4/2021	3/12/2021
1FVACYFE1NHNC3534	230233	2022	SS	CC	4059	FS	9/9/2021	9/21/2021
3ALACYFE2MDMY0198	230217	2021	SS	CC	3746	FS	4/27/2021	5/5/2021
3ALACYFE6NDNH3982	230229	2022	SS	CC	4059	FS	10/20/2021	11/2/2021
1FVACYFE2NHNH4038	230363	2022	SS	CC	4059	FS	3/1/2022	3/9/2022
1FVACYFE7NHNH4052	230307	2022	SS	CC	4065	FS	3/11/2022	3/18/2022
1FVACYFE6LHLP3258	230111	2020	SS	CC	4061	FS	9/23/2019	10/3/2019
1FVHC5DV8NHNC3563	270161	2022	SA	CC	4051	FS	8/10/2021	8/24/2021
3ALACYFE4NDNH3981	230272	2022	SS	CC	4065	FS	9/17/2021	9/27/2021
3ALACYFE5KDJM8382	230102	2020	SS	CC	4061	FS	1/28/2019	2/6/2019
1FVACYFE1NHNH7714	230378	2022	SS	CC	4059	FS	4/27/2022	5/4/2022

VIN Number	Prod#	Year	Brand	Type	Floor	Chassis	Date In	Date Off
1FVACYFE8LHLP3293	230144	2020	SS	CC	4058	FS	2/10/2020	2/18/2020
1FVACYFEXMHMA9417	230179	2021	SS	CC	3746	FS	1/7/2021	1/15/2021
1FVHC5DV7MHMA9424	270125	2021	SA	CC	4051	FS	1/11/2021	1/18/2021
1FVACYFE3MHMA9422	230199	2021	SS	CC	4051	FS	2/18/2021	3/2/2021
3ALACYFE6LDLP3279	230121	2020	SS	CC	3746	FS	9/17/2019	9/24/2019
1FVACYFE2LHLP3290	230112	2020	SS	CC	4061	FS	11/6/2019	11/18/2019
1FVACYFE0MHMA9393	230156	2021	SS	CC	3746	FS	8/5/2020	8/17/2020
1FVHC5DV2NHNH4041	270178	2022	SA	CC	4575	FS	5/10/2022	5/18/2022
1FVACYFE8NHNH4027	230360	2022	SS	CC	4059	FS	2/9/2022	2/17/2022
1FVACYFE4MHMA9414	230175	2021	SS	CC	4061	FS	12/16/2020	1/11/2021
1FVACYFE2MHMA9394	230164	2021	SS	CC	4061	FS	9/4/2020	9/15/2020
1FVACYFE1NHNC3548	230283	2022	SS	CC	3727	FS	7/21/2021	7/29/2021
1FVACYFE7MHMA9410	230167	2021	SS	CC	4058	FS	11/10/2020	11/30/2020
3ALACYFE8NDNH3983	230313	2022	SS	CC	4059	FS	8/27/2021	9/7/2021
3ALACYFE0LDMG5953	230142	2020	SS	CC	4058	FS	3/13/2020	3/23/2020
1FVACYFE4LHLP3291	230141	2020	SS	CC	4058	FS	1/21/2020	1/30/2020
1FVACYFE0MHMA9409	230184	2021	SS	CC	4061	FS	10/19/2020	10/27/2020
3ALACYFE4NDNH3978	230261	2022	SS	CC	3727	FS	9/21/2021	9/28/2021
1FVACYFEXNHNH4028	230359	2022	SS	CC	4059	FS	1/17/2022	1/25/2022
1FVACYFEXNHNH4031	230346	2022	SS	CC	4059	FS	2/16/2022	2/28/2022
3ALHC5DV4LDLP3247	270103	2020	SA	CC	4573	FS	8/6/2019	8/13/2019
1FVACYFEXMHMA9398	230162	2021	SS	CC	4058	FS	10/8/2020	10/16/2020
1FVHC5DV5JHJN7169	270118	2021	SA	CC	4051	FS	12/14/2020	1/7/2021
1FVACYFE4PHNL7726	230303	2022	SS	CC	4059	FS	5/4/2022	5/12/2022
3ALACYFE0MDMY0202	230188	2021	SS	CC	4061	FS	5/7/2021	5/17/2021
1FVACYFEXNHNC3547	230249	2022	SS	CC	3727	FS	7/13/2021	7/21/2021
1FVACYFE8MHMT2215	230209	2021	SS	CC	4051	FS	3/29/2021	4/8/2021
1FVACYFE6NHNC3531	230221	2022	SS	CC	4059	FS	8/5/2021	8/17/2021
1FVACYFE7NHNH4018	230344	2022	SS	CC	3727	FS	1/4/2022	1/14/2022
1FVACYFE2MHMT2209	230213	2021	SS	CC	4061	FS	3/25/2021	4/6/2021
1FVHC5DV0NHNH4040	270173	2022	SA	CC	4051	FS	3/29/2022	4/7/2022
1FVHC5DV1NHNC3565	270169	2022	SA	CC	4573	FS	8/25/2021	9/2/2021
3ALACYFE2NDNH3994	230267	2022	SS	CC	3727	FS	10/21/2021	11/3/2021
1FVACYFE6MHMV0938	230214	2021	SS	CC	4051	FS	3/23/2021	3/30/2021
1FVACYFE2PHNL7739	230334	2022	SS	CC	4059	FS	6/20/2022	6/30/2022
1FVACYFE3LHLP3265	230134	2020	SS	CC	4051	FS	12/3/2019	12/11/2019
1FVACYFE5NHNH4048	230324	2022	SS	CC	4059	FS	2/17/2022	2/28/2022
1FVACYFE8NHNC3529	230248	2022	SS	CC	4059	FS	7/1/2021	7/19/2021
1FVHC5DV4NHNH4042	270177	2022	SA	CC	4573	FS	4/29/2022	5/9/2022
3ALACYFE2LDLP3277	230122	2020	SS	CC	3746	FS	10/17/2019	10/24/2019
1FVACYFE0NHNH4037	230223	2022	SS	CC	4065	FS	3/23/2022	3/31/2022
1FVACYFE8NHNH4044	230357	2022	SS	CC	4065	FS	2/11/2022	2/21/2022
1FVACYFE4MHMA9395	230169	2021	SS	CC	4051	FS	9/14/2020	9/22/2020
3ALACYFE7NDNH4011	230338	2022	SS	CC	4059	FS	11/16/2021	11/30/2021
1FVACYFE2LHLP3287	230105	2020	SS	CC	4061	FS	9/25/2019	10/7/2019
1FVACYFE3LHLP3296	230140	2021	SS	CC	4051	FS	1/9/2020	1/16/2020
1FVACYFE8MHMA9416	230182	2021	SS	CC	4061	FS	1/5/2021	1/14/2021
1FVACYFE1MHMA9418	230168	2021	SS	CC	3746	FS	12/7/2020	12/15/2020
1FVACYFE4MHMV0937	230194	2021	SS	CC	4061	FS	3/9/2021	3/17/2021
1FVACYFE9MHMA9389	230155	2021	SS	CC	4051	FS	8/28/2020	9/8/2020
3ALACYFE9LDLP3275	230116	2020	SS	CC	3746	FS	8/22/2019	8/29/2019

VIN Number	Prod#	Year	Brand	Type	Floor	Chassis	Date In	Date Off
3ALACYFE4LDLP3281	230115	2020	SS	CC	3746	FS	12/5/2019	12/13/2019
1FVHC5DV6NHNH4026	270157	2022	SA	CC	4573	FS	4/25/2022	5/3/2022
1FVACYFE9NHNH4022	230356	2022	SS	CC	4059	FS	12/16/2021	1/12/2022
1FVACYFE6LHLP3289	230137	2020	SS	CC	4061	FS	10/21/2019	10/29/2019
1FVHC5DVXNHNH3564	270142	2022	SA	CC	4573	FS	7/23/2021	8/2/2021
3ALHC5DV5KDLG8908	270101	2020	SA	CC	4573	FS	6/11/2019	6/20/2019
1FVACYFE8LHLP3262	230109	2020	SS	CC	4061	FS	11/4/2019	11/14/2019
1FVACYFE6MHMA9415	230163	2021	SS	CC	4061	FS	1/13/2021	1/20/2021
1FVACYFE7NHNH4021	230354	2022	SS	CC	4059	FS	1/20/2022	2/8/2022
1FVHC5DV9MHMA9408	270127	2021	SA	CC	4573	FS	5/20/2021	5/28/2021
1FVACYFE8MHMA9397	230178	2021	SS	CC	4051	FS	9/28/2020	10/7/2020
3ALACYFE9MDMY0201	230216	2021	SS	CC	4051	FS	4/21/2021	4/29/2021
1FVHC5DV9NHNH4053	270192	2022	SA	CC	4575	FS	6/2/2022	6/14/2022
1FVHC5DV7LHLP3270	270115	2021	SA	CC	4575	FS	12/19/2019	1/14/2020
3ALACYFEXNDNH3998	230340	2022	SS	CC	4059	FS	11/18/2021	12/1/2021
3ALACYFE4NDNH3995	230237	2022	SS	CC	4065	FS	10/18/2021	10/27/2021
1FVHC5DV0LHLP3272	270106	2020	SA	CC	4573	FS	3/11/2020	3/19/2020
1FVACYFE2PHNL7742	230269	2022	SS	CC	4059	FS	6/16/2022	6/23/2022
1FVACYFE4LHLP3257	230103	2020	SS	CC	4061	FS	7/12/2019	7/22/2019
1FVHC5DV5MHMA9423	270129	2021	SA	CC	4051	FS	5/14/2021	5/21/2021
1FVACYFE4MHMA9400	230176	2021	SS	CC	3746	FS	10/15/2020	10/23/2020
1FVACYFE2LHLP3256	230133	2020	SS	CC	4051	FS	7/31/2019	8/8/2019
1FVACYFE3PHNL7734	230381	2022	SS	CC	4065	FS	5/23/2022	6/3/2022
1FVACYFE4NHNL7710	230333	2022	SS	CC	4065	FS	3/16/2022	3/28/2022
1FVACYFE3MHMA9405	230170	2021	SS	CC	4061	FS	10/23/2020	11/3/2020
1FVACYFE0LHLP3255	230114	2020	SS	CC	4061	FS	7/9/2019	7/16/2019
1FVHC5DV9MHMA9392	270124	2021	SA	CC	4573	FS	10/1/2020	10/19/2020
1FVACYFE6NHNC3528	230252	2022	SS	CC	4059	FS	6/21/2021	6/30/2021
3ALHC5DV6NDNH3996	270183	2022	SA	CC	4573	FS	2/8/2022	2/15/2022
1FVACYFE9PHNL7737	230383	2022	SS	CC	4059	FS	6/8/2022	6/17/2022
1FVACYFE0MHMT2208	230219	2021	SS	CC	3746	FL	5/18/2021	5/25/2021
1FVACYFE9MHMA9411	230161	2021	SS	CC	4058	FS	11/18/2020	12/8/2020
3ALACYFE3NDNH3986	230240	2022	SS	CC	4065	FS	9/22/2021	9/30/2021
3ALHC5DV3NDNH4006	270189	2023	SA	CC	4530	FS	2/21/2022	3/3/2022
3ALACYFE6NDNH4002	230355	2022	SS	CC	3727	FS	11/22/2021	12/3/2021
3ALACYFE4LDMG5955	230124	2020	SS	CC	3746	FS	2/26/2020	3/5/2020
1FVACYFE9PHNL7723	230255	2022	SS	CC	4059	FS	4/20/2022	4/28/2022
1FVACYFE1LHLP3264	230138	2020	SS	CC	4058	FS	11/26/2019	12/9/2019
1FVACYFEXLHLP3294	230130	2020	SS	CC	4051	FS	2/17/2020	2/26/2020
1FVACYFE5MHMA9387	230136	2020	SS	CC	4051	FS	5/13/2020	5/26/2020
1FVHC5DV9MHMA9425	270138	2022	SA	CC	4573	FS	7/16/2021	7/26/2021
3ALHC5DV1NDNH4005	270146	2022	SA	CC	4051	FS	10/26/2021	11/5/2021
1FVACYFE0PHNL7724	230368	2022	SS	CC	4059	FS	4/22/2022	4/29/2022
1FVACYFE6LHLP3261	230132	2020	SS	CC	4051	FS	10/23/2019	10/31/2019
1FVACYFE4NHNC3530	230251	2022	SS	CC	4061	FS	6/29/2021	7/14/2021
1FVACYFE1MHMA9421	230192	2021	SS	CC	4051	FS	2/9/2021	2/18/2021
1FVHC5DV7MHMA9391	270120	2021	SA	CC	4573	FS	9/16/2020	9/24/2020
1FVACYFE5MHMA9406	230181	2021	SS	CC	3746	FS	10/28/2020	11/6/2020
3ALHC5DV9NDNH3989	270168	2022	SA	CC	4575	FS	9/30/2021	10/12/2021
1FVACYFE2MHMA9413	230171	2021	SS	CC	4061	FS	12/1/2020	12/11/2020
1FVACYFE1LHLP3250	230123	2020	SS	CC	3746	FS	10/1/2019	10/9/2019

VIN Number	Prod#	Year	Brand	Type	Floor	Chassis	Date In	Date Off
1FVACYFE0LHLP3269	230148	2020	SS	CC	4061	FS	2/28/2020	3/10/2020
1FVACYFE9NHNH4036	230348	2022	SS	CC	4061	FS	1/20/2022	2/7/2022
1FVACYFE4LHLP3288	230107	2020	SS	CC	4061	FS	10/10/2019	10/18/2019
3ALHC5DV8LDLP3249	270105	2020	SA	CC	4573	FS	9/6/2019	9/17/2019
1FVHC5DV9NHNS1437	270185	2022	SA	CC	4590	FS	12/1/2021	12/9/2021
1FVACYFE3MHMA9386	230129	2020	SS	CC	4051	FS	5/7/2020	5/15/2020
1FVHC5DV0NHNH4054	270186	2022	SA	CC	4573	FS	6/7/2022	6/15/2022
1FVACYFEXLHLP3263	230139	2020	SS	CC	4061	FS	11/19/2019	11/27/2019
1FVACYFE3NHNH4016	230351	2022	SS	CC	4059	FS	1/10/2022	1/20/2022
1FVACYFEXNHNC3533	230329	2022	SS	CC	4065	FS	10/13/2021	10/25/2021
1FVACYFE9NHNH4019	230349	2022	SS	CC	4061	FS	1/12/2022	1/21/2022
3ALHC5DV2LDLP2663	270102	2020	SA	CC	4573	FS	6/25/2019	7/10/2019
1FVACYFE1MHMA9385	230110	2020	SS	CC	4061	FS	3/24/2020	5/8/2020
1FVACYFE9LHLP3285	230128	2020	SS	CC	4051	FS	9/3/2019	9/10/2019
1FVHC5DV2NHNH4055	270181	2022	SA	CC	4061	FS	5/18/2022	5/25/2022
1FVACYFE4LHLP3260	230106	2020	SS	CC	4061	FS	10/3/2019	10/14/2019
1FVACYFE5LHLP3283	230127	2020	SS	CC	4051	FS	8/15/2019	8/22/2019
3ALACYFE4LDLP3278	230126	2020	SS	CC	3746	FS	11/14/2019	11/21/2019
1FVACYFE3NHNH4033	230258	2022	SS	CC	3727	FS	1/27/2022	2/11/2022
1FVACYFE1MHMR7844	230210	2022	SS	CC	3727	FS	2/2/2021	2/10/2021
3ALHC5DV5NDNH3987	270144	2022	SA	CC	4061	FS	9/10/2021	9/22/2021
1FVACYFE9LHLP3271	230135	2020	SS	CC	4051	FS	2/24/2020	3/3/2020
1FVACYFEXMHMR7843	230204	2022	SS	CC	4059	FS	1/18/2021	1/25/2021
3ALHC5DV1MDMY2105	270128	2021	SA	CC	4061	FS	6/9/2021	6/17/2021
3ALACYFE9NDNH3992	230337	2022	SS	CC	4059	FS	10/27/2021	11/8/2021
1FVACYFE8LHLP3259	230113	2020	SS	CC	4061	FS	8/28/2019	9/6/2019
3ALACYFE2LDLP3280	230125	2020	SS	CC	3746	FS	10/31/2019	11/12/2019
3ALACYFE1NDNH3985	230275	2022	SS	CC	4059	FS	9/28/2021	10/7/2021
1FVACYFE8PHNW3973	230375	2023	SS	CC	4059	FS	3/4/2022	3/14/2022
1FVACYFE4MHMV0940	230196	2021	SS	CC	4061	FS	4/7/2021	4/15/2021
1FVACYFE0MHMA9426	230195	2021	SS	CC	4051	FS	2/11/2021	2/22/2021
3ALACYFE8LDMG5957	230154	2021	SS	CC	3746	FS	8/3/2020	8/11/2020
1FVACYFE2NHNH4024	230341	2022	SS	CC	4061	FS	12/9/2021	1/4/2022
1FVACYFE1NHNH4046	230358	2022	SS	CC	4059	FS	2/15/2022	2/24/2022
1FVACYFE9MHMT2210	230197	2021	SS	CC	4061	FS	2/15/2021	2/24/2021
3ALACYFE2NDNH3977	230250	2022	SS	CC	3727	FS	9/1/2021	9/9/2021
3ALHC5DV2NDNH4014	270175	2022	SA	CC	4590	FS	11/15/2021	11/24/2021
3ALACYFE2NDNH3980	230274	2022	SS	CC	4059	FS	9/29/2021	10/11/2021
1FVACYFE1MHMU9809	230193	2021	SS	CC	4051	FS	3/4/2021	3/12/2021
1FVACYFE1NHNH4029	230350	2022	SS	CC	3727	FS	3/8/2022	3/16/2022
1FVACYFE4NHNH4025	230353	2022	SS	CC	3727	FS	2/23/2022	3/7/2022
1FVACYFE1LHLP3295	230145	2021	SS	CC	3746	FS	1/13/2020	1/21/2020
1FVACYFE4NHNC3527	230294	2022	SS	CC	4059	FS	8/3/2021	8/10/2021
3ALACYFE9LDMG5952	230159	2021	SS	CC	4051	FL	8/11/2020	8/20/2020
1FVACYFE1MHMA9399	230153	2021	SS	CC	3746	FS	9/22/2020	10/1/2020
1FVACYFE7MHMA9388	230152	2021	SS	CC	4051	FS	8/24/2020	9/2/2020
1FVACYFE9MHMT2207	230202	2021	SS	CC	3746	FS	2/23/2021	3/5/2021
3ALHC5DV3MDMY2106	270132	2021	SA	CC	4051	FS	6/3/2021	6/10/2021
1FVHC5DV4MHMR7837	270131	2022	SA	CC	4590	FS	3/3/2021	3/11/2021
1FVACYFE0PHNL7741	230380	2022	SS	CC	4059	FS	6/1/2022	6/9/2022
1FVHC5DV7LHLP3267	270108	2020	SA	CC	4573	FS	11/21/2019	12/4/2019

VIN Number	Prod#	Year	Brand	Type	Floor	Chassis	Date In	Date Off
3ALACYFE4MDMY0199	230206	2021	SS	CC	3746	FS	5/11/2021	5/19/2021
1FVACYFE0NHNH7719	230298	2022	SS	CC	3727	FS	6/14/2022	6/21/2022
1FVACYFE3NHNH4047	230362	2022	SS	CC	4061	FS	2/14/2022	2/22/2022
1FVACYFE7LHLP3284	230104	2020	SS	CC	4061	FS	7/23/2019	7/31/2019
1FVHC5DV4NHNH4056	270176	2022	SA	CC	4051	FS	5/25/2022	6/8/2022
1FVACYFE8MHMV0939	230218	2021	SS	CC	4061	FS	4/5/2021	4/13/2021
1FVACYFE4NHNH4039	230295	2022	SS	CC	4059	FS	3/21/2022	3/31/2022
1FVACYFE7NHNH4049	230299	2022	SS	CC	4065	FS	3/7/2022	3/15/2022
1FVHC5DV5LHLP3252	270116	2021	SA	CC	4051	FS	2/4/2020	2/12/2020
1FVACYFEXNHNH4045	230372	2022	SS	CC	4059	FS	2/23/2022	3/8/2022
1FVACYFE0MHMA9412	230165	2021	SS	CC	4061	FS	11/16/2020	12/2/2020
1FVHC5DV3NHNH3566	270148	2022	SA	CC	4573	FS	7/27/2021	8/4/2021
1FVACYFE8NHNH3546	230253	2022	SS	CC	3727	FS	8/18/2021	8/30/2021
1FVACYFE1MHMA9404	230177	2021	SS	CC	4061	FS	10/13/2020	10/21/2020
1FVACYFE5NHNH4051	230266	2022	SS	CC	4061	FS	3/14/2022	3/23/2022
1FVACYFE9PHNL7740	230382	2022	SS	CC	4065	FS	6/9/2022	6/20/2022
1FVHC5DV0NHNH4023	270190	2023	SA	CC	4065	FS	3/2/2022	3/10/2022
3ALACYFE0LDLP3276	230118	2020	SS	CC	3746	FS	9/5/2019	9/12/2019
1FVACYFE2PHNL7725	230374	2022	SS	CC	4065	FS	4/19/2022	4/26/2022
1FVACYFE7NHNH7717	230330	2022	SS	CC	3727	FS	5/2/2022	5/11/2022
1FVACYFE9NHNH7718	230335	2022	SS	CC	3727	FS	5/11/2022	5/19/2022
1FVACYFE6PHNL7744	230371	2022	SS	CC	4065	FS	6/21/2022	7/12/2022
1FVACYFEXNHNH7713	230297	2022	SS	CC	4059	FS	4/11/2022	4/22/2022
1FVACYFE2PHNW3936	230373	2023	SS	CC	3729	FS	3/3/2022	3/11/2022
1FVACYFE4PHNL7743	230310	2022	SS	CC	4061	FS	6/15/2022	6/22/2022
1FVACYFE5NHNH4034	230361	2022	SS	CC	3727	FS	3/31/2022	4/14/2022
1FVACYFE5PHNL7735	230305	2022	SS	CC	4065	FS	5/25/2022	6/7/2022
1FVACYFE8NHNH7712	230306	2022	SS	CC	4065	FS	4/6/2022	4/20/2022
1FVHC5DV8MHMA9402	270122	2021	SA	CC	4575	FS	10/6/2020	10/14/2020
1FVACYFE6PHNL7727	230271	2022	SS	CC	4059	FS	5/13/2022	5/23/2022
1FVACYFE7NHNS1436	230260	2022	SS	CC	3727	FS	4/14/2022	4/25/2022

CANADIAN Units

1FVACYFE3NHNH4050	230322	2022	SS	CC	4065	FS	3/9/2022	3/17/2022
3ALACYFE0NDNH3993	230276	2022	SS	CC	3727	FS	10/14/2021	10/26/2021
1FVACYFE6MHMT2214	230158	2021	SS	CC	4061	FS	3/15/2021	3/23/2021
1FVHC5DV1NHNH4032	270179	2022	SA	CC	4573	FS	5/20/2022	6/1/2022
1FVHC5DV5LHLP3266	270107	2020	SA	CC	4573	FS	10/15/2019	10/22/2019
1FVACYFE3NHNH3535	230268	2022	SS	CC	4059	FS	9/8/2021	9/16/2021
3ALACYFE5NDNH3990	230273	2022	SS	CC	3727	FS	10/12/2021	10/21/2021
1FVACYFE7NHNH4035	230321	2022	SS	CC	3727	FS	3/30/2022	4/13/2022
3ALACYFE7MDMY0200	230203	2021	SS	CC	4061	FS	4/13/2021	4/20/2021
1FVACYFE9LHLP3268	230147	2020	SS	CC	4061	FS	3/3/2020	3/12/2020
3ALACYFE9MDMY0196	230200	2021	SS	CC	3746	FS	3/18/2021	3/26/2021
3ALACYFE0MDMY0197	230166	2021	SS	CC	3746	FS	4/29/2021	5/7/2021
1FVACYFEXMHMA9420	230172	2021	SS	CC	3746	FS	1/22/2021	2/1/2021
3ALACYFE6LDMG5956	230157	2021	SS	CC	3746	FS	6/19/2020	7/15/2020