



ITEM #	QTY	NEWMAR #	DESCRIPTION
3	1	145641	Wheel Well Liner — Pass. Front
4	1	145642	Wheel Well Liner — Pass. Rear


Material: 20 GA Galv.

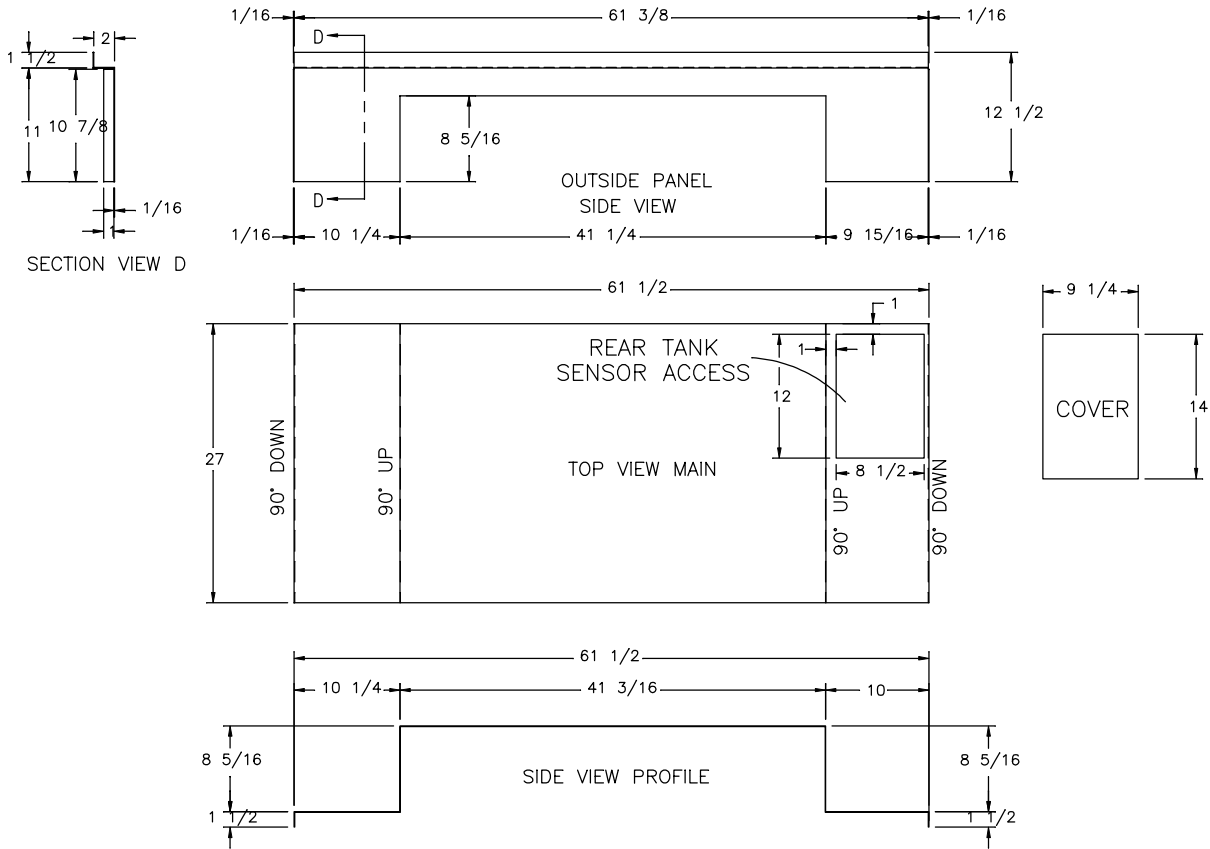




\*Overall part length not to exceed 61 1/2"

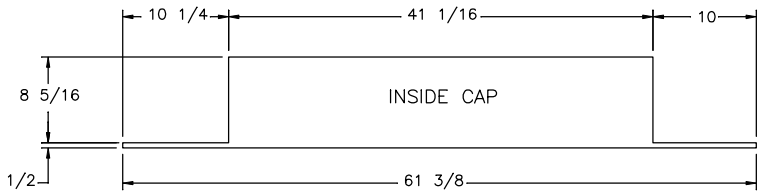


PASSENGER SIDE REAR

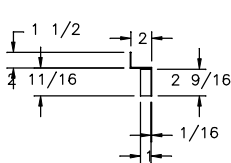

SECTION VIEW B

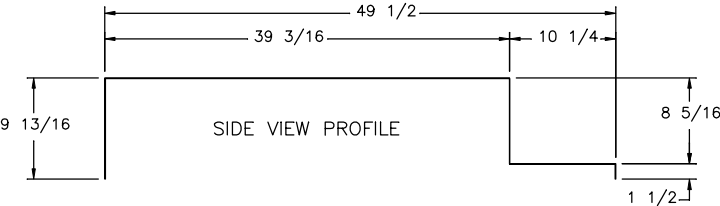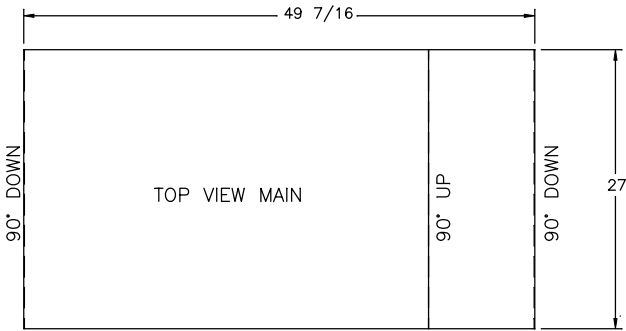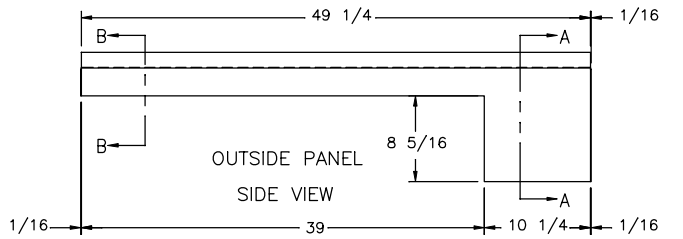


\*Overall part length not to exceed 49 1/2"

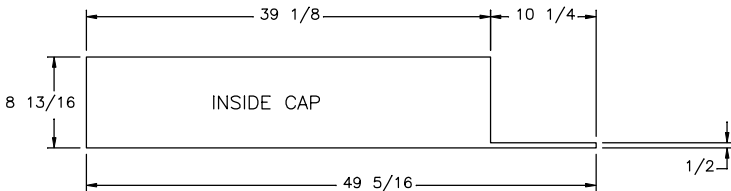

PASSENGER SIDE FRONT

<b>NEWMAR CORP</b> P.O. Box 30, Nappanee, IN. 46550  UNITS: INCHES TITLE BLOCK: 5TB	Model:	Sheet	Drawn by:	Checked by:	Revision:	By:
	SACC	2 OF 3	R. W.	R. R.	Added 8 x12 cutout to passenger rear well liner for access to	R. W.
	Title:	I.D. # 2020\	Date:	Date:	rear holding tank sensor; Added 9 1/4 x 14 cover for access hole (PCR #200993)	Date:RR 5/28/19
	WHEEL WELL LINER	CC\FRAME\SA\WHEEL_WELL_LINER	4/18/19	4/26/19	Revision:	By:
						Date:

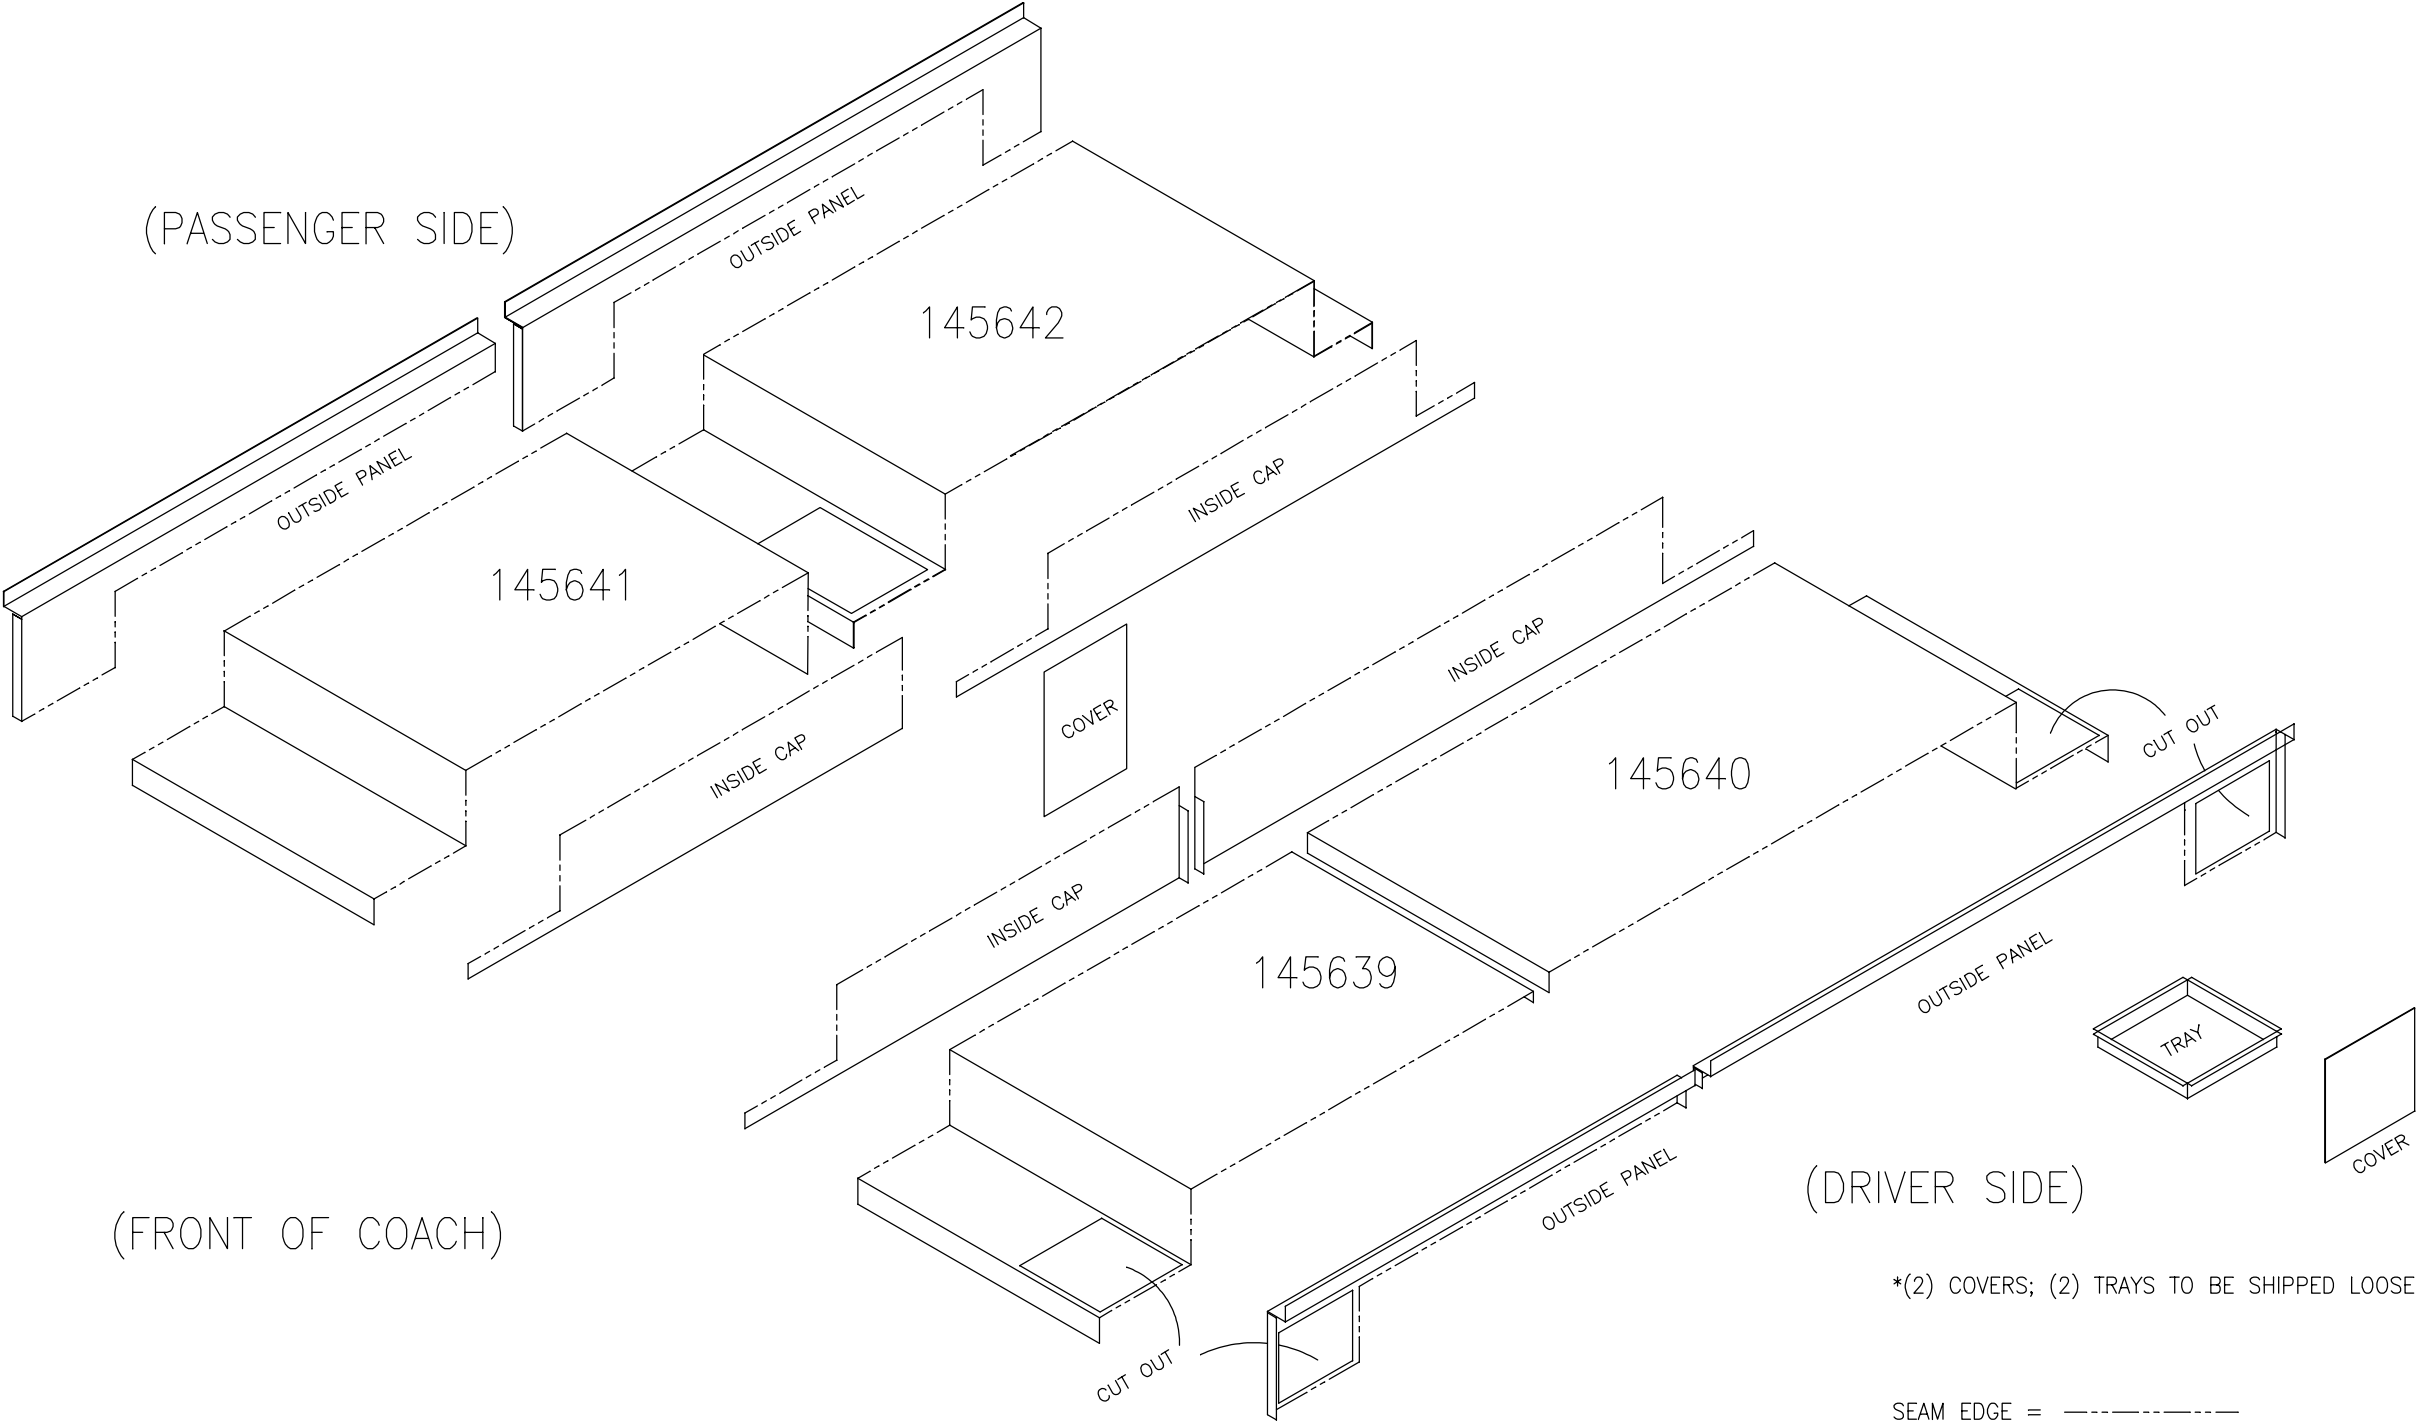

**NEWMAR CORP**  
P.O. Box 30,  
Nappanee, IN. 46550

Model: SACC  
Title: WHEEL WELL LINER

Sheet 3 OF 3  
I.D. # 2020\CC\FRAME\SA\WHEEL\_WELL\_LINER

Drawn by: R. W.  
Date: 4/18/19

Checked by: R. R.  
Date: 4/26/19

Revision: Added 8 x12 cutout to passenger rear well liner for access to rear holding tank sensor; Added 9 1/4 x 14 cover for access hole (PCR #200993)  
Revision:

By: R. W.  
Date: RR 5/28/19  
By:  
Date:

UNITS: INCHES  
TITLE BLOCK: 5TB

\*(2) COVERS; (2) TRAYS TO BE SHIPPED LOOSE  
SEAM EDGE = - - - - -