

NEWMAR CORPORATION

WARRANTY

DEPARTMENT

TECHNICAL SERVICE BULLETIN

DATE ISSUED**MODEL YEAR(S) AFFECTED****TSB #**

12/27/2017

2017, 2018

490

MODEL

Bay Star Sport	☐	Ventana	☐	Essex	☒
Bay Star	☐	Dutch Star	☐	King Aire	☒
Canyon Star	☐	Mountain Aire	☐	New Aire	☐
Ventana LE	☐	London Aire	☒	Other	☐

DESCRIPTION

Newmar has decided to install an override switch for the HWH step to provide a way to operate the step from inside the coach in the event of a sensor or door switch failure.

Issue: In the event of a step failure, the person(s) inside the coach would have a large gap between the door threshold and the ground. The person(s) may have to exit via the large gap or the emergency exit door to get out of the coach.

Correction: The step controller will be replaced and an override switch will be installed on the passenger side console.

Refer to the attached population list for the affected coach and VIN numbers.

RECOMMENDED ACTION

Verify that the coach does not already have an override switch on the passenger console. Call your Service Account Manager for authorization and necessary parts. Follow the attached instructions to install and test the override switch.

Flat Rate Code: TSB 490 **Labor Time:** 3.0 hr.

Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.

How to Install an HWH Step Override Switch

Relevant Coaches

Model: King Aire, Essex, London Aire

Year(s): 2017, 2018

Floorplan: All

Issue

TSB 490 provides instructions for installing an HWH step override switch.

Action

Follow the service procedure below to correct the condition. The approximate time to complete this repair is three hours (3.0 hr).

Necessary Tools & Replacement Parts

Screw Gun with Square and Phillips Bits
Drill with Step Style Drill Bit
Wire Stripper
Wire Crimper
7/16" Nut Driver
Caulk Gun
Tape Measure
Fish Tape



Part Name	Part Quantity	Newmar Part Number
HWH Miom	1 ea	025009
Push Button Switch	1 ea	132719
5 Amp ATC Fuse	1 ea	107160
Fuse Holder	1 ea	22620
Blue Butt Connector	1 ea	107151
Blue Female Spade Terminal	1 ea	107187
Bell Connector	2 ea	41969
Ring Terminal Blue with 1/4" Hole	1 ea	22664

# 8 x 5/8" Washer Head Screw	.001 ea	11870
7" Cable Ties	12 ea	10643
Piggyback Terminal	1 ea	25878
Relay with Harness	1 ea	12707
16 Gauge Brown Wire	35 ft	20907
1/4" Flexible Conduit	35 ft	138810
Black Silicone	1 ea	24114
Black Tape	1 roll	10645

Service Procedure

Installing the Switch

1. Mark the switch location.

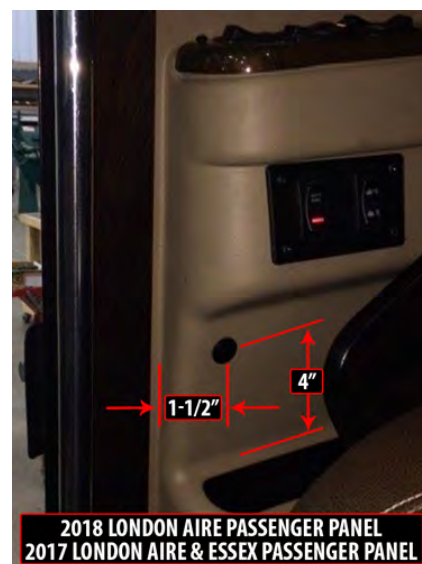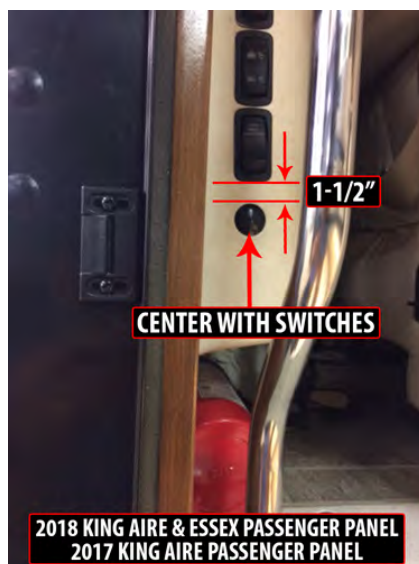


2. Remove the passenger side console panel from the wall. Some screws may be hidden by covers held on by Velcro.
3. Pull out enough of the panel to access the wires.
4. Using the drill and step bit, drill a 3/4" hole for switch. Make sure the wiring is out of the way of the drill bit.
5. Check the switch fit often to make sure the hole is not too large.
6. Install the switch, and tighten it in place.



Preparing the Wire


7. Prepare the 16 gauge brown wire by wrapping the wire with the flexible conduit, and tape it as needed.

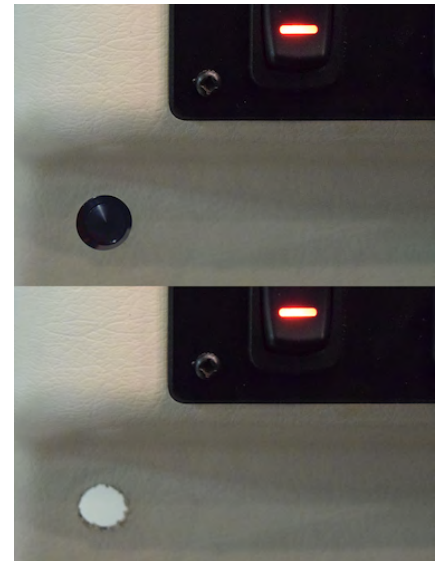

8. Run the wire and strap it along the following path:
 - From the driver's front fuse panel
 - Out the back around the frame rail to the front
 - Across the firewall
 - Down the passenger frame rail
 - To the passenger side wheel well
 - Up in the front corner of the wheel
 - Into the passenger side console.

Note: Make sure the wire is tucked and secured along the frame rail beside the generator area to ensure the generator can slide in and out without interference from the new wire.



9. Make a loop of wire in the passenger side console (enough to get to the switch).
10. Run the wire around the wheel well and down the frame rail to the first compartment just above the Miom.
11. Strap the wire up with cable ties as needed.

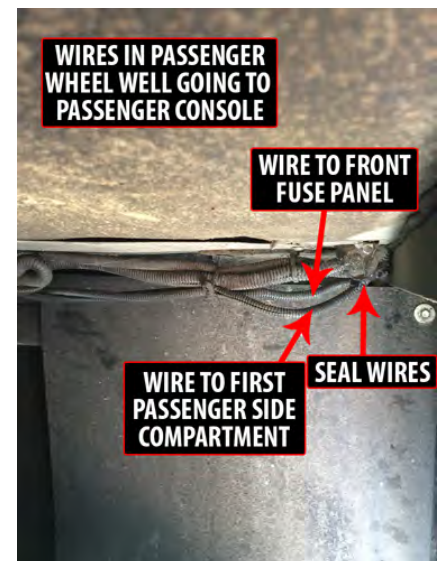


12. Drill a hole for the wire and loom.
13. Pull the wire through the hole using fish tape (if needed).
14. Remove the current Miom, and install a new Miom, which has a wire in the brown connector to pin 11.

Note: There are four black connectors with the same plug, so make sure to plug them in correctly. Two of them are marked for step in and out. The other two are not marked on the coach harness side. Mark them or unplug them, and only hook up one at a time.


15. Cut the wire at pin 11 on the plug, and then hook up to the 16 gauge brown wire ran from the passenger side console.

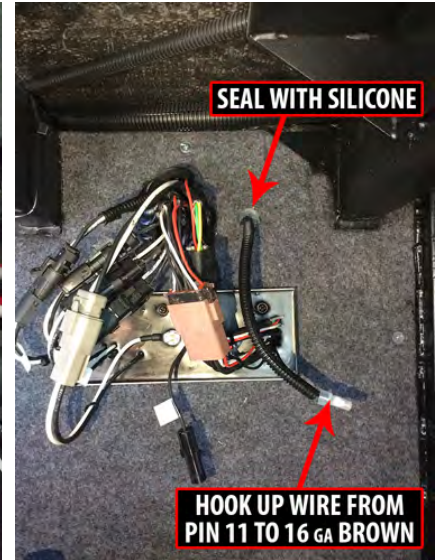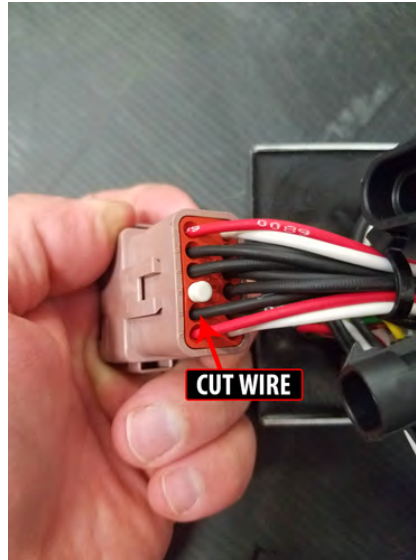

16. Seal the hole, loom, inside of the loom, inside of the compartment, and the outside of the compartment.
17. Seal the wire leading up to the passenger console in the wheel well area.
18. Seal the wire leading through the front driver side electrical compartment.
19. Mark (label) the wire at each end.

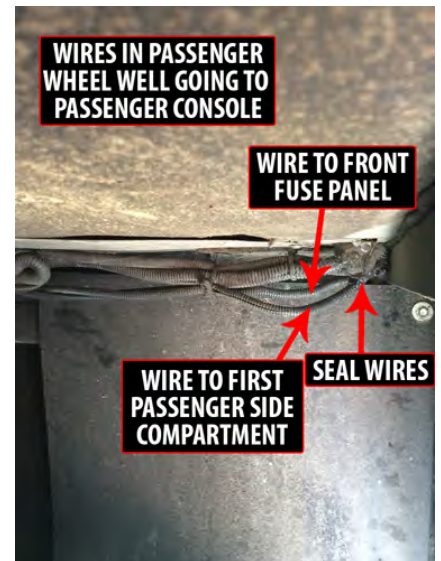


20. Cut the wire loop at the console in half.
21. Strip each wire end back, and hook up one 16 gauge brown wire to each terminal on the switch previously installed in the console.
22. Secure the console to the wall.
23. Reinstall any covers that were previously removed.

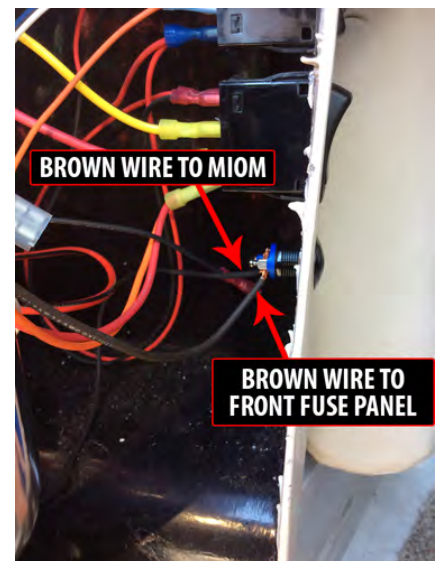


Preparing the Relay

1. Cut the fuse holder wire in half, and strip the wire ends.
2. Hook the red and orange relay wire together, and connect them to one side of the fuse holder.
3. Install a ring terminal on the other side of the fuse holder.
4. Install a female spade terminal on the white wire.
5. Install the piggyback terminal on the white wire.
6. Crimp a blue butt connector onto the brown relay wire.
7. Label the fuse holder "Step Override."

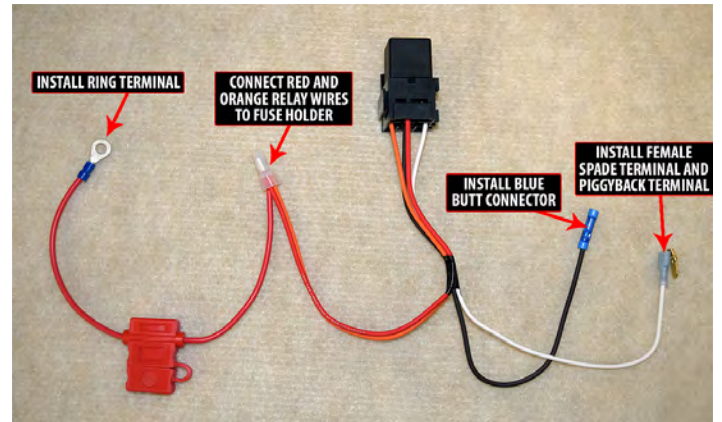

Installing the Relay

1. Pull the relay out of the harness, and fasten the harness with a screw.
2. Insert the relay back into the harness.
3. Hook up the brown relay wire to the 16 gauge brown wire leading to the passenger console with a blue butt connector.
4. Remove the wire from terminal J7 on the fuse panel.
5. Slide the piggyback terminal on J7, and attach the wire onto the piggyback terminal on J7.
6. Hook up the ring terminal attached to the fuse holder to the J10 battery terminal on the fuse panel.
7. Install the five amp fuse in the fuse holder.

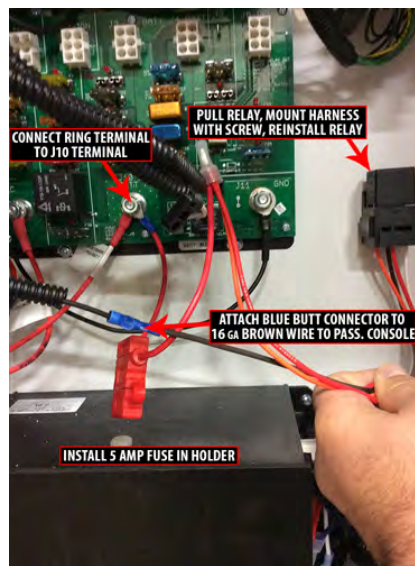

Testing the Switch Operation

1. With the park brake set and the door shut (with the step retracted), the override switch should extend the step.



Make sure the path of the step is clear. Pressing the override switch disables the curb and shin guard sensors. Stop the step before it contacts any objects or the ground. Failure to do so may result in severe damage to the step or contacted objects. Using the override switch will extend the step during switch activation at any time unless the park brake is released. Releasing the park brake will disable the override switch.

Production #	VIN Number	Year	Brand	Type	Floor Plan	Chassis Brand	Date In Production	Date Off Production
501327	4VZVU1E90HC081288	2017	LA	DP	4513	S	12/9/2015	12/16/2015
501337	4VZVU1E94HC081133	2017	LA	DP	4553	S	2/10/2016	2/18/2016
501339	4VZVU1E99HC082214	2017	LA	DP	4533	S	5/12/2016	5/20/2016
501440	4UZFBG3HCHZ7804	2017	LA	DP	4553	FL	5/31/2016	6/9/2016
501441	4UZFBG1HCHZ7803	2017	LA	DP	4553	FL	5/24/2016	6/2/2016
501442	4VZVU1E94HC082217	2017	LA	DP	4533	S	5/27/2016	6/8/2016
501443	4VZVU1E95HC082663	2017	LA	DP	4519	S	9/12/2016	9/20/2016
501444	4VZVU1E96HC082882	2017	LA	DP	4519	S	10/24/2016	11/1/2016
501445	4VZVU1E95HC082436	2017	LA	DP	4553	S	6/24/2016	7/12/2016
501446	4VZVU1E98HC082446	2017	LA	DP	4519	S	7/11/2016	7/19/2016
501447	4VZVU1E96HC082445	2017	LA	DP	4519	S	6/3/2016	6/13/2016
501448	4UZFBG0HCJA0484	2017	LA	DP	4553	FL	6/13/2016	6/21/2016
501449	4UZFBG9HCJA4758	2017	LA	DP	4519	FL	7/13/2016	7/21/2016
501450	4UZFBG8HCJC3155	2017	LA	DP	4519	FL	8/15/2016	8/22/2016
501451	4UZFBG9HCJC3156	2017	LA	DP	4533	FL	8/18/2016	8/25/2016
501452	4UZFBG9HCJA2887	2017	LA	DP	4519	FL	6/28/2016	7/14/2016
501453	4UZFBG8HCJA2886	2017	LA	DP	4513	FL	6/13/2016	6/22/2016
501454	4VZVU1E97HC082437	2017	LA	DP	4519	S	6/29/2016	7/15/2016
501455	4UZFBG7HCJC0649	2017	LA	DP	4553	FL	8/9/2016	8/17/2016
501456	4UZFBG8HCJC3110	2017	LA	DP	4553	FL	8/1/2016	8/8/2016
501457	4UZFBG4HCJA6756	2017	LA	DP	4533	FL	7/14/2016	7/22/2016
501458	4VZVU1E93HC082502	2017	LA	DP	4539	S	8/10/2016	8/18/2016
501459	4UZFBG6HCJA6757	2017	LA	DP	4519	FL	7/26/2016	8/3/2016
501460	4UZFBG1HCJC3157	2017	LA	DP	4519	FL	8/19/2016	8/29/2016
501461	4VZVU1E96HC082641	2017	LA	DP	4519	S	9/7/2016	9/15/2016
501462	4VZVU1E91HC082613	2017	LA	DP	4519	S	8/26/2016	9/6/2016
501463	4VZVU1E94HC082668	2017	LA	DP	4553	S	9/13/2016	9/21/2016
501464	4UZFBG4HCJD1348	2017	LA	DP	4525	FL	8/29/2016	9/7/2016
501465	4VZVU1E92HC082796	2017	LA	DP	4525	S	9/23/2016	10/3/2016
501466	4UZFBG5HCHX0278	2017	LA	DP	4553	FL	12/13/2016	12/20/2016
501467	4VZVU1E94HC082802	2017	LA	DP	4533	S	9/30/2016	10/10/2016
501468	4UZFBG9HCJC8180	2017	LA	DP	4519	FL	10/14/2016	10/24/2016
501469	4UZFBG6HCJD1349	2017	LA	DP	4553	FL	10/19/2016	10/27/2016
501470	4UZFBG0GCHV9302	2017	LA	DP	4535	FL	11/2/2016	11/10/2016
501471	4UZFBG3HCJC8179	2017	LA	DP	4553	FL	10/10/2016	10/17/2016
501472	4UZFBG5HCJE7011	2017	LA	DP	4519	FL	10/12/2016	10/20/2016
501473	4UZFBG3HCHX0280	2017	LA	DP	4519	FL	1/13/2017	1/20/2017
501474	4VZVU1E91HC083115	2017	LA	DP	4553	S	12/6/2016	12/14/2016
501478	4VZVU1E93HC082886	2017	LA	DP	4513	S	11/11/2016	11/21/2016
501479	4UZFBG2HCHY3568	2017	LA	DP	4519	FL	11/8/2016	11/16/2016
501480	4UZFBG4GCHW1411	2017	LA	DP	4519	FL	11/7/2016	11/15/2016
501481	4VZVU1E98HC083080	2017	LA	DP	4535	S	11/22/2016	12/1/2016
501482	4UZFBG1HCHX0276	2017	LA	DP	4519	FL	11/18/2016	11/29/2016
501483	4VZVU1E9XHC083081	2017	LA	DP	4535	S	11/29/2016	12/6/2016
501484	4VZVU1E91HC083308	2017	LA	DP	4553	S	2/8/2017	2/15/2017
501485	4VZVU1E99HC083153	2017	LA	DP	4519	S	12/20/2016	1/12/2017
501486	4VZVU1E9XHC083307	2017	LA	DP	4519	S	2/9/2017	2/16/2017
501487	4UZFBG7HCHX0279	2017	LA	DP	4553	FL	2/13/2017	2/20/2017
501488	4VZVU1E98HC083192	2017	LA	DP	4519	S	1/9/2017	1/17/2017
501489	4UZFBG8HCHY6233	2017	LA	DP	4513	FL	2/20/2017	2/27/2017
501490	4UZFBG7HCJF6664	2017	LA	DP	4553	FL	3/8/2017	3/16/2017
501491	4UZFBG3HCHX0277	2017	LA	DP	4525	FL	2/28/2017	3/8/2017
501492	4UZFBG1HCJG0712	2017	LA	DP	4519	FL	3/20/2017	3/27/2017
501493	4UZFBG0JCJD9866	2018	LA	DP	4531	FL	1/13/2017	1/23/2017
501494	4UZFBG1JCJN9984	2017	LA	DP	4519	FL	4/4/2017	4/12/2017
501495	4VZVU1E98HC083323	2017	LA	DP	4519	S	4/3/2017	4/10/2017

Production #	VIN Number	Year	Brand	Type	Floor Plan	Chassis Brand	Date In Production	Date Off Production
501496	4UZFBTGB9HCJF4379	2017	LA	DP	4519 FL		2/22/2017	3/2/2017
501497	4UZFBTGB5HCJF4380	2017	LA	DP	4533 FL		2/24/2017	3/3/2017
501498	4VZVU1E96JC082869	2018	LA	DP	4534 S		2/23/2017	3/3/2017
501499	4UZFBTGB9HCJF6665	2017	LA	DP	4519 FL		3/10/2017	3/20/2017
501500	4UZFBTFG3JCJP0405	2017	LA	DP	4553 FL		4/17/2017	4/25/2017
501501	4UZFBTFG5JCJP0406	2017	LA	DP	4519 FL		5/4/2017	5/12/2017
501502	4VZVU1E98HC083600	2017	LA	DP	4519 S		5/5/2017	5/15/2017
501503	4VZVU1E95HC083733	2017	LA	DP	4519 S		5/12/2017	5/22/2017
501504	4UZFBTFG5JCJR6603	2018	LA	DP	4531 FL		5/22/2017	6/2/2017
501506	4VZVU1E96JC084086	2018	LA	DP	4531 S		8/18/2017	8/28/2017
501507	4UZFBTFG1JCJR8347	2018	LA	DP	4535 FL		6/23/2017	7/11/2017
501508	4VZVU1E9XJC083765	2018	LA	DP	4531 S		6/12/2017	6/20/2017
501509	4UZFBTFG9JCJT1852	2018	LA	DP	4553 FL		7/21/2017	7/31/2017
501510	4VZVU1E9XJC084074	2018	LA	DP	4553 S		8/2/2017	8/10/2017
501513	4UZFBTFG6JCJU4946	2018	LA	DP	4534 FL		8/16/2017	8/24/2017
501516	4UZFBTFG1JCJS6791	2018	LA	DP	4534 FL		7/12/2017	7/20/2017
501518	4VZVU1E91JC083766	2018	LA	DP	4531 S		6/14/2017	6/22/2017
501519	4VZVU1E96JC083777	2018	LA	DP	4531 S		6/27/2017	7/14/2017
501520	4VZVU1E97JC083786	2018	LA	DP	4553 S		6/29/2017	7/18/2017
501525	4VZVU1E97JC083898	2018	LA	DP	4533 S		7/28/2017	8/7/2017
501531	4VZVU1E94JC084085	2018	LA	DP	4553 S		8/14/2017	8/22/2017
501535	4UZFBTFG3JCJT8411	2018	LA	DP	4553 FL		8/7/2017	8/15/2017
530361	4VZVU1E92HC081132	2017	KG	DB	4519 S		1/22/2016	2/1/2016
530365	4VZVU1E90HC081131	2017	KG	DB	4584 S		2/9/2016	2/17/2016
530371	4VZVU1E92HC082216	2017	KG	DB	4519 S		5/13/2016	5/25/2016
530372	4VZVU1E92HC082278	2017	KG	DB	4519 S		7/12/2016	7/20/2016
530373	4VZVU1E90HC082277	2017	KG	DB	4584 S		6/20/2016	6/28/2016
530374	4VZVU1E95HC082369	2017	KG	DB	4519 S		8/2/2016	8/10/2016
530375	4VZVU1E98HC082219	2017	KG	DB	4533 S		7/28/2016	8/5/2016
530376	4VZVU1E99HC082939	2017	KG	DB	4553 S		11/1/2016	11/9/2016
530377	4VZVU1E95HC082498	2017	KG	DB	4513 S		8/15/2016	8/23/2016
530378	4VZVU1E98HC082558	2017	KG	DB	4519 S		8/25/2016	9/2/2016
530379	4VZVU1E9XHC082559	2017	KG	DB	4533 S		8/30/2016	9/8/2016
530380	4VZVU1E94HC082797	2017	KG	DB	4553 S		9/21/2016	9/29/2016
530381	4VZVU1E95HC082565	2017	KG	DB	4553 S		9/14/2016	9/22/2016
530382	4VZVU1E91HC082370	2017	KG	DB	4519 S		9/16/2016	9/26/2016
530383	4VZVU1E96HC082803	2017	KG	DB	4519 S		9/26/2016	10/4/2016
530384	4VZVU1E98HC082804	2017	KG	DB	4519 S		9/29/2016	10/7/2016
530385	4VZVU1E94HC082833	2017	KG	DB	4519 S		10/13/2016	10/21/2016
530386	4VZVU1E95HC082887	2017	KG	DB	4584 S		10/11/2016	10/19/2016
530387	4VZVU1E9XHC083193	2017	KG	DB	4533 S		12/22/2016	1/16/2017
530388	4VZVU1E9XHC082805	2017	KG	DB	4519 S		10/5/2016	10/13/2016
530389	4VZVU1E96HC083045	2017	KG	DB	4519 S		12/1/2016	12/9/2016
530390	4VZVU1E90HC083154	2017	KG	DB	4519 S		12/21/2016	1/13/2017
530391	4VZVU1E97HC082888	2017	KG	DB	4519 S		10/20/2016	10/28/2016
530392	4VZVU1E96HC082669	2017	KG	DB	4519 S		10/18/2016	10/26/2016
530393	4VZVU1E94HC083044	2017	KG	DB	4519 S		11/28/2016	12/5/2016
530394	4VZVU1E98HC082978	2017	KG	DB	4519 S		10/24/2016	11/1/2016
530397	4VZVU1E9XHC083114	2017	KG	DB	4598 S		12/14/2016	12/21/2016
530398	4VZVU1E9XHC082982	2017	KG	DB	4519 S		11/15/2016	11/22/2016
530399	4VZVU1E90HC083221	2017	KG	DB	4519 S		1/11/2017	1/19/2017
530400	4VZVU1E99HC083007	2017	KG	DB	4584 S		11/17/2016	11/28/2016
530401	4VZVU1E97HC083006	2017	KG	DB	4519 S		11/22/2016	12/2/2016
530402	4VZVU1E95HC083411	2017	KG	DB	4533 S		3/9/2017	3/17/2017
530403	4VZVU1E92HC083222	2017	KG	DB	4519 S		1/30/2017	2/7/2017
530404	4VZVU1E93HC083083	2017	KG	DB	4519 S		12/7/2016	12/15/2016

Production #	VIN Number	Year	Brand	Type	Floor Plan	Chassis Brand	Date In Production	Date Off Production
530405	4VZVU1E90HC083526	2017	KG	DB	4553	S	3/17/2017	3/27/2017
530406	4VZVU1E92HC083298	2017	KG	DB	4533	S	2/9/2017	2/17/2017
530407	4VZVU1E99JC082865	2018	KG	DB	4534	S	1/16/2017	1/24/2017
530408	4VZVU1E95HC083246	2017	KG	DB	4519	S	2/1/2017	2/9/2017
530409	4VZVU1E93HC083441	2017	KG	DB	4519	S	3/15/2017	3/23/2017
530410	4VZVU1E9XHC083310	2017	KG	DB	4513	S	3/7/2017	3/15/2017
530411	4VZAU1D91HC083440	2017	KG	DB	4598	S	3/13/2017	3/21/2017
530412	4VZVU1E96JC083763	2017	KG	DB	4519	S	5/30/2017	6/7/2017
530413	4VZVU1E95HC083537	2017	KG	DB	4519	S	3/28/2017	4/5/2017
530414	4VZVU1E92JC082867	2018	KG	DB	4531	S	2/21/2017	3/1/2017
530415	4VZVU1E91HC083566	2017	KG	DB	4519	S	4/7/2017	4/18/2017
530416	4VZVU1E95HC083585	2017	KG	DB	4584	S	4/12/2017	4/21/2017
530417	4VZVU1E9XHC083565	2017	KG	DB	4519	S	4/3/2017	4/11/2017
530418	4VZVU1E9XHC083601	2017	KG	DB	4519	S	4/24/2017	5/2/2017
530419	4VZVU1E98HC083645	2017	KG	DB	4519	S	5/1/2017	5/9/2017
530420	4VZVU1E97HC083586	2017	KG	DB	4519	S	4/18/2017	4/26/2017
530421	4VZVU1E9XJC083779	2018	KG	DB	4531	S	5/23/2017	6/5/2017
530422	4VZVU1E95HC083649	2017	KG	DB	4519	S	5/9/2017	5/17/2017
530427	4VZVU1E91JC083881	2018	KG	DB	4531	S	6/9/2017	6/19/2017
530428	4VZVU1E90JC083788	2018	KG	DB	4531	S	6/2/2017	6/12/2017
530429	4VZVU1E91JC083900	2018	KG	DB	4531	S	6/19/2017	6/28/2017
530430	4VZVU1E90JC083953	2018	KG	DB	4531	S	7/14/2017	7/27/2017
530431	4VZVU1E98JC084011	2018	KG	DB	4534	S	7/24/2017	8/1/2017
530433	4VZVU1E91JC084089	2018	KG	DB	4553	S	8/9/2017	8/17/2017
530437	4VZVU1E95JC084077	2018	KG	DB	4531	S	7/31/2017	8/8/2017
530442	4VZVU1E93JC083901	2018	KG	DB	4531	S	6/26/2017	7/12/2017
530443	4VZVU1E9XJC084155	2018	KG	DB	4553	S	8/17/2017	8/24/2017
530444	4VZVU1E99JC083966	2018	KG	DB	4531	S	7/17/2017	7/25/2017
530445	4VZVU1E92JC083954	2018	KG	DB	4534	S	7/10/2017	7/18/2017
530446	4VZVU1E9XJC084088	2018	KG	DB	4534	S	8/8/2017	8/15/2017
530452	4VZVU1E98JC084154	2018	KG	DB	4531	S	8/14/2017	8/21/2017
801196	4VZVU1E99HC081130	2017	EX	DP	4553	S	12/14/2015	1/7/2016
801202	4UZFBTGB1HCHP4120	2017	EX	DP	4533	FL	2/2/2016	2/10/2016
801212	4VZVU1E9XHC082285	2017	EX	DP	4519	S	5/24/2016	6/3/2016
801213	4UZFBTGB1HCJA2888	2017	EX	DP	4519	FL	6/15/2016	6/23/2016
801214	4VZVU1E90HC082313	2017	EX	DP	4519	S	6/6/2016	6/15/2016
801215	4UZFBTGB0HCJA0503	2017	EX	DP	4519	FL	5/26/2016	6/6/2016
801216	4UZFBTGB0HCJA4759	2017	EX	DP	4519	FL	6/28/2016	7/14/2016
801217	4UZFBTGB5HCJB2274	2017	EX	DP	4533	FL	8/8/2016	8/16/2016
801218	4UZFBTGB8HCJA6758	2017	EX	DP	4519	FL	7/20/2016	7/27/2016
801219	4VZVU1E92HC082314	2017	EX	DP	4598	S	9/6/2016	9/14/2016
801220	4VZVU1E9XHC082450	2017	EX	DP	4553	S	9/9/2016	9/19/2016
801221	4VZVU1E94HC082556	2017	EX	DP	4519	S	10/6/2016	10/14/2016
801222	4VZVU1E91HC082563	2017	EX	DP	4533	S	11/10/2016	11/18/2016
801223	4VZVU1E96HC082557	2017	EX	DP	4519	S	10/27/2016	11/4/2016
801224	4UZFBTGB9HCJB3380	2017	EX	DP	4519	FL	11/4/2016	11/11/2016
801225	4UZFBTGB8HCHY0173	2017	EX	DP	4519	FL	1/19/2017	1/26/2017
801226	4VZVU1E98HC083113	2017	EX	DP	4519	S	12/15/2016	1/9/2017
801227	4VZVU1E91HC083082	2017	EX	DP	4519	S	11/22/2016	12/1/2016
801228	4UZFBTGBXHCJB8801	2017	EX	DP	4598	FL	10/28/2016	11/7/2016
801229	4VZVU1E9XHC082562	2017	EX	DP	4584	S	11/7/2016	11/15/2016
801230	4VZVU1E93HC083309	2017	EX	DP	4553	S	1/26/2017	2/3/2017
801231	4VZVU1E94HC083397	2017	EX	DP	4519	S	3/2/2017	3/10/2017
801232	4VZVU1E9XHC083324	2017	EX	DP	4553	S	2/16/2017	2/24/2017
801233	4VZVU1E93HC083245	2017	EX	DP	4553	S	1/24/2017	1/31/2017
801234	4VZVU1E91HC083325	2017	EX	DP	4553	S	2/27/2017	3/7/2017

Production #	VIN Number	Year	Brand	Type	Floor Plan	Chassis Brand	Date In Production	Date Off Production
801237	4VZVU1E96JC082872	2018	EX	DP	4531	S	3/22/2017	3/30/2017
801238	4UZFGT2JCD9867	2018	EX	DP	4536	FL	2/6/2017	2/13/2017
801239	4VZVU1E90JC082866	2018	EX	DP	4537	S	2/14/2017	2/21/2017
801240	4VZVU1E93HC083410	2017	EX	DP	4519	S	3/30/2017	4/7/2017
801241	4VZVU1E98GC083434	2017	EX	DP	4519	S	4/6/2017	4/17/2017
801242	4VZVU1E93HC083584	2017	EX	DP	4553	S	4/19/2017	4/27/2017
801243	4VZVU1E93HC083648	2017	EX	DP	4519	S	5/15/2017	5/23/2017
801244	4UZFTBG4HCHY3569	2017	EX	DP	4533	FL	4/27/2017	5/5/2017
801245	4UZFTBGXHCY6234	2017	EX	DP	4519	FL	5/3/2017	5/11/2017
801246	4UZFTBG0HCJF6666	2017	EX	DP	4519	FL	5/18/2017	5/30/2017
801247	4UZFTBG1HCJC8181	2017	EX	DP	4553	FL	5/11/2017	5/19/2017
801248	4UZFTFG7JCJR6604	2018	EX	DP	4553	FL	5/19/2017	6/1/2017
801250	4VZVU1E99JC083787	2018	EX	DP	4531	S	6/21/2017	6/29/2017
801253	4UZFTFG7JCJR3945	2018	EX	DP	4531	FL	6/15/2017	6/23/2017
801254	4VZVU1E98JC083778	2018	EX	DP	4531	S	6/7/2017	6/15/2017
801255	4VZVU1E96JC084010	2018	EX	DP	4534	S	7/28/2017	8/9/2017
801256	4UZFTFG3JCS6792	2018	EX	DP	4531	FL	6/28/2017	7/14/2017
801257	4VZVU1E99JC083899	2018	EX	DP	4553	S	7/11/2017	7/19/2017
801258	4VZVU1E93JC084076	2018	EX	DP	4531	S	8/18/2017	8/25/2017
801259	4VZVU1E91JC084075	2018	EX	DP	4531	S	8/4/2017	8/11/2017
801261	4UZFTFG5JCJT8412	2018	EX	DP	4531	FL	8/10/2017	8/18/2017
801263	4VZVU1E99JC083952	2018	EX	DP	4531	S	7/19/2017	7/27/2017
801264	4VZVU1E9XJC084009	2018	EX	DP	4531	S	7/26/2017	8/2/2017
801266	4UZFTFG0JCJT1853	2018	EX	DP	4553	FL	8/2/2017	8/10/2017
801268	4UZFTFG3JCU2250	2018	EX	DP	4531	FL	8/22/2017	8/30/2017